Integrated Waste Management Facilities, Phase 1

Appendix A Proposal for Review Baseline Marine Water Quality

22-AUG-2018	10:29	FROM E	EPD	ТО	25120427		P.01/01
本罟悩號 OUR REF: (19) in E 來函檔號	P2/G/G/131	Pt.15	Environment	al Protection Depart Branch(瑻镜保護署分處 ^{否港灣仔}
YOUR REF: KSZHJ\ 電話	//OUT/2018/07	7/03.01/000	3896	28th Floor, Southom	Centre,		軒尼討道
TEL. NO.: 2835	1127			130 Hennessy	Road,		一百三十號 修頓中心廿八欄
圖文傳商 FAX NO: 2591□ 電子郵件 E-MAIL: 網 址	0558	ľ	CEIVE	Wan Chai, Hong	Kong.		
HOMEPAGE: http://w	ww.epd.gov.hk	Ē	зү: <i>000 763</i>	-	By	22 Augus Fax 2512	

Keppel Seghers – Zhen Hua Joint Venture 19/F China Harbour Building 370-374 King's Road North Point, Hong Kong (Attn: Mr. CHUNG Tai Tung, Peter)

Dear Mr. CHUNG

Contract No. EP/SP/66/12 Integrated Waste Management Facilities Phase 1 Proposal for Review Baseline Marine Water Quality

I refer to your above referenced letter dated 14 August 2018 sending us the subject revised Proposal for Review Baseline Marine Water Quality.

Please note that we have no further comment on the Proposal.

The above is advisory and administrative in nature and shall not pre-empt any statutory decision under the EIA Ordinance. As pointed out to you previously, please be reminded to follow any necessary procedures and submission requirements under the EM&A programme controlled by the Further Environmental Permit No. FEP-01/429/2012/A for the IWMF Phase 1 project.

Yours sincerely,

(Raymond L. Y. LAI) Environmental Protection Officer for Director of Environmental Protection

<u>C.C.</u>	
SFG/EPD	(Attn: Mr. T. H. MAN)
DAFC	(Attn: Dr. Y. M. Mak)

Fax: 2411 3073 Fax: 2377 4427

c.c. Internal - E(RA)15, S(RS)5





吉寶西格斯-振華聯營公司 KEPPEL SEGHERS - ZHEN HUA JOINT VENTURE

PROPOSAL FOR REVIEW BASELINE MARINE WATER QUALITY

Document No.

KSZHJV	1	312	1		1	0001	/	В
Issuer		Project Code		Type of Document		Sequential No.		Revision Index

	Prepared by:	Approved by:	Certified by:	Verified by:
Name	Leo Chow	Peter Chung	Gabriel Lam	Mandy To
Position	Environmental Monitoring Manager (KSZHJV)	Project Manager (KSZHJV)	ETL (Acuity)	IEC (ERM)
Signature	Le	aller	(An)	Mandy 2.
Date:	10 August 2018	10 August 2018	14 August 2018	14 August 2018

© This document contains confidential and proprietary information belonging to Keppel Seghers - Zhen Hua Joint Venture and/or its affiliates. The contents of this document shall not be used for any other purpose than that for which they were provided. Any disclosure, copying, distribution or the taking of any action in reliance on the contents of this document is strictly prohibited. This document confers upon the recipient no right or license of whatsoever nature based on the information as described herein. If you have received this document in error, please immediately arrange for the return to Keppel Seghers - Zhen Hua Joint Venture or destruction of this document.

能資保護當 Environmental Protection Department

1

Contract No. EP/SP/66/12 Integrated Waste Management Facilities, Phase 1

В	Revised as per EPD's comment issued on 8 August 2018	10 August 2018
A	First Issue	11 July 2018
Rev.	Description of Modification	Date

Revision History



Response to Comment issued by EPD on 8/8/18

Query	Query EPD's Comment	KSZHJV's Response
1	Suggest deleting the word "impact" in front of "marine water quality monitoring data" for	Revised.
	the last para. of S.2 and S.4.2.	
2	The DO measuring equipment should be capable of measuring a DO level in the range of	Revised in Section 3.2.
	0-50mg/L not 0-20mg/L so as to consistent to the original baseline monitoring (i.e. dry	
	season).	
З	Please clarify if measurement of salinity in wet season will be carried out to derive action	Revised in Section 3.1, 3.2, 4.3 and
	and limit levels of salinity for brine water monitoring in operational phase as the same	Appendix A.
	exercise had been performed in dry season. If affirmative, relevant paras. about salinity	
	should be added in the proposal.	

读述编辑 Reveranmental Protection Department

Contract No. EP/SP/66/12 Integrated Waste Management Facilities, Phase 1

Table of Contents

1		INTRODUCTION0	
2		PURPOSE AND SCOPE0	
3		WATER QUALITY MONITORING REQUIREMENTS2	
	3.1	Water Quality Parameters to be Monitored2	
	3.2	Monitoring Equipment and Procedures2	
4		BASELINE MONITORING FOR WET SEASON	
	4.1	Purpose	
	4.2	Timing4	
	4.3	Monitoring Locations	
	4.4	Monitoring Procedures	
	4.5	Action and Limit Levels	
	4.6	Event and Action Plan7	
	4.7	Reporting11	

APPENDICES

A. Sample Record Sheet

FIGURE

- 1 Location Plan for Static Loading Test and DCM Site Trial
- 2 Monitoring Stations for Marine Water Quality

1 INTRODUCTION

The Government of Hong Kong SAR will develop the Integrated Waste Management Facilities (IWMF) Phase 1 (hereafter "the Project") with incineration to achieve substantial bulk reduction of unavoidable municipal solid waste (MSW) and to recover energy from the incineration process. The IWMF will be on an artificial island to be formed by reclamation at the south-western coast of Shek Kwu Chau. Keppel Seghers – Zhen Hua Joint Venture (KSZHJV) was awarded the contract under Contract No. EP/SP/66/12 Integrated Waste Management Facilities Phase 1 to construct and operate the Project.

An environmental impact assessment (EIA) study for the Project have been conducted and the EIA Report was approved under the Environmental Impact Assessment Ordinance on 17 January 2012. An Environmental Permit (EP) (EP No.: EP-429/2012) was granted to EPD on 19 January 2012 for the construction and operation of the Project. Subsequently, the EP was amended (EP No.: EP-429/2012/A) and a further EP (FEP) (EP No.: FEP-01/429/2012/A) was granted to the Keppel Seghers – Zhen Hua Joint Venture (KSZHJV) on 27 December 2017.

Baseline marine water quality monitoring was undertaken in accordance with the requirements provided in the EM&A Manual between 26 February and 26 March 2018. A Baseline Monitoring Report was submitted on 14 June 2018 to fulfill Condition 3.3 of the FEP. It is proposed to supplement the marine water quality monitoring data in wet season (April – September) so as to further improve the baseline data to take into account potential variations within a year due to natural fluctuations and also enhance the representativeness of the water quality monitoring parameters.

2 PURPOSE AND SCOPE

As the baseline marine water quality monitoring was undertaken during the dry season (October – March), it is proposed to supplement the marine water quality monitoring data in wet season (April – September) so as to further improve the baseline data to take into account potential variations within a year due to natural fluctuations and also enhance the representativeness of the water quality monitoring parameters.

Under the latest construction programme, DCM site trial shall be carried out in the designated location as shown in **Figure 1**.



The construction sequence of DCM site trial is summarized as below:

- 1. Carrying out site investigation to determine the property, grading, chemical composition of the sediment;
- 2. Obtaining sediment samples for laboratory investigation to produce design mix of cement slurry;
- 3. Laying geotextile and placing of sand blanket, with at least 2m thickness, to cover the seabed at the area where DCM site trial would be carried out;
- 4. Positioning of marine DCM barge;
- 5. Inserting piling pile of mixing treatment equipment into the soft layer at the designated level;
- 6. Pulling up of piling pipe together with the injection of cement slurry and mixing of soft material by the agitator;
- 7. Monitor, control, review and adjust the cement slurry content during mixing;
- 8. Repositioning of the marine DCM barge and repeat the mixing procedure until the required pattern of strengthened material is formed;
- 9. Wait for 28 days to allow cement mixed marine sediment to grow strength prior to conducting Unconfined Compressive Strength (UCS) Test; and
- 10. Coring out the cement mixed marine sediment to carry out UCS test and determine the mixing ratio of cement: marine sediment.

After obtaining the results from the UCS test, KSZHJV will conduct the static loading test at the designated location as shown in **Figure 1** and the construction sequence of static loading test is summarized as below:

- 1. Laying Geotextile at seabed;
- 2. Laying of sand blankets with at least 2m thickness on top of geotextile, cage type silt curtain shall be deployed while laying sand blanket;
- 3. Conduct DCM work, procedures as stated in Points 4 -8 of the construction sequence of DCM site trial, using the cement mixing ratio as determined by DCM site trial;
- 4. Laying Grade 400 aggregate on top of sand blanket to form a rubble mound, cage type silt curtain shall also be deployed while laying of Grade 400 aggregate; and
- 5. Placing concrete blocks on top of rubble mound to form a platform to install the survey monitoring equipment.

Therefore, it is proposed to make use of the marine water quality monitoring data to be collected in the period during cement mixed marine sediment to grow 28 days strength prior to conducting UCS test to represent the baseline monitoring data for wet season. At that period of time, the key construction activities will be operating at most 3 nos. of drill rigs for site investigation works. No marine construction works will be undertaken.



3 WATER QUALITY MONITORING REQUIREMENTS

3.1 Water Quality Parameters to be Monitored

The following water quality parameters to be monitored are summarized in Table 1.

Water Quality Parameters	Baseline Monitoring for Wet Season
Dissolved Oxygen (DO) / Dissolved	х
Oxygen Saturation (DO%)	
pH	х
Temperature	х
Turbidity	x
Suspended Solids (SS)	х
Water depth	Х
Salinity	х

 Table 1 – Water Quality Parameters

x – Parameters to be tested

3.2 Monitoring Equipment and Procedures

Monitoring of DO, DO%, pH, temperature, turbidity, water depth and salinity should be measured in-situ whereas SS should be sampled and then determined by laboratory. The equipment required for each type of monitoring are specified below.

Data record sheets shall be completed for each monitoring location. Sample data record sheets based on the one presented in the "EM&A Guideline for Development Projects in Hong Kong" are shown in **Appendix A**.

In-situ Monitoring

- Dissolved Oxygen Measuring Equipment the instrument should be portable and weatherproof using a DC power source. It should be capable of measuring a dissolved oxygen level in the range of 0-50mg/L and 0-200% saturation.
- pH Measuring Equipment a portable pH meter capable of measuring a range between 0.0 and 14.0 should be provided to measure pH under the specified conditions according to the Standard Methods, APHA.
- Temperature Measuring Equipment the instrument should be portable and weatherproof using a DC power source. It should be capable of measuring a temperature of 0-45 degree



Celsius with a capability of measuring to ± 0.1 degree Celsius.

- Turbidity Measuring Equipment the instrument should be portable and weatherproof using a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0-1000NTU.
- Positioning Device a hand held or boat fixed type differential Global Positioning System (dGPS) with way point bearing indication or other equivalent instrument of similar accuracy should be provided and used during monitoring to ensure the monitoring vessel is at the correct location before taking measurements
- Water Depth Detector a portable, battery-operated echo sounder should be used for the determination of water depth at each designated monitoring station. The unit would either be handheld or affixed to the bottom of the work boat, if the same vessel is to be used throughout the monitoring programme.
- Salinity the instrument should be portable and weatherproof using a DC power source. It should be capable of measuring salinity in the range 0-40ppt.

Calibration of In-situ Instruments

All in-situ monitoring instrument should be checked, calibrated and certified by a laboratory accredited under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) or other international accreditation scheme that is HOKLAS-equivalent before use, and subsequently re-calibrated at three monthly intervals throughout all stages of the water quality monitoring. Responses of sensors and electrodes should be checked with certified standard solutions before each use.

For the on-site calibration of field equipment, the BS 1427:2009, Guide to on-site test methods for the analysis of waters should be observed.

Sufficient stocks of spare parts should be maintained for replacements when necessary. Backup monitoring equipment should also be made available so that monitoring can proceed uninterrupted even when some equipment is under maintenance, calibration etc.

Water Samples for Laboratory Testing

Collection of Water Samples

Water samples for all monitoring parameters should be collected, stored, preserved and analysis according to the Standard Methods, APHA 22nd ed. and/or other methods as agreed by the EPD.

A water sampler comprises a transparent PVC cylinder, with a capacity of not less than two litres, and could be effectively sealed with latex cups at both ends should be used. The sampler should



have a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler is at the selected water depth. Kahlsico Water Sampler or a similar instrument approved by the ET and SO should be used.

Water samples should be stored in high density polythene bottles with no preservative added, packed in ice (cooled to 4 °C without being frozen), delivered to the laboratory within 24 hours of collection.

Laboratory Measurement / Analysis

Analysis of SS should be carried out in a HOKLAS accredited laboratory (or other international accredited laboratory that is HOKLAS-equivalent). Sufficient water samples should be collected at the monitoring stations for carrying out the laboratory determination. The laboratory determination work should start within 24 hours after receipt of the water samples. The analysis should follow the standard methods summarised in **Table 2**.

Table 2:Laboratory analysis for SS

Parameters	Instrumentation	Analytical Method	Reporting Limit
Suspended Solids (SS)	Analytical Balance	APHA 2540D	1 mg/L

Additional duplicate samples may be required by EPD for inter laboratory calibration. Remaining samples after analysis should be kept by the laboratory for three months in case repeat analysis is required.

4 BASELINE MONITORING FOR WET SEASON

4.1 Purpose

The purpose of the baseline monitoring for wet season is to supplement the baseline data to take into account the potential variations within a year due to natural fluctuations and to enhance the representativeness of the water quality monitoring parameters. These baseline conditions shall be established by measuring DO, DO%, pH, temperature, turbidity, salinity and SS at designated monitoring stations.

4.2 Timing

It is proposed to make use of the marine water quality monitoring data to be collected in the period during cement mixed marine sediment to grow 28 days strength prior to conducting UCS test to



represent the baseline monitoring data for wet season. At that period of time, the key construction activities will be operating approximately 3 nos. of drill rigs for site investigation works. No marine construction works will be undertaken.

4.3 Monitoring Locations

Baseline water quality for wet season will be measured at the monitoring stations as listed in **Table 3** and illustrated in **Figure 2**. The monitoring stations will be the same as those for the IWMF's marine water quality monitoring stations during construction phase. DO, DO%, pH, temperature, turbidity, salinity and SS are measured at all monitoring stations.

Table 3 – Proposed Monitoring Stations

Station	Description	Easting	Northing	Parameters
B1	Beach – Cheung Sha Lower	813342	810316	DO, DO%, pH, Temperature,
B2	Beach – Pui O	815340	811025	Turbidity, SS, Salinity
B3	Beach – Yi Long Wan	817210	808395	
B4	Beach – Tai Long Wan	817784	808682	
H1	Horseshoe Crab – Shek Kwu Chau	816477	806953	
C1	Control Station	810850	806288	
C2	Control Station	819421	808053	
F1	Cheung Sha Wan Fish Culture Zone	818631	810966	
S1	Submarine Cable Landing Site	814245	810335	
S2	Submarine Cable	815076	807747	
S3	Submarine Cable Landing Site	816420	805621	
CR1	Coral	817144	805597	
CR2	Coral	816512	805882	1
M1	Tung Wan	821572	807799	1

4.4 Monitoring Procedures

The measurements will be taken three days per week, at mid-flood and mid-ebb tides, for a period of four weeks when there are no marine construction activities to be carried out. The interval between two sets of monitoring will be not less than 36 hours.



Samples will be taken at three depths (at 1m below surface, at mid-depth, and at 1m above bottom) for locations with water depth >6m. For locations with water depth between 3m and 6m, two depths (surface and bottom) were taken. Locations with water depth< 3m, only surface depth will be taken. Duplicate water samples will be taken and analysed.

4.5 Action and Limit Levels

The Action and Limit levels are defined in Table 4 in accordance with the Updated EM&A Manual.

Parameters	Action Level	Limit Level
Construction Phase Impact Moni	toring	
DO in mg/L	\leq 5 percentile of baseline data	≤ 4 mg/L
Suspended Solids (SS) in mg/L	95 percentile of baseline data	99 percentile of baseline
	or 120% of upstream control	data or 130% of upstream
	station at the same tide at the	control station at the same
	same day, whichever is higher	tide of the same day,
		whichever is higher
Turbidity in NTU	95 percentile of baseline data	99 percentile of baseline
	or 120% of upstream control	data or 130% of upstream
	station at the same tide at the	control station at the same
	same day, whichever is higher	tide of the same day,
		whichever is higher
Operational Phase Impact Monit	oring	
Salinity in ppm	95 percentile of baseline data	99 percentile of baseline
	or 105% of upstream control	data or 109% of upstream
	station at the same tide at the	control station at the same
	same day, whichever is higher	tide of the same day,
		whichever is higher

Table 4 - Action and Limit Levels for Water Quality Parameters

Notes:

- 1. For DO, non-compliance of water quality results when monitoring results are lower than the limits.
- 2. Depth-averaged results are used unless specified otherwise
- 3. For SS and Turbidity, non-compliance of water quality results when monitoring results are higher than the limits.
- 4. Baseline data to be adopted in the marine water quality monitoring are specified in the Baseline Monitoring Report.
- 5. With reference to Plate 5b.8 of the approved EIA report EIA-201/2011, the upstream control station shall be C2 during flood tide and C1 during ebb tide.



Integrated Waste Management Facilities, Phase 1

4.6 Event and Action Plan

The actions in accordance with the Event and Action Plan in **Table 5** should be carried out if the water quality assessment criteria are exceeded at the impact monitoring stations.

		А	ction		
Event	Environmental Team	Independent	Supervising	KSZHJV	
	(ET)	Environmental	Officer (SO)		
		Checker (IEC)			
Action	1. Repeat in-situ	1. Discuss with	1. Discuss with IEC	1. Inform SO and	
level being	measurement to	ET and	on the proposed	confirm receipt of	
exceeded	confirm findings;	KSZHJV on the	mitigation	ET's notification of	
by one	2. Identify reasons for	mitigation	measures;	the non-compliance in	
sampling	non-compliance and	measures;	2. Make agreement	writing;	
day	sources of impact;	2. Review	on the mitigation	2. Rectify	
	3. Inform IEC and	proposals on	measures to be	unacceptable practice;	
	KSZHJV;	mitigation	implemented;	3. Check all plant and	
	4. Check monitoring	measures	3. Assess the	equipment;	
	data, all plant,	submitted by	effectiveness of the	4. Provide report of the	
	equipment and	KSZHJV and	implemented	status and condition of	
	KSZHJV's working	advise SO	mitigation	plant, equipment and	
	methods;	accordingly;	measures.	mitigation measures to	
	5. Discuss mitigation	3. Assess the		ET;	
	measures with IEC and	effectiveness of		5. Consider changes of	
	KSZHJV;	the implemented		working methods;	
	6. If not already	mitigation		6. Discuss with ET and	
	undertaking daily	measures.		IEC and propose	
	monitoring, increase			mitigation measures.	
	monitoring frequency.				

Table 5 - Event and Action Plan for Marine Water Quality Monitoring	Table 5 -	Event and	Action Pla	n for Marine	Water (Quality Monitoring
---	-----------	-----------	------------	--------------	---------	--------------------



Action			
Environmental Team	Independent	Supervising	KSZHJV
(ET)	Environmental	Officer (SO)	
	Checker (IEC)		
1. Repeat in-situ	1. Discuss with	1. Discuss with IEC	1. Inform SO and
measurement to	ET and	on the proposed	confirm receipt of
confirm findings;	KSZHJV on the	mitigation	ET's notification of
2. Identify reasons for	mitigation	measures;	the non-compliance in
non-compliance and	measures;	2. Make agreement	writing;
sources of impact;	2. Review	on the mitigation	2. Rectify
3. Inform IEC and	proposals on	measures to be	unacceptable practice;
KSZHJV;	mitigation	implemented;	3. Check all plant and
4. Check monitoring	measures	3. Assess the	equipment;
data, all plant,	submitted by	effectiveness of the	4. Provide report of the
equipment and	KSZHJV and	implemented	status and condition of
KSZHJV's working	advise SO	mitigation	plant, equipment and
methods;	accordingly;	measures.	mitigation measures to
5. Discuss mitigation	3. Assess the		ET;
measures with IEC and	effectiveness of		5. Consider changes of
KSZHJV;	the implemented		working methods;
	-		6. Discuss with ET and
measures are	measures.		IEC and propose
implemented;			mitigation measures to
			IEC and SO within 3
	1		working days;
			7. Implement the
			agreed mitigation
			measures.
			8. As directed by SO,
			to slow down all or
			part of the construction
			activities.
	(ET) 1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and KSZHJV; 4. Check monitoring data, all plant, equipment and KSZHJV's working methods; 5. Discuss mitigation measures with IEC and KSZHJV; 6. Ensure mitigation	Environmental TeamIndependent(ET)Environmental(ET)Checker (IEC)1. Repeat in-situ1. Discuss withmeasurement toET andconfirm findings;KSZHJV on the2. Identify reasons formeasures;sources of impact;2. Review3. Inform IEC andmeasures;4. Check monitoringmeasures;data, all plant,submitted byequipment andKSZHJV andKSZHJV's workingadvise SOmethods;3. Assess themeasures with IEC andStasses themeasures with IEC andintigationKSZHJV';intigationfuel to dy:3. Assess themethods;intigationfuel to dy:intigationfuel to dy:intigation<	Environmental Team (ET)Independent EnvironmentalSupervising Officer (SO)1. Checker (IEC)Checker (IEC)1. Discuss with IECneasurement toET andn the proposedconfirm findings;KSZHJV on the measures;measures;2. Identify reasons formitigationmeasures;sources of impact;2. Reviewon the mitigation3. Inform IEC andproposals on measures to beimplemented;4. Check monitoringmeasures3. Assess thedata, all plant,submitted by accordingly;effectiveness of the mitigation5. Discuss mitigation3. Assess themeasures;f. SZHJV;intigationmeasures,f. SZHJV's workingadvise SOmitigationmethods;3. Assess themeasures,f. Discuss mitigationmitigationmeasures,f. Ensure mitigationmitigationmeasures,measures with IEC andmeasures,intigationf. Discuss mitigationmeasures,intigationmeasures with IEC andffectiveness ofintigationf. Ensure mitigationmeasures,intigationmeasures aremeasures,intigationmeasures areintigationintigationmeasures areintigationintigationmeasures areintigationintigationmeasures, implemented;intigationintigationf. If not alreadyintigationintigationintigationintigationintigation



 $\hat{\mathbf{s}}$

Contract No. EP/SP/66/12 Integrated Waste Management Facilities, Phase 1

	Action			
Event	Environmental Team	Independent	Supervising	KSZHJV
	(ET)	Environmental	Officer (SO)	
		Checker (IEC)		
Limit Level	1. Repeat in-situ	1. Discuss with	1. Discuss with	1. Inform SO and
being	measurement to	ET and	IEC, ET and	confirm receipt of
exceeded	confirm findings;	KSZHJV on the	KSZHJV on the	ET's notification of
by one	2. Identify reasons for	mitigation	proposed mitigation	the non-compliance in
sampling	non-compliance and	measures;	measures;	writing;
day	sources of impact;	2. Review	2. Request	2. Rectify
	3. Inform IEC,	proposals on	KSZHJV to	unacceptable practice;
	KSZHJV and EPD;	mitigation	critically review the	3. Check all plant and
	4. Check monitoring	measures	working methods;	equipment;
	data, all plant,	submitted by	3. Make agreement	4. Provide report of the
	equipment and	KSZHJV and	on the mitigation	status and condition of
	KSZHJV's working	advise SO	measures to be	plant, equipment and
	methods;	accordingly;	implemented;	mitigation measures to
	5. Discuss mitigation	3. Assess the	4. Assess the	ET;
	measures with IEC,	effectiveness of	effectiveness of the	5. Consider changes of
	SO and KSZHJV;	the implemented	implemented	working methods;
	6. Ensure mitigation	mitigation	mitigation	6. Discuss with ET,
	measures are	measures.	measures.	IEC and SO and
	implemented;			propose mitigation
	7. If not already			measures to IEC and
	undertaking daily			SO within three
	monitoring, increase			working days;
	monitoring frequency.			7. Implement the
				agreed mitigation
				measures.



	Action			
Event	Environmental Team	Independent	Supervising	KSZHJV
	(ET)	Environmental	Officer (SO)	
		Checker (IEC)		
Limit Level	1. Repeat in-situ	1. Discuss with	1. Discuss with	1. Inform SO and
being	measurement to	ET and	IEC, ET and	confirm receipt of
exceeded	confirm findings;	KSZHJV on the	KSZHJV on the	ET's notification of
by more	2. Identify reasons for	mitigation	proposed mitigation	the non-compliance in
than one	non-compliance and	measures;	measures;	writing;
consecutive	sources of impact;	2. Review	2. Request	2. Rectify
sampling	3. Inform IEC,	proposals on	KSZHJV to	unacceptable practice;
days	KSZHJV and EPD;	mitigation	critically review the	3. Check all plant and
	4. Check monitoring	measures	working methods;	equipment;
	data, all plant,	submitted by	3. Make agreement	4. Provide report of the
	equipment and	KSZHJV and	on the mitigation	status and condition of
	KSZHJV's working	advise SO	measures to be	plant, equipment and
	methods;	accordingly;	implemented;	mitigation measures to
	5. Discuss mitigation	3. Assess the	4. Assess the	ET;
	measures with IEC,	effectiveness of	effectiveness of the	5. Consider changes of
	SO and KSZHJV;	the implemented	implemented	working methods;
	6. Ensure mitigation	mitigation	mitigation	6. Discuss with ET,
	measures are	measures.	measures;	IEC and SO and
	implemented;		5. Consider and	propose mitigation
	7. If not already		instruct, if	measures to IEC and
	undertaking daily		necessary, the	SO within three
	monitoring, increase		KSZHJV to slow	working days;
	monitoring frequency.		down or to stop all	7. Implement the
			or part of the	agreed mitigation
			construction	measures;
			activities until no	8. As directed by SO,
			exceedance of limit	to stop all or part of
			level.	the construction
				activities.



4.7 Reporting

The monitoring data to be collected at the baseline monitoring for wet season shall be used to supplement the baseline monitoring data to be collected between 26 February 2018 and 26 March 2018 so as to further improve the baseline data to take into account potential variations within a year due to natural fluctuations and also enhance the representativeness of the water quality monitoring parameters. Baseline Monitoring Report shall follow the relevant reporting requirements as specified in the EM&A Manual. The Baseline Monitoring Report shall be certified by ET leader and verified by the IEC.



3

3

Contract No. EP/SP/66/12 Integrated Waste Management Facilities, Phase 1

Appendix A

Sample Record Sheet

Water Quality Monitoring Data Record Sheet

ii)

Location			
Date			
Start Time (hh:mm)			
Weather			
Sea Conditions			
Tidal Mode			
Water Depth (m)	Water Depth (m)		
Monitoring Results		1 st reading	2 nd reading or Duplicate
Dissolved Oxygen	mg/L		
Dissolved Oxygen	%		
Saturation			
pН			
Turbidity	NTU		
Temperature	• C		
Suspended Solids	mg/L		
Salinity	ppt		
Observed construction	<100m from location		
activities	>100m from location		
Other Observations			

	Name & Designation	Signature	Date
Recorded by:			
Checked by:			




 $\widehat{\mathbf{x}}$

Contract No. EP/SP/66/12 Integrated Waste Management Facilities, Phase 1

Figure 1

Location Plan for Static Loading Test and DCM Site Trial

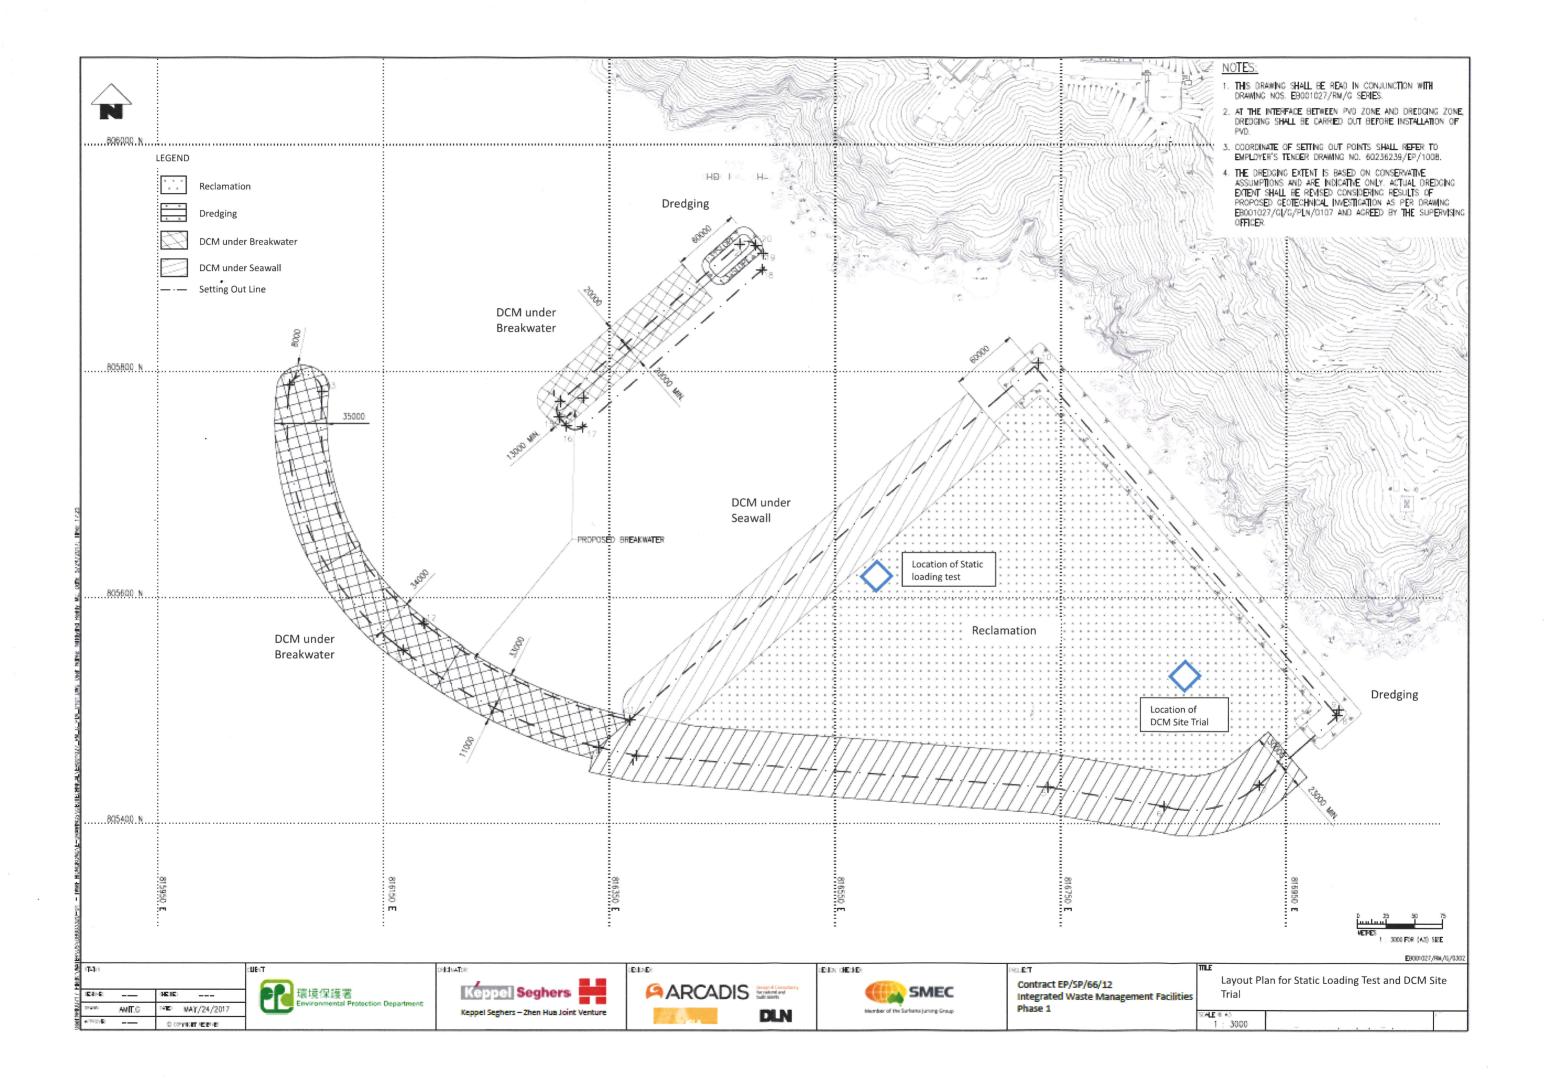



ž

Figure 2

Monitoring Stations for Marine Water Quality

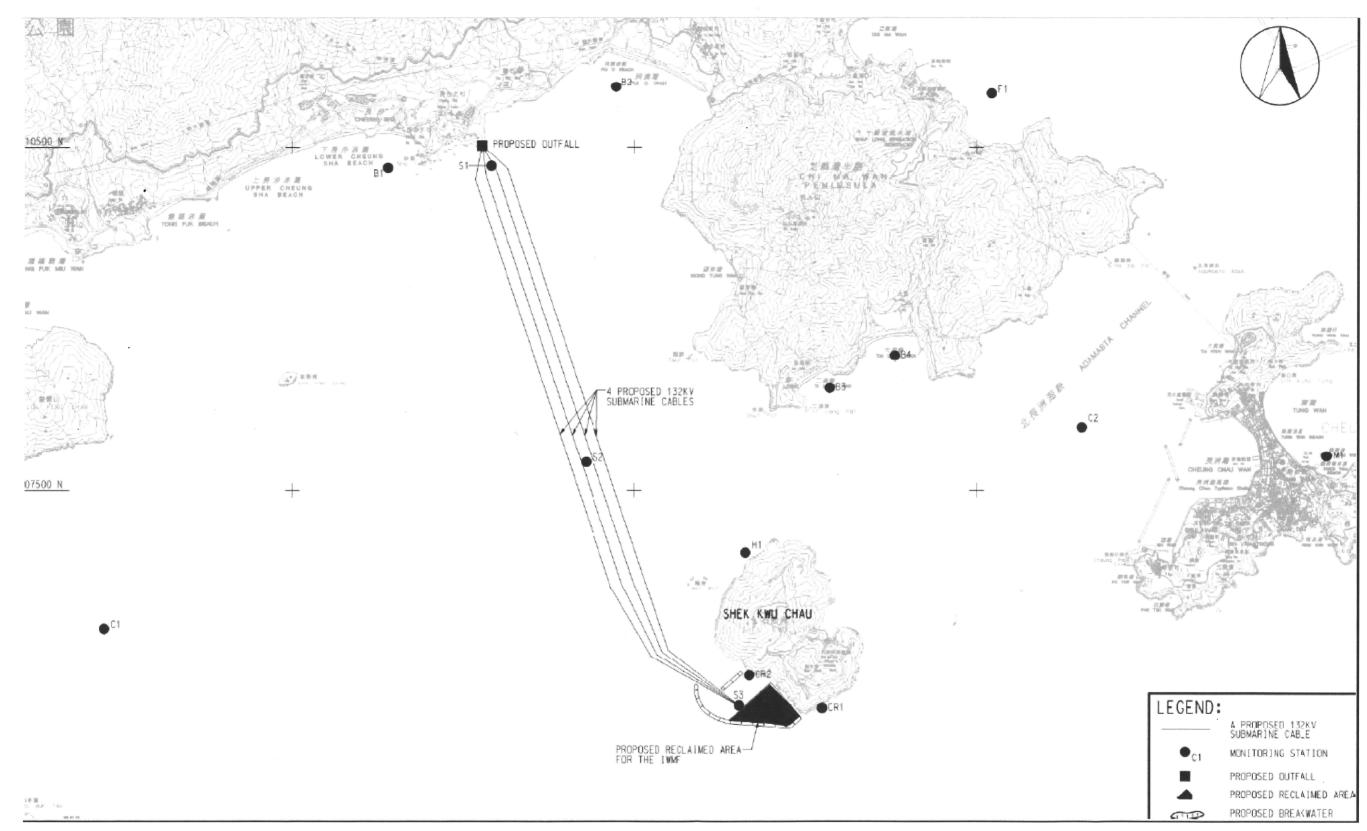


Figure 2 Monitoring Stations for Marine Water Quality