



Appendix D Noise Monitoring Data Trending


Impact Noise Monitoring Results during Day Time (0700 - 1900 hours)

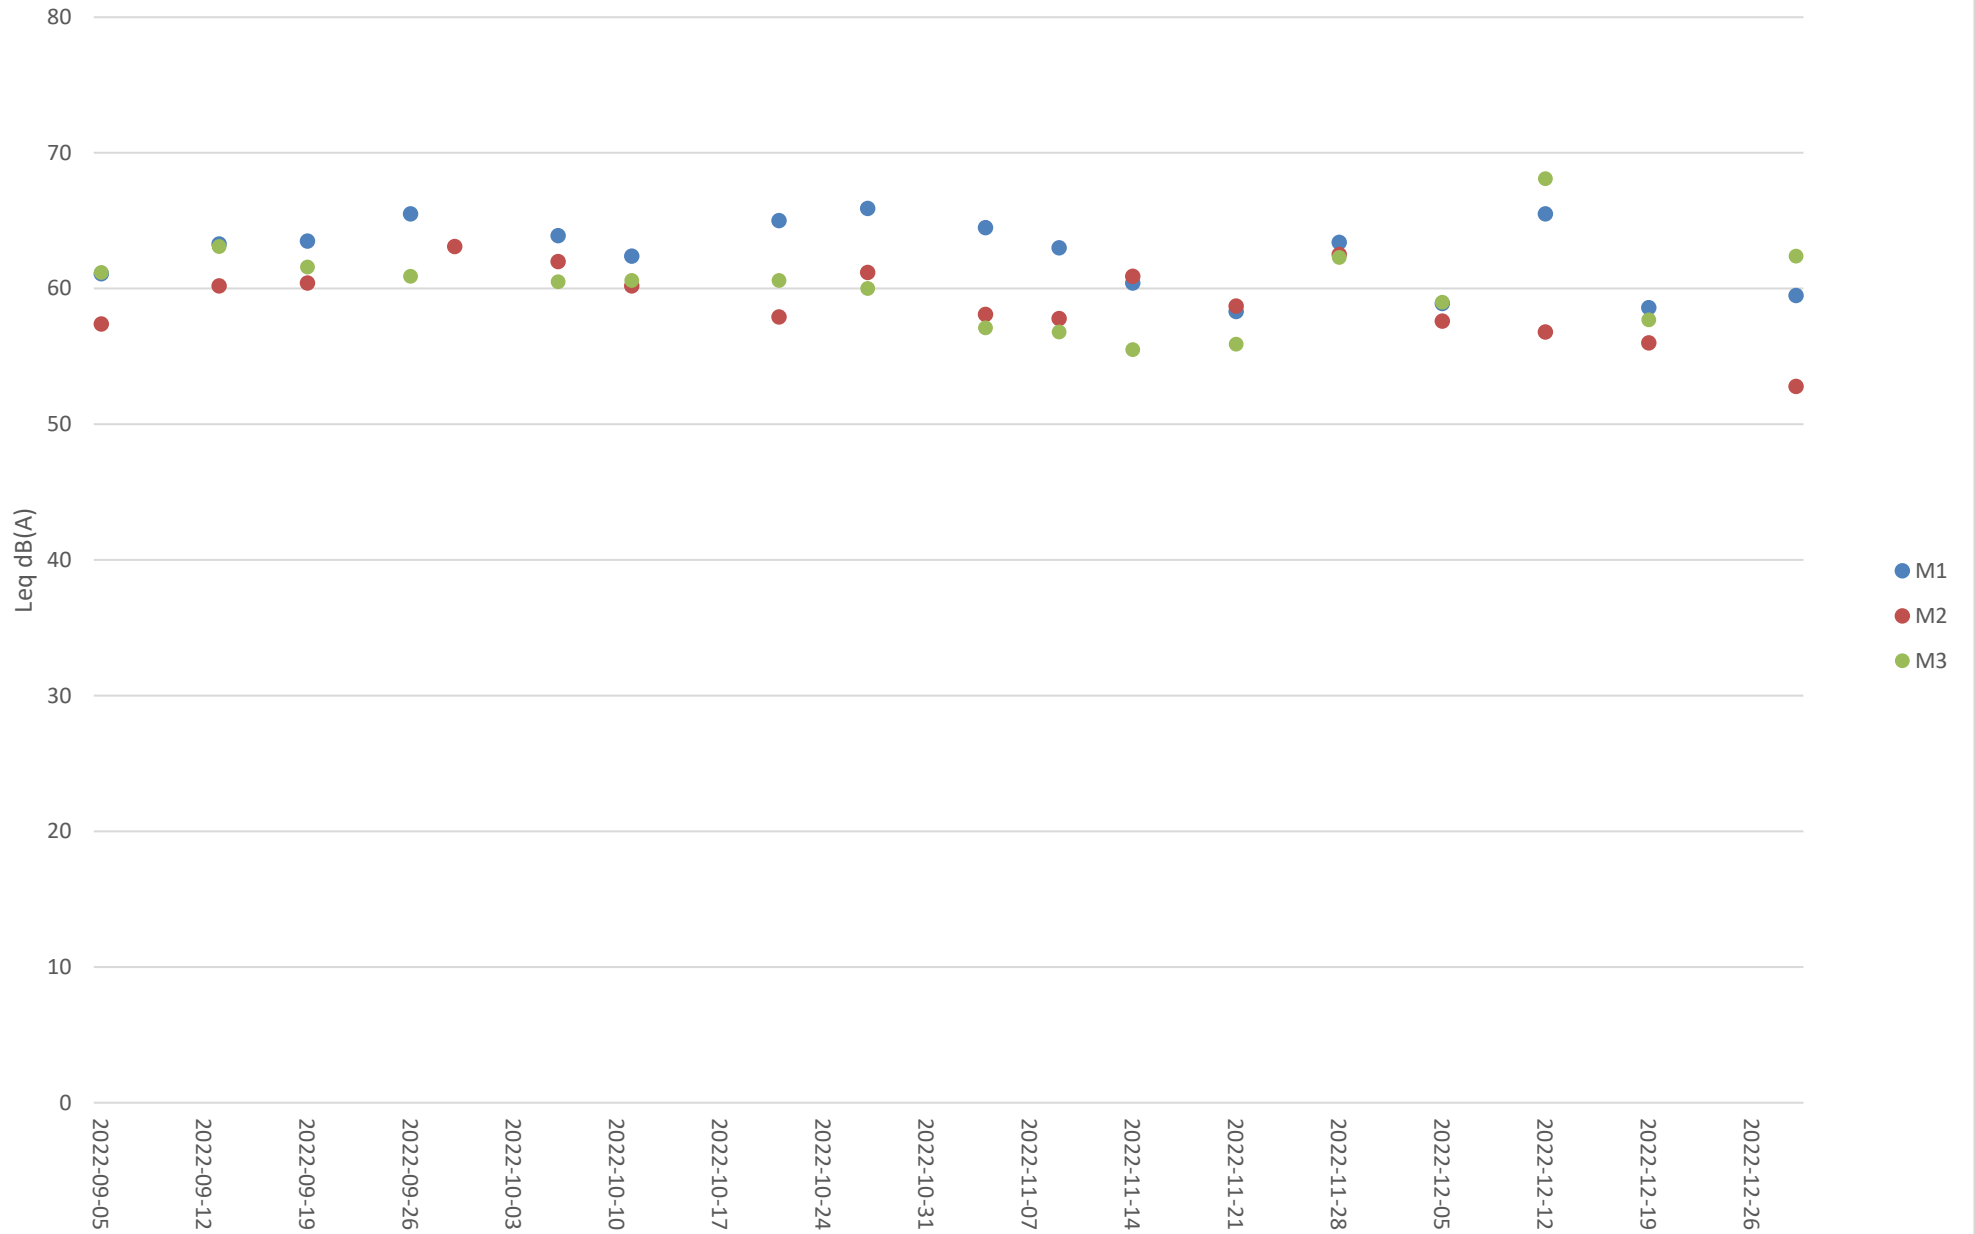

Additional Impact Noise Monitoring Results during Evening Time (1900 - 2300 hours)

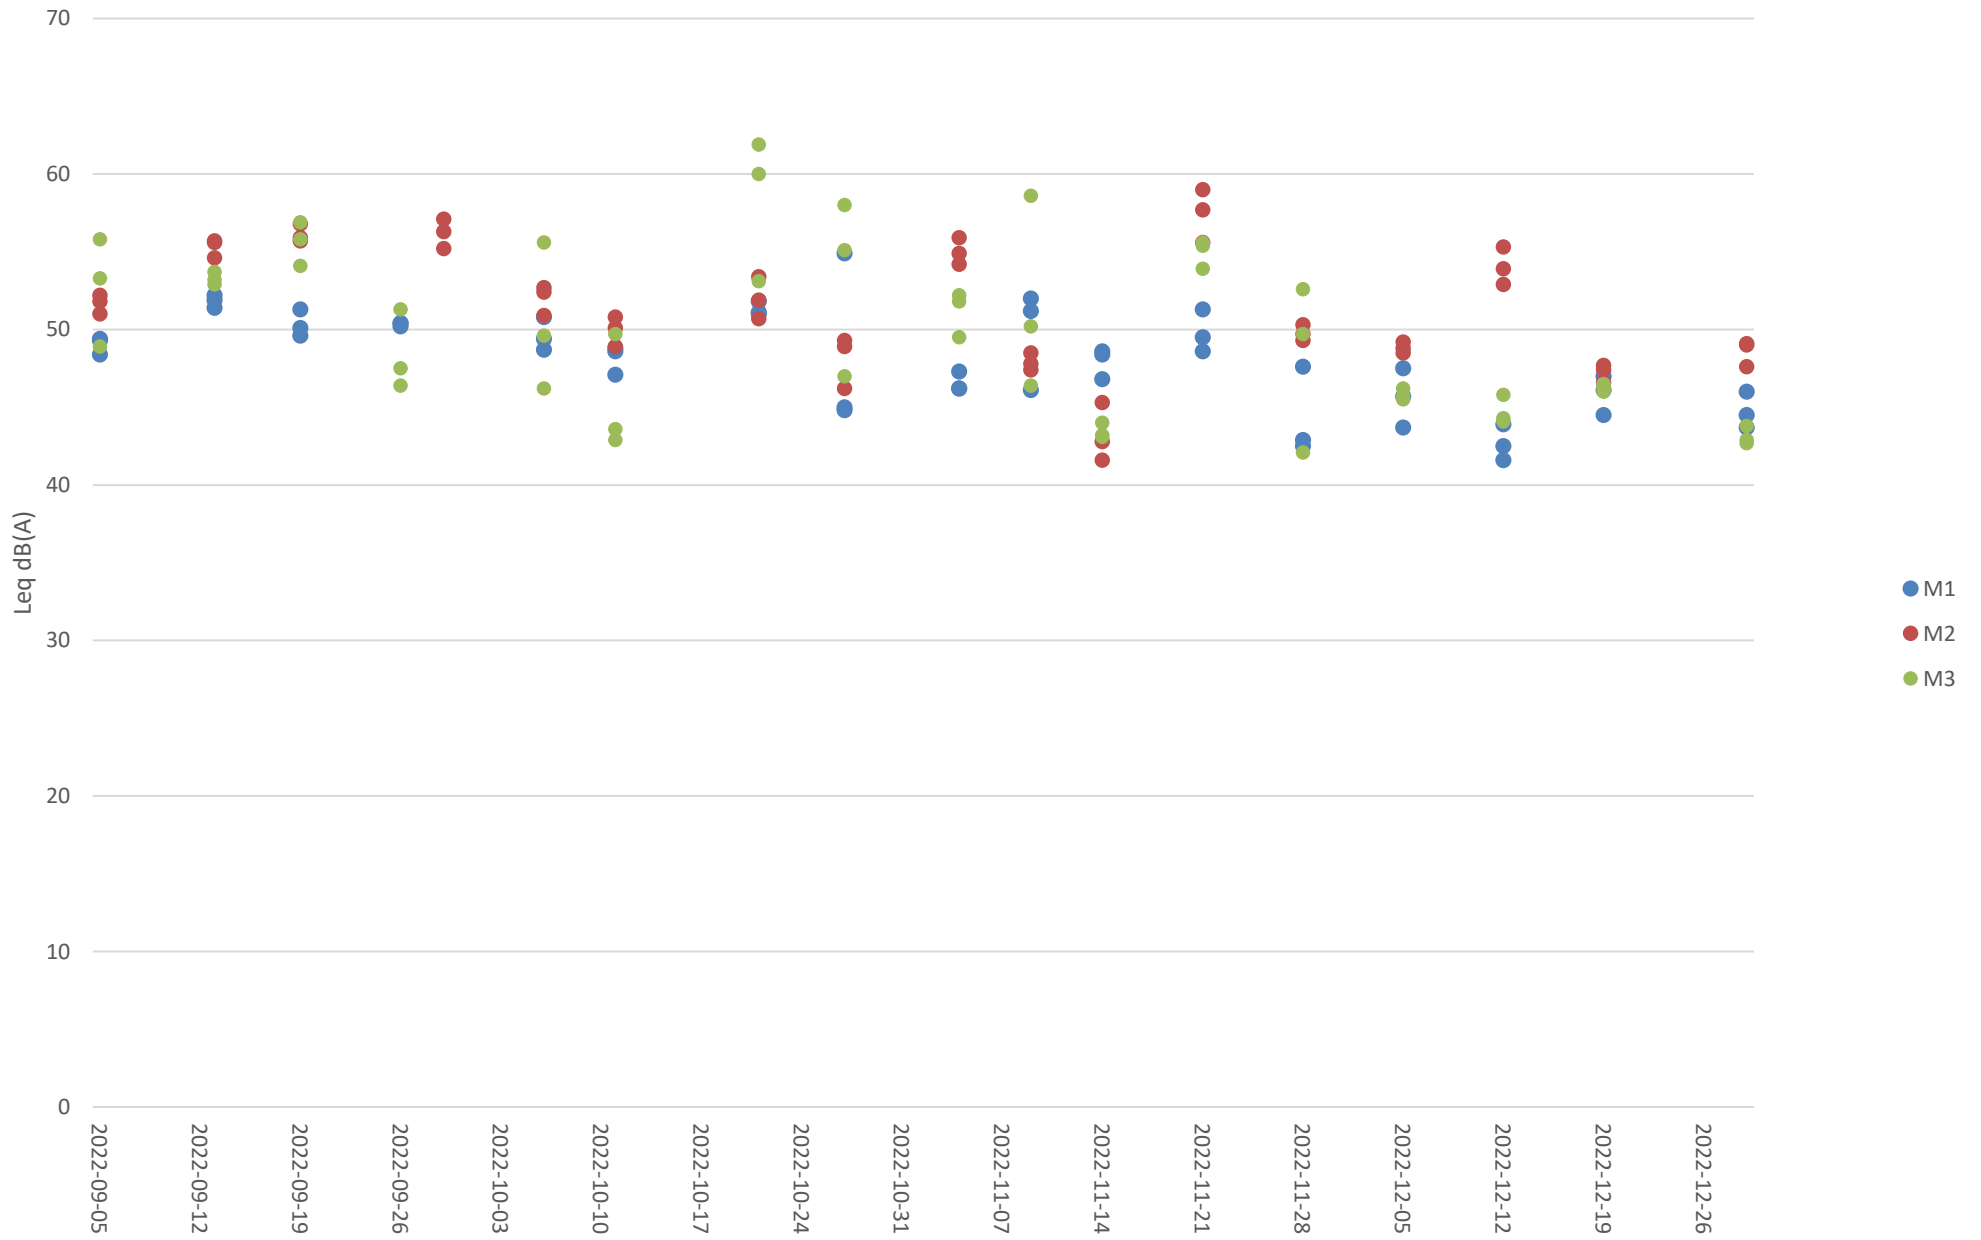

Additional Impact Noise Monitoring Results during Night Time (2300 - 0700 hours)

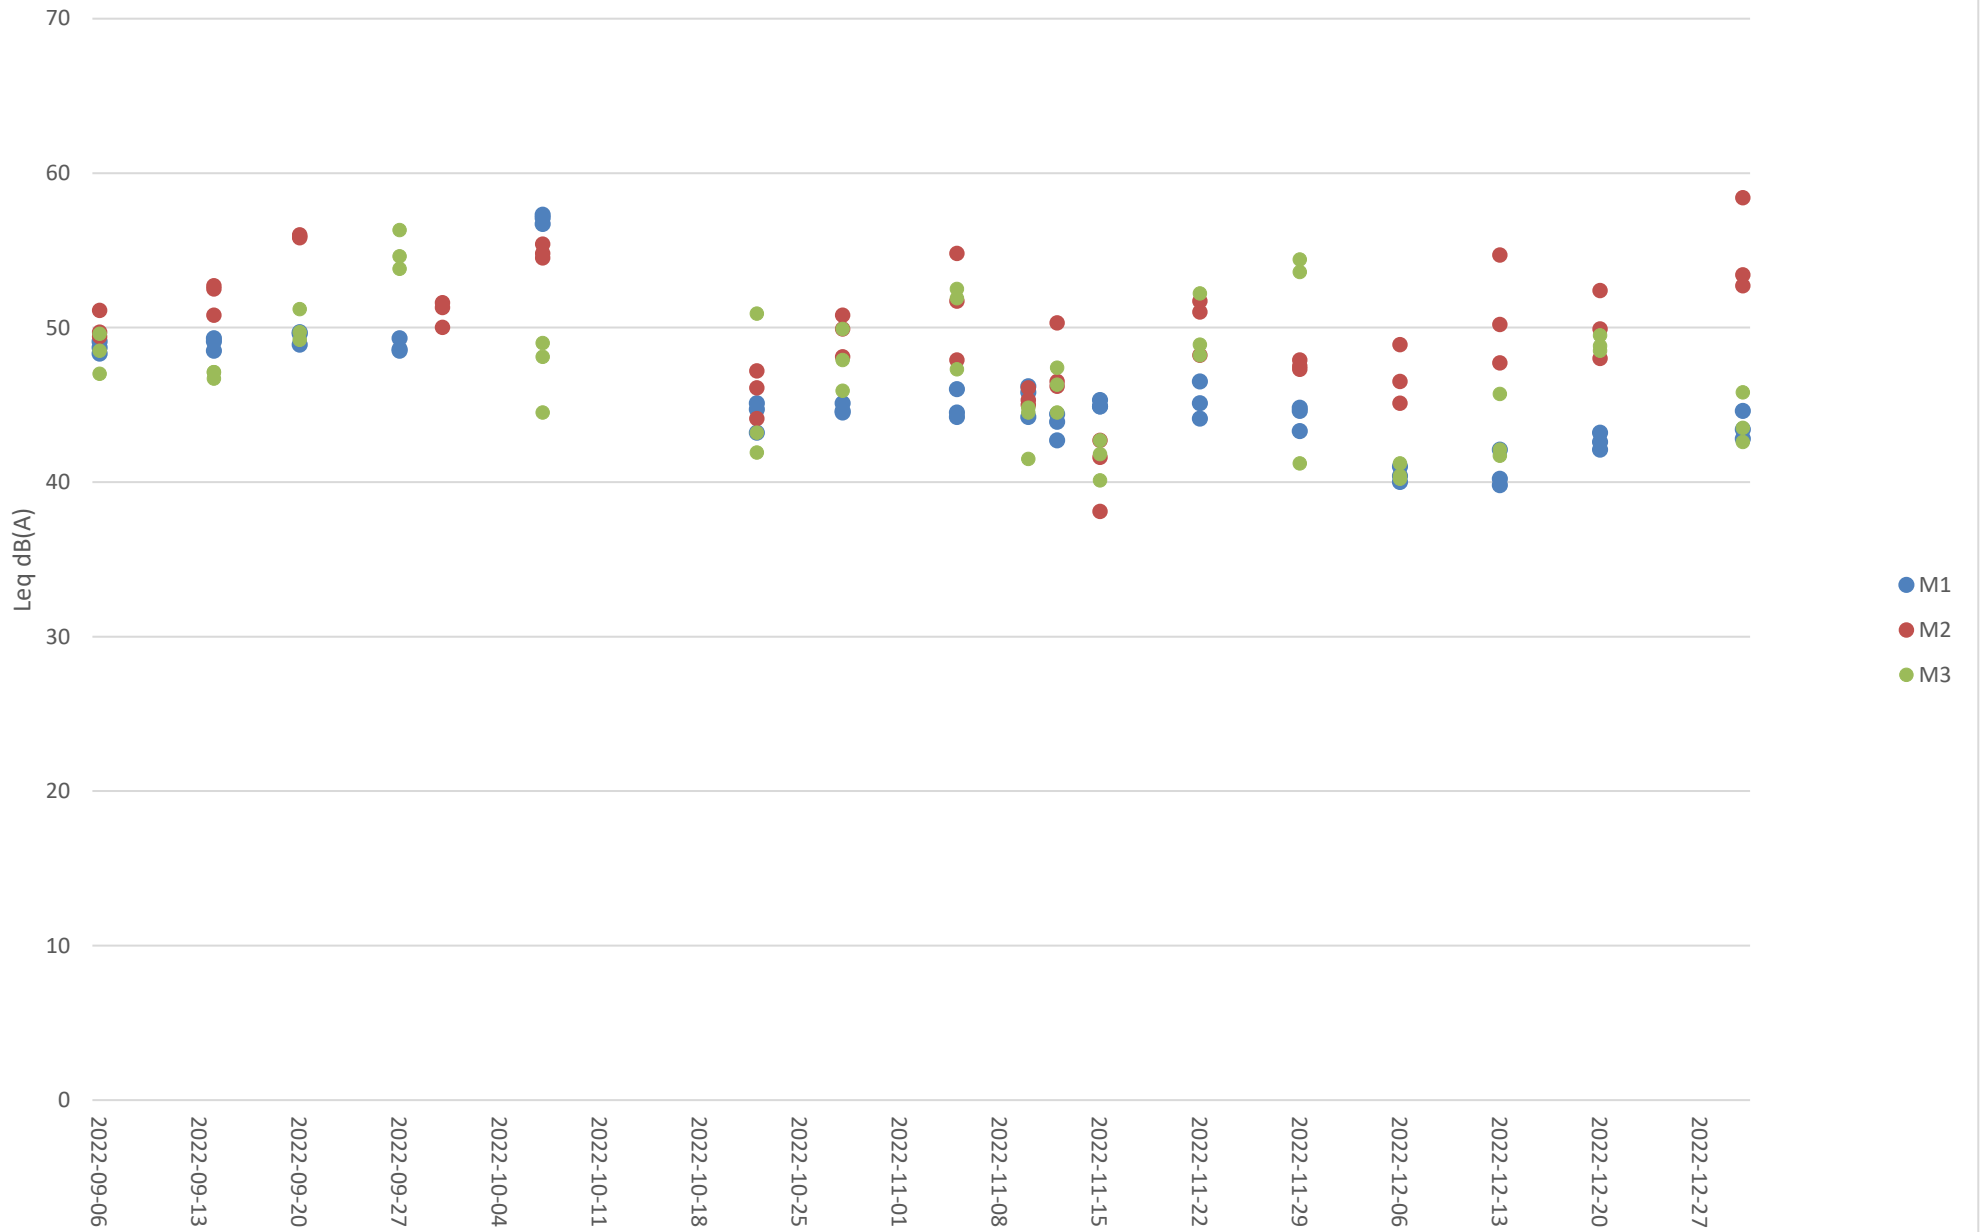

Summary of the Construction Activities Undertaken during the Reporting Period

Location of works	Construction activities undertaken	Remarks on progress
Reclamation area	<ul style="list-style-type: none"> • Reclamation works • Installation of Instrumentation • Site Investigation works for foundation • Foundation works (including Driven H Pile and Socketed H Pile) • Pile cap construction • Structural steel work 	<ul style="list-style-type: none"> • On-going • On-going • On-going • On-going • On-going • On-going
Seawall portion	<ul style="list-style-type: none"> • Installation of Chinese Pod • Caisson extension works, from +3mPD to +6mPD, at Seawall A and B • Construction of wave wall along the vertical seawall 	<ul style="list-style-type: none"> • On-going • On-going • On-going

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 1 (M1 / N_S1)

Monitoring date: 06, 11, 21, 27 October 2022 (Daytime)

06&07, 11&12, 21&22, 27&28 October 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Nil

Noise Monitoring Data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
06 Oct 2022	13:25	-	13:55	Sunny	63.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
06 Oct 2022	19:10	-	19:15	Fine	48.7	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:05	-	20:10		50.8		
	21:05	-	21:10		49.4		
07 Oct 2022	1:05	-	1:10	Fine	56.7	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:10	-	3:15		57.1		
	5:05	-	5:10		57.3		
11 Oct 2022	14:01	-	14:31	Sunny	62.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
11 Oct 2022	19:11	-	19:16	Fine	47.1	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:06	-	20:11		48.8		
	21:11	-	21:16		48.6		
12 Oct 2022	1:11	-	1:16	Fine	44.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:16	-	3:21		43.9		
	5:11	-	5:16		42.7		
21 Oct 2022	13:29	-	13:59	Sunny	65.0	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
21 Oct 2022	19:09	-	19:14	Fine	51.1	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:14	-	20:19		51.8		
	21:14	-	21:19		51.0		
22 Oct 2022	1:24	-	1:29	Fine	44.7	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:09	-	3:14		45.1		
	5:14	-	5:19		43.2		
27 Oct 2022	13:20	-	13:50	Sunny	65.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
27 Oct 2022	19:05	-	19:10	Fine	45.0	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:10	-	20:15		54.9		
	21:10	-	21:15		44.8		
28 Oct 2022	1:10	-	1:15	Fine	44.6	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:15	-	3:20		45.1		
	5:25	-	5:30		44.5		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 1 (M1 / N_S1)

Monitoring date: 04, 09, 14, 21, 28 November 2022 (Daytime)

04&05, 09&10, 14&15, 21&22, 28&29 November 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Nil

Noise Monitoring Data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
04 Nov 2022	13:09	-	13:39	Sunny	64.5	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
04 Nov 2022	19:04	-	19:09	Fine	46.2	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:04	-	20:09		47.3		
	21:09	-	21:14		46.2		
05 Nov 2022	1:09	-	1:14	Fine	46.0	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:14	-	3:19		44.5		
	5:19	-	5:24		44.2		
09 Nov 2022	13:18	-	13:48	Fine	63.0	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
09 Nov 2022	19:03	-	19:08	Fine	46.1	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:04	-	20:09		52.0		
	21:03	-	21:08		51.2		
10 Nov 2022	1:13	-	1:18	Fine	46.2	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:03	-	3:08		45.8		
	5:18	-	5:23		44.2		
14 Nov 2022	13:21	-	13:51	Sunny	60.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
14 Nov 2022	19:16	-	19:21	Fine	48.6	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:01	-	20:06		48.4		
	21:26	-	21:31		46.8		
15 Nov 2022	1:11	-	1:16	Fine	44.9	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:16	-	3:21		45.3		
	5:16	-	5:21		44.9		
21 Nov 2022	12:56	-	13:26	Fine	58.3	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
21 Nov 2022	19:11	-	19:16	Fine	51.3	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:11	-	20:16		48.6		
	21:11	-	21:16		49.5		
22 Nov 2022	1:16	-	1:21	Fine	44.1	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:06	-	3:11		45.1		
	5:06	-	5:11		46.5		

Date	Start time		End time	Weather	L_{eq 30min} dB(A) / L_{eq 5min} dB(A)	Sound Level Meter Used	Calibrator Used
28 Nov 2022	13:22	-	13:52	Sunny	63.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
28 Nov 2022	19:12	-	19:17	Fine	47.6	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:17	-	20:22		42.5		
	21:22	-	21:27		42.9		
29 Nov 2022	1:02	-	1:07	Fine	43.3	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:07	-	3:12		44.8		
	5:12	-	5:17		44.6		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 1 (M1 / N_S1)

Monitoring date: 05, 12, 19, 29 December 2022 (Daytime)

05&06, 12&13, 19&20, 29&30 December 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Nil

Noise Monitoring Data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
05 Dec 2022	13:42	-	14:12	Sunny	58.9	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
05 Dec 2022	19:02	-	19:07	Fine	47.5	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:17	-	20:22		45.7		
	21:37	-	21:42		43.7		
06 Dec 2022	1:27	-	1:32	Fine	40.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:17	-	3:22		40.0		
	5:22	-	5:27		41.0		
12 Dec 2022	12:56	-	13:26	Fine	65.5	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
12 Dec 2022	19:16	-	19:21	Fine	43.9	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:21	-	20:26		41.6		
	21:21	-	21:26		42.5		
13 Dec 2022	1:06	-	1:11	Fine	40.2	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:11	-	3:16		39.8		
	5:11	-	5:16		42.1		
19 Dec 2022	13:01	-	13:31	Sunny	58.6	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
19 Dec 2022	19:21	-	19:26	Fine	47.0	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:16	-	20:21		44.5		
	21:16	-	21:21		46.1		
20 Dec 2022	1:02	-	1:07	Fine	43.2	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:21	-	3:26		42.1		
	5:21	-	5:26		42.6		
29 Dec 2022	13:20	-	13:50	Sunny	59.5	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724243)
29 Dec 2022	19:05	-	19:10	Fine	46.0	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724243)
	20:15	-	20:20		44.5		
	21:20	-	21:25		43.7		
30 Dec 2022	1:20	-	1:25	Fine	43.4	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724243)
	3:10	-	3:15		42.8		
	5:20	-	5:25		44.6		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 2 (M2 / N_S2)

Monitoring date: 06, 11, 21, 27 October 2022 (Daytime)
06&07, 11&12, 21&22, 27&28 October 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than Nil
construction activities from
the Project:

Noise Monitoring Data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
06 Oct 2022	13:32	-	14:02	Sunny	62.0	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
06 Oct 2022	19:02	-	19:07	Fine	52.7	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:17	-	20:22		52.4		
	21:12	-	21:17		50.9		
07 Oct 2022	1:07	-	1:12	Fine	54.8	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:07	-	3:12		55.4		
	5:07	-	5:12		54.5		
11 Oct 2022	14:04	-	14:34	Sunny	60.2	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
11 Oct 2022	19:09	-	19:14	Fine	50.1	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:29	-	20:34		48.9		
	21:14	-	21:19		50.8		
12 Oct 2022	1:14	-	1:19	Fine	46.2	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:09	-	3:14		46.5		
	5:19	-	5:24		50.3		
21 Oct 2022	13:40	-	14:10	Sunny	57.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
21 Oct 2022	19:05	-	19:10	Fine	51.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:05	-	20:10		50.7		
	21:05	-	21:10		53.4		
22 Oct 2022	1:15	-	1:20	Fine	46.1	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:10	-	3:15		47.2		
	5:10	-	5:15		44.1		
27 Oct 2022	13:30	-	14:00	Sunny	61.2	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
27 Oct 2022	19:10	-	19:15	Fine	46.2	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:10	-	20:15		49.3		
	21:10	-	21:15		48.9		
28 Oct 2022	1:05	-	1:10	Fine	48.1	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:10	-	3:15		50.8		
	5:20	-	5:25		49.9		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 2 (M2 / N_S2)

Monitoring date: 04, 09, 14, 21, 28 November 2022 (Daytime)

04&05, 09&10, 14&15, 21&22, 28&29 November 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Nil

Noise Monitoring Data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
04 Nov 2022	13:20	-	13:50	Sunny	58.1	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
04 Nov 2022	19:10	-	19:15	Fine	54.2	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:45	-	20:50		54.9		
	21:20	-	21:25		55.9		
05 Nov 2022	1:25	-	1:30	Fine	54.8	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:25	-	3:30		51.7		
	5:15	-	5:20		47.9		
09 Nov 2022	13:30	-	14:00	Fine	57.8	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
09 Nov 2022	19:05	-	19:10	Fine	48.5	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:05	-	20:10		47.4		
	21:05	-	21:10		47.8		
10 Nov 2022	1:10	-	1:15	Fine	45.3	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:10	-	3:15		45.0		
	5:15	-	5:20		46.1		
14 Nov 2022	13:37	-	14:07	Sunny	60.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
14 Nov 2022	19:17	-	19:22	Fine	45.3	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:07	-	20:12		42.8		
	21:27	-	21:32		41.6		
15 Nov 2022	1:12	-	1:17	Fine	42.7	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:07	-	3:12		41.6		
	5:22	-	5:27		38.1		
21 Nov 2022	13:03	-	13:33	Fine	58.7	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
21 Nov 2022	19:13	-	19:18	Fine	57.7	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:08	-	20:13		55.6		
	21:18	-	21:23		59.0		
22 Nov 2022	1:18	-	1:23	Fine	51.7	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:13	-	3:18		51.0		
	5:13	-	5:18		48.2		

Date	Start time		End time	Weather	L_{eq 30min} dB(A) / L_{eq 5min} dB(A)	Sound Level Meter Used	Calibrator Used
28 Nov 2022	13:34	-	14:04	Sunny	62.5	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
28 Nov 2022	19:14	-	19:19	Fine	50.3	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:09	-	20:14		49.3		
	21:14	-	21:19		49.7		
29 Nov 2022	1:04	-	1:09	Fine	47.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:09	-	3:14		47.3		
	5:14	-	5:19		47.5		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 2 (M2 / N_S2)

Monitoring date: 05, 12, 19, 29 December 2022 (Daytime)

05&06, 12&13, 19&20, 29&30 December 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than Nil
 construction activities from
 the Project:

Noise Monitoring Data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
05 Dec 2022	13:40	-	14:10	Sunny	57.6	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
05 Dec 2022	19:25	-	19:30	Fine	49.2	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:05	-	20:10		48.8		
	21:15	-	21:20		48.5		
06 Dec 2022	1:10	-	1:15	Fine	48.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:15	-	3:20		45.1		
	5:10	-	5:15		46.5		
12 Dec 2022	12:34	-	13:04	Fine	56.8	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
12 Dec 2022	19:09	-	19:14	Fine	52.9	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:14	-	20:19		55.3		
	21:19	-	21:24		53.9		
13 Dec 2022	1:14	-	1:19	Fine	50.2	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:04	-	3:09		47.7		
	5:24	-	5:29		54.7		
19 Dec 2022	13:10	-	13:40	Sunny	56.0	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
19 Dec 2022	19:20	-	19:25	Fine	47.4	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	20:15	-	20:20		46.6		
	21:15	-	21:20		47.7		
20 Dec 2022	1:05	-	1:10	Fine	52.4	SVAN 971 (Serial No. 103482)	Rion NC-75 (No.34724244)
	3:25	-	3:30		49.9		
	5:20	-	5:25		48.0		
29 Dec 2022	13:11	-	13:41	Sunny	52.8	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724243)
29 Dec 2022	19:16	-	19:21	Fine	47.6	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724243)
	20:16	-	20:21		49.0		
	21:16	-	21:21		49.1		
30 Dec 2022	1:06	-	1:11	Fine	58.4	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724243)
	3:06	-	3:11		53.4		
	5:11	-	5:16		52.7		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 3 (M3 / N_S3)

Monitoring date: 06, 11, 21, 27 October 2022 (Daytime)
 06&07, 11&12, 21&22, 27&28 October 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Air-conditioner

Noise Monitoring data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
06 Oct 2022	13:24	-	13:54	Sunny	60.5	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
06 Oct 2022	19:09	-	19:14	Fine	46.2	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:04	-	20:09		49.6		
	21:04	-	21:09		55.6		
07 Oct 2022	1:19	-	1:24	Fine	49.0	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:14	-	3:19		48.1		
	5:04	-	5:09		44.5		
11 Oct 2022	14:03	-	14:33	Sunny	60.6	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
11 Oct 2022	19:03	-	19:08	Fine	49.7	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:08	-	20:13		43.6		
	21:13	-	21:18		42.9		
12 Oct 2022	1:03	-	1:08	Fine	47.4	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:23	-	3:28		46.3		
	5:28	-	5:33		44.5		
21 Oct 2022	13:33	-	14:03	Sunny	60.6	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
21 Oct 2022	19:08	-	19:13	Fine	60.0	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:33	-	20:38		61.9		
	21:18	-	21:23		53.1		
22 Oct 2022	1:18	-	1:23	Fine	41.9	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:08	-	3:13		50.9		
	5:13	-	5:18		43.2		
27 Oct 2022	13:25	-	13:55	Sunny	60.0	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
27 Oct 2022	19:15	-	19:20	Fine	55.1	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:25	-	20:30		58.0		
	21:20	-	21:25		47.0		
28 Oct 2022	1:15	-	1:20	Fine	45.9	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:15	-	3:20		47.9		
	5:30	-	5:35		49.9		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 3 (M3 / N_S3)

Monitoring date: 04, 09, 14, 21, 28 November 2022 (Daytime)

04&05, 09&10, 14&15, 21&22, 28&29 November 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Air-conditioner

Noise Monitoring data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
04 Nov 2022	13:07	-	13:37	Sunny	57.1	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
04 Nov 2022	19:07	-	19:37	Fine	49.5	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:22	-	20:52		52.2		
	21:02	-	21:32		51.8		
05 Nov 2022	1:12	-	1:42	Fine	51.9	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:07	-	3:37		52.5		
	5:12	-	5:42		47.3		
09 Nov 2022	13:16	-	13:46	Fine	56.8	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
09 Nov 2022	19:01	-	19:31	Fine	46.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	20:21	-	20:51		50.2		
	21:21	-	21:51		58.6		
10 Nov 2022	1:06	-	1:36	Fine	44.5	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724244)
	3:11	-	3:41		41.5		
	5:11	-	5:41		44.8		
14 Nov 2022	13:34	-	14:04	Sunny	55.5	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
14 Nov 2022	19:19	-	19:49	Fine	44.0	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:04	-	20:34		43.1		
	21:24	-	21:54		43.2		
15 Nov 2022	1:14	-	1:44	Fine	42.7	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:09	-	3:39		40.1		
	5:19	-	5:49		41.8		
21 Nov 2022	13:01	-	13:31	Fine	55.9	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
21 Nov 2022	19:11	-	19:41	Fine	55.6	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:11	-	20:41		53.9		
	21:11	-	21:41		55.4		
22 Nov 2022	1:16	-	1:46	Fine	48.9	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:16	-	3:46		48.2		
	5:16	-	5:46		52.2		
28 Nov 2022	13:17	-	13:47	Sunny	62.3	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)

Date	Start time		End time	Weather	L_{eq 30min} dB(A) / L_{eq 5min} dB(A)	Sound Level Meter Used	Calibrator Used
28 Nov 2022	19:17	-	19:47	Fine	42.1	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:12	-	20:42		49.7		
	21:17	-	21:47		52.6		
29 Nov 2022	1:12	-	1:42	Fine	53.6	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:12	-	3:42		54.4		
	5:17	-	5:47		41.2		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 3 (M3 / N_S3)

Monitoring date: 05, 12, 19, 29 December 2022 (Daytime)

05&06, 12&13, 19&20, 29&30 December 2022 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Air-conditioner

Noise Monitoring data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
05 Dec 2022	13:37	-	14:07	Sunny	59.0	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
05 Dec 2022	19:17	-	19:22	Fine	46.2	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:17	-	20:22		45.5		
	21:22	-	21:27		45.7		
06 Dec 2022	1:22	-	1:27	Fine	40.4	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:12	-	3:17		40.2		
	5:22	-	5:27		41.2		
12 Dec 2022	12:58	-	13:28	Fine	68.1	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
12 Dec 2022	19:18	-	19:23	Fine	44.3	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:18	-	20:23		44.1		
	21:13	-	21:18		45.8		
13 Dec 2022	1:13	-	1:18	Fine	41.7	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:18	-	3:23		42.1		
	5:18	-	5:23		45.7		
19 Dec 2022	12:58	-	13:58	Sunny	57.7	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
19 Dec 2022	19:18	-	19:23	Fine	46.5	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	20:18	-	20:18		46.0		
	21:13	-	21:28		46.2		
20 Dec 2022	1:13	-	1:18	Fine	48.5	SVAN 971 (Serial No. 96063)	Rion NC-75 (No.34724244)
	3:18	-	3:33		48.8		
	5:18	-	5:23		49.5		
29 Dec 2022	13:21	-	13:51	Sunny	62.4	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724243)
29 Dec 2022	19:16	-	19:21	Fine	43.8	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724243)
	20:21	-	20:26		42.7		
	21:21	-	21:26		42.9		
30 Dec 2022	1:06	-	1:11	Fine	43.5	SVAN 971 (Serial No. 96062)	Rion NC-75 (No.34724243)
	3:11	-	3:16		42.6		
	5:11	-	5:16		45.8		