

Contract No. EP/SP/66/12
Integrated Waste Management Facilities, Phase 1
Monthly EM&A Report No.30






Monthly EM&A Report No.30
(Period from 1 December to 31 December 2020)

(Clause 3.3, Further Environmental Permit FEP-01/429/2012/A)

Document No.

KSZHJV	/	312	/	Monthly EM&A	/	0030	/	B
Issuer		Project Code		Type of Document		Sequential No.		Revision Index

	Prepared by:	Certified by:	Verified by:
Name	Joe Ho	F.C. Tsang	Mandy To
Position	Environmental Team	Environmental Team Leader	Independent Environmental Checker
Signature			
Date:	1 April 2021	1 April 2021	1 April 2021

Revision History

B	Revision based on EPD and AFCD's comment	24 March 2021
A	First Submission	14 January 2021
Rev.	DESCRIPTION OF MODIFICATION	DATE

CONTENTS

1. Basic Project Information.....	7
2. Marine Water Quality Monitoring.....	17
3. Noise Monitoring.....	29
4. Waste.....	36
5. Coral.....	38
6. Marine Mammal.....	52
7. White-Bellied Sea Eagle.....	65
8. Summary of Monitoring Exceedance, Complaints, Notification of Summons and Prosecutions.....	69
9. EM&A Site Inspection.....	73
10. Future Key Issues.....	75
11. Conclusion and Recommendations.....	76

Appendix A	Master Programme
Appendix B	Summary of Implementation Status of Environmental Mitigation
Appendix C	Impact Monitoring Schedule of the Reporting Month
Appendix D	Water Quality Monitoring Data
Appendix E	HOKLAS Laboratory Certificate
Appendix F	Water Quality Equipment Calibration Certificate
Appendix G	Event/ Action Plan for Water Quality Exceedance
Appendix H	Noise Monitoring Equipment Calibration Certificate
Appendix I	Event/Action Plan for Noise Exceedance
Appendix J	Noise Monitoring Data
Appendix K	Waste Flow Table
Appendix L	Event/Action Plan for Coral Monitoring
Appendix M	Event/Action Plan for White-bellied Sea Eagle Monitoring
Appendix N	Exceedance Report
Appendix O	Complaint Log
Appendix P	Impact Monitoring Schedule of Next Reporting Month

EXECUTIVE SUMMARY

Introduction

- A1. The Project, Integrated Waste Management Facility (IWMF), is a Designated Project under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO) and is currently governed by a Further Environmental Permit (FEP No. FEP-01/429/2012/A) for the construction and operation of the Project.
- A2. In accordance with the Updated Environmental Monitoring and Audit (EM&A) Manual for the Project, EM&A works for marine water quality, noise, waste management and ecology should be carried out by Environmental Team (ET), Acuity Sustainability Consulting Limited (ASCL), during the construction phase of the Project.
- A3. This is the 30th Monthly EM&A Report, prepared by ASCL, for the Project summarizing the monitoring results and audit findings of the EM&A programme at and around Shek Kwu Chau (SKC) during the reporting period from 1 December to 31 December 2020.

Summary of Main Works Undertaken & Key Mitigation Measures Implemented

- A4. Key activities carried out in this reporting period for the Project included the following:
- Placing rock filter at reclamation area
 - Installation of Caisson
 - Reclamation works
 - Installation of Chinese Pod
- A5. The major environmental impacts brought by the above construction activities include:
- Disturbance and possible trapping of Finless Porpoise by silt curtains
 - Deterioration of water quality of nearby water body by reclamation
- A6. The key environmental mitigation measures implemented for the Project in this reporting period associated with the construction activities include:
- Reduction of noise from equipment and machinery on-site;
 - Installation process of silt curtain according to approved Silt Curtain Deployment Plan;
 - Sorting, recycling, storage and disposal of general refuse and construction waste;
 - Management of chemicals and avoidance of oil spillage on-site;
 - Implementation of MMEZ (Marine Mammal Exclusion Zone) and inspection of enclosed environment within silt curtains as per DMPFP (Detailed Monitoring Programme of Finless Porpoise);
 - Regulation on rate and means for filling works as stipulated in Table 1 of FEP or the approved Supporting Document for Reviewing Dredging Rate and Filling Rate, whichever is applicable;

- Confirmation of the absence of silt content in the rock filling material and the filling work is properly conducted;
- Deployment of floating silt curtain according to approved Silt Curtain Deployment Plan.

Summary of Exceedance & Investigation & Follow-up

- A7. The EM&A works for water quality, construction waste, marine mammal and White-Bellied Sea Eagle (WBSE) were conducted during the reporting period in accordance with the Updated EM&A Manual.
- A8. No exceedance of the Action or Limit Levels in relation to noise, construction waste and WBSE monitoring was recorded in the reporting month.
- A9. Ten (10) of the general water quality monitoring results of suspended solids (SS) obtained had exceeded Action Level. Eight (8) of general water quality monitoring results of SS obtained during the reporting period had exceeded the Limit Level.
- A10. No project-related Action Level & Limit Level exceedance was recorded from 1 December 2020 to 31 December 2020.
- A11. Weekly site inspections of the construction work by ET were carried out on 1, 8, 17, 22 and 29 December 2020 to audit the mitigation measures implementation status. Monthly joint site inspection was carried out on 22 December 2020 by ET and IEC. Observations were recorded in the site inspection checklists and provided to the contractors together with the appropriate follow-up actions where necessary.

Complaint Handling and Prosecution

- A12. No project-related environmental complaint was received during the reporting period.
- A13. Neither notifications of summons nor prosecution was received for the Project.

Reporting Change

- A14. There was no change to be reported that may affect the on-going EM&A programme.

Summary of Upcoming Key Issues and Key Mitigation Measures

- A15. Key activities anticipated in the next reporting period for the Project will include the following:
- Placing rock filter at reclamation area
 - Installation of Caisson
 - Reclamation works
 - Installation of Chinese Pod

- A16. The major environmental impacts brought by the above construction activities will include:

- Disturbance and possible trapping of Finless Porpoise by silt curtains.

A17. The key environmental mitigation measures for the Project in the coming reporting period associated with the construction activities will include:

- Reduction of noise from equipment and machinery on-site;
- Installation of silt curtains for reclamation works;
- Sorting, recycling, storage and disposal of general refuse and construction waste;
- Management of chemicals and avoidance of oil spillage on-site, especially under heavy rains and adverse weather;
- Implementation of MMEZ and inspection of enclosed environment within silt curtains as per DMPFP;
- Regulation on rate and means for filling works as stipulated in Table 1 of FEP or the approved Supporting Document for Reviewing Dredging Rate and Filling Rate, whichever is applicable;
- Confirmation of the absence of silt content in the rock filling material and the filling work is properly conducted; and
- Deployment of floating silt curtain according to approved Silt Curtain Deployment Plan.

1. BASIC PROJECT INFORMATION

1.1 Background

1.1.1 The Government of Hong Kong SAR will develop the Integrated Waste Management Facilities (IWMF) Phase 1 (hereafter “the Project”) with incineration to achieve substantial bulk reduction of unavoidable municipal solid waste (MSW) and to recover energy from the incineration process. The IWMF will be on an artificial island to be formed by reclamation at the south-western coast of Shek Kwu Chau. Keppel Seghers – Zhen Hua Joint Venture (KSZHJV) was awarded the contract under Contract No. EP/SP/66/12 Integrated Waste Management Facilities Phase 1 to construct and operate the Project.

1.1.2 An environmental impact assessment (EIA) study for the Project has been conducted and the EIA Report was approved under the Environmental Impact Assessment Ordinance on 17 January 2012. An Environmental Permit (EP) (EP No.: EP-429/2012) was granted to EPD on 19 January 2012 for the construction and operation of the Project. Subsequently, the EP was amended (EP No.: EP-429/2012/A) and a further EP (FEP) (EP No.: FEP-01/429/2012/A) was granted to the Keppel Seghers – Zhen Hua Joint Venture (KSZHJV) on 27 December 2017.

1.1.3 A further EP (FEP) (EP No.: FEP-02/429/2012/A) on Submarine Cable for the Development of the Project was granted to CLP Power Hong Kong Limited (CLP) on 17 Jan 2020.

1.1.4 The key design and construction elements of the Project include the Design and the Works including but not limited to the design, engineering procurement, construction, testing and commissioning of the Facility including:

- Ground Treatment works;
- Seawall and Breakwater construction;
- Non-dredged Reclamation;
- Other Marine works and Harbour and Port Facilities;
- Site formation;
- Municipal Solid Waste (MSW) Treatment Processes;
- Energy Recovery for Power Generation and Surplus Electricity export;
- Wastewater treatment process;
- Desalination and water treatment process;
- Civil works;
- Building and Structural works;
- Electrical and Mechanical works;
- Building Services;
- Architectural and Landscaping works; and
- All other design and works required for the operation and maintenance of the Facility according to the Contract requirements.

- 1.1.5 The location of the IWMF near Shek Kwu Chau (SKC) and general layout of IWMF are shown in **Figure 1.1** and **Figure 1.2** respectively.

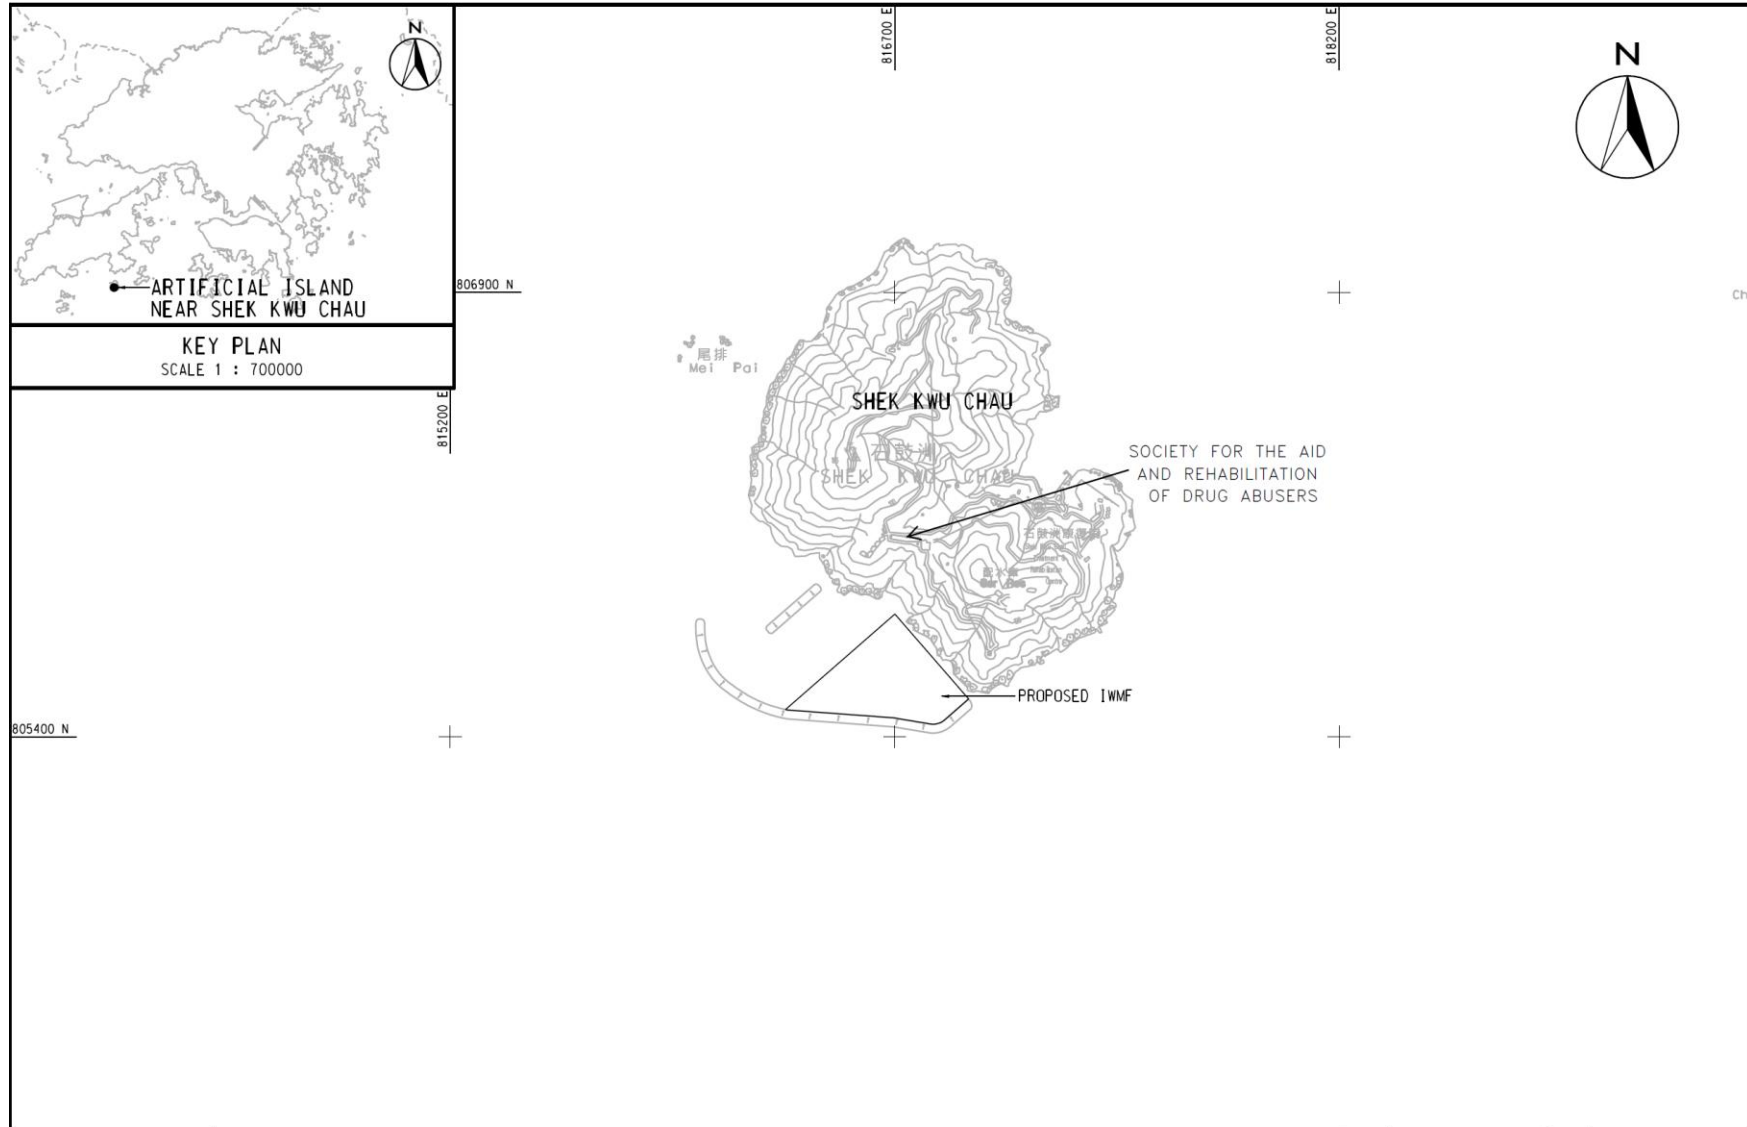


Figure 1.1 Location of the IWMF at the Artificial Island near SKC

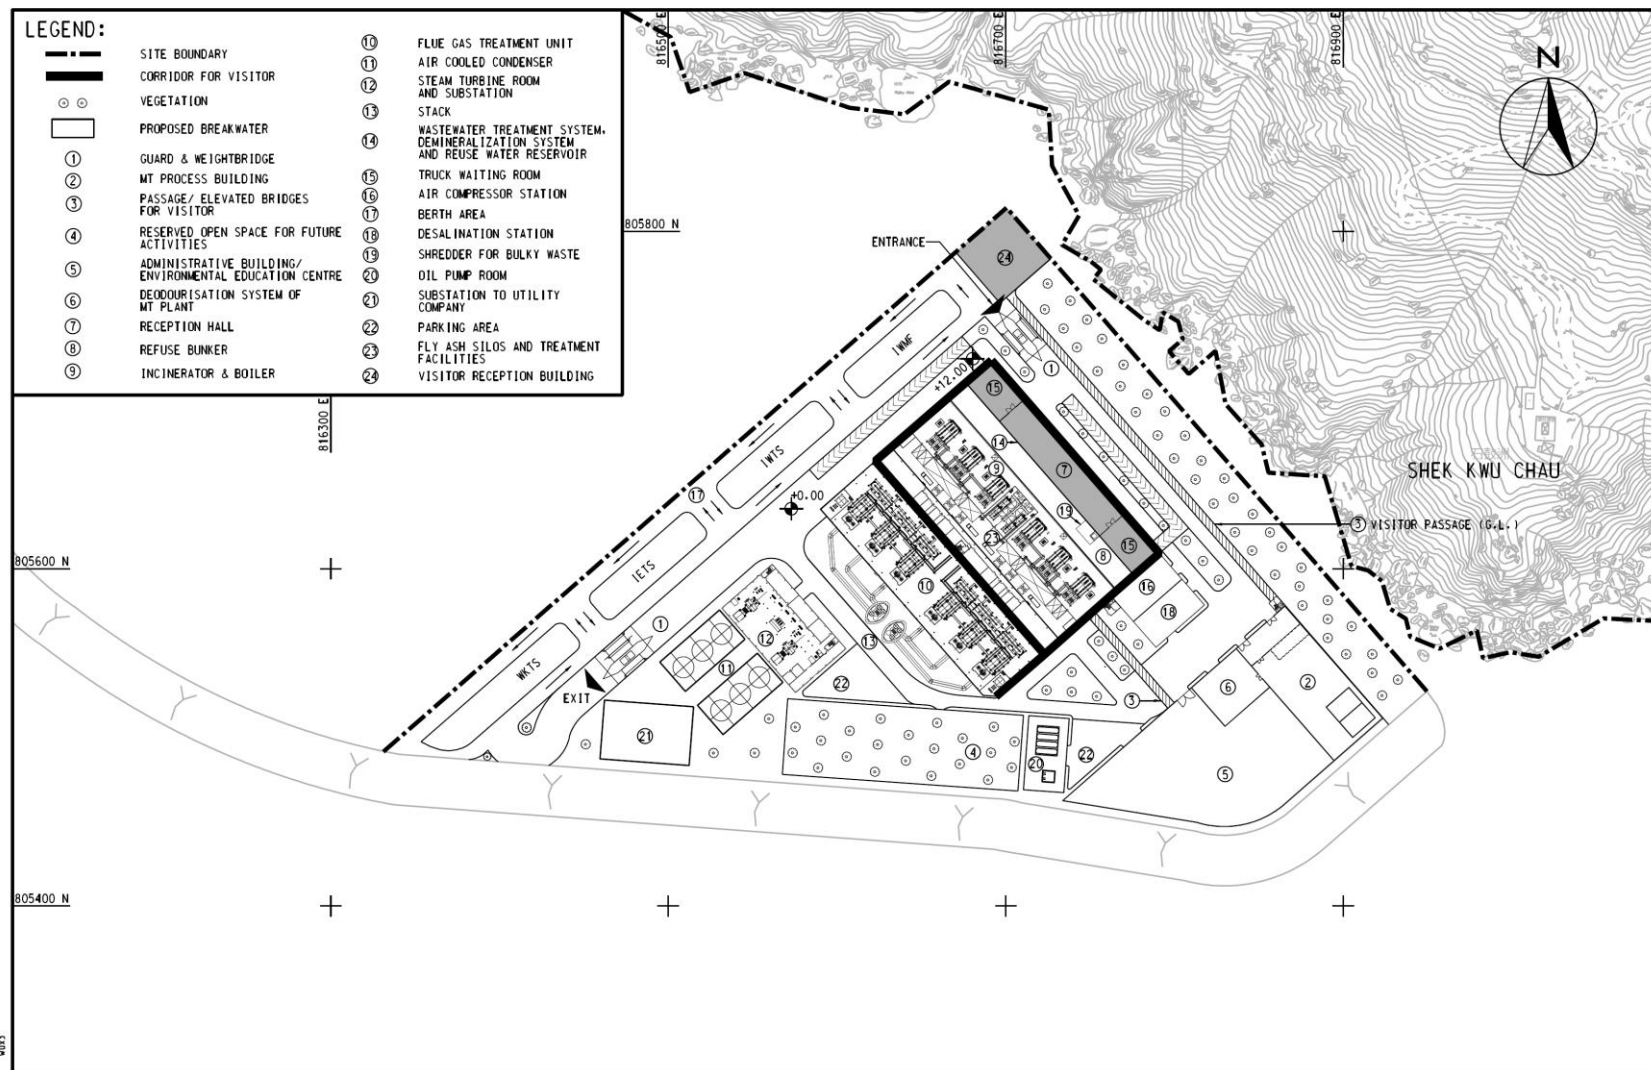


Figure 1.2 General Layout of the IWMF at the Artificial Island near SKC

1.2 The Reporting Scope

1.2.1 This is the 30th Monthly EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 1 December 2020 to 31 December 2020.

1.3 Project Organization

1.3.1 The Project Organization structure for Construction Phase is presented in **Figure 1.3**.

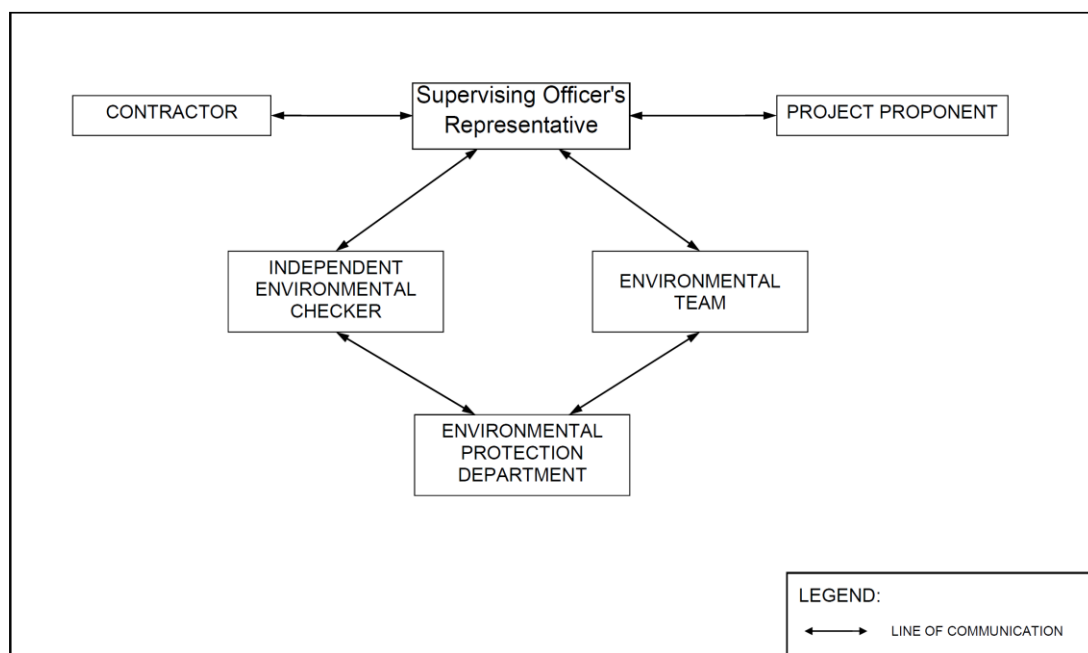


Figure 1.3 Project Organization Chart

1.3.2 Contact details of the key personnel are presented in **Table 1.1** below:

Table 1.1 Contact Details of Key Personnel


Party	Position	Name	Telephone no.
Keppel Seghers – Zhen Hua Joint Venture	Project Manager	Kenny Yu	2192-0606
Acuity Sustainability Consulting Limited	Environmental Team Leader	F.C. Tsang	2698-6833
ERM-Hong Kong, Limited	Independent Environmental Checker	Mandy To	2271-3000

1.4 Summary of Construction Works

1.4.1 Details of the major construction activities undertaken in this reporting period are shown in **Table 1.2** and **Figure 1.4** below. The construction programme is presented in **Appendix A**.

Table 1.2 Summary of the Construction Activities Undertaken during the Reporting Month

Location of works	Construction activities undertaken	Remarks on progress
Reclamation area	<ul style="list-style-type: none">• Placing rock filter• Reclamation works	<ul style="list-style-type: none">• On-going• On-going
Seawall portion	<ul style="list-style-type: none">• Installation of caisson• Installation of Chinese Pod	<ul style="list-style-type: none">• On-going• On-going

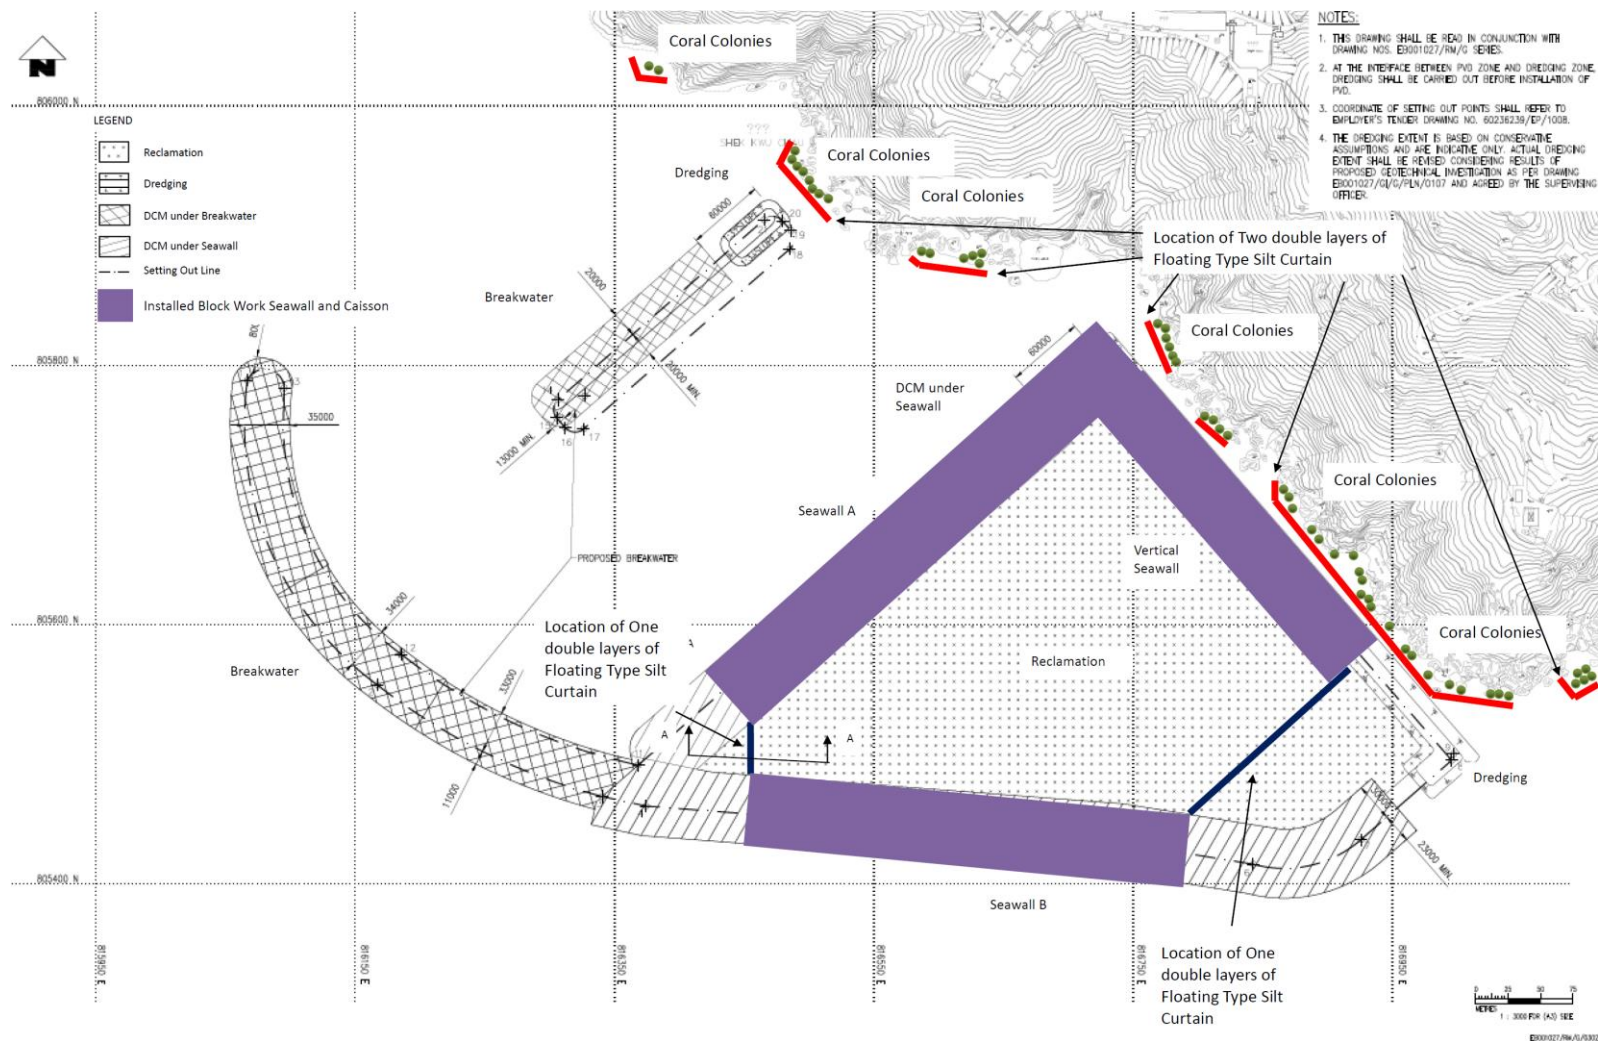

1.5 Summary of Environmental Status

1.5.1 A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in **Table 1.3**

Table 1.3 Summary of the Status of Valid Environmental Licence, Notification, Permit and Documentations

Permit/ Licences/ Notification	Reference	Validity Period	Remarks
Variation of Environmental Permit	EP-429/2012/A	Throughout the Contract	
Further Environmental Permit	FEP-01/429/2012/A	Throughout the Contract	
Notification of Construction Works under the Air Pollution Control (Construction Dust) Regulation (Form NA)	Ref No.: 428778	15/12/2017 – 22/09/2024	
Wastewater Discharge Licence	WT00033787-2019	22/08/2019 – 31/08/2024	
Chemical Waste Producer Registration	WPN0017-933-K3301-01	Throughout the Contract	
	WPN5213-961-K3301-02	Throughout the Contract	
	WPN5296-839-K3301-03	Throughout the Contract	
Construction Noise Permit (24 hours)	GW-RS0857-20	24/11/2020 – 23/05/2021	Portion 1, 1A & 1B
	GW-RE0957-20	24/11/2020 – 23/05/2021	Portion 8
Billing Account for Disposal of Construction Waste	A/C No.:7029768	Throughout the Contract	

1.5.2 The status for all environmental aspects is presented in **Table 1.4**.

Table 1.4 Summary of Status for Key Environmental Aspects under the Updated EM&A Manual

Parameters	Status
Water Quality	
Baseline Monitoring under Updated EM&A Manual and Detailed Plan on DCM	The baseline water quality monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under FEP Condition 3.4
Impact Monitoring	On-going
Post DCM Monitoring	All DCM was completed on 14 October 2020, regular DCM monitoring for further 4 weeks (i.e from 16 October 2020 to 14 November 2020) was completed according to the approved Detailed Plan on Deep Cement Mixing
Initial Intensive DCM Monitoring	Conducted from 11 February 2019 to 10 March 2019, had not been resumed since there was no DCM related parameter exceeding the AL/LL.
Baseline Water Quality of wet season	Completed over 13 August 2018 to 7 September 2018
Noise	
Baseline Monitoring	The baseline noise monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under FEP Condition 3.4
Impact Monitoring	On-going
Waste Management	
Mitigation Measures in Waste Monitoring Plan	On-going
Coral	
Pre-translocation Survey and Coral Mapping	The Coral Translocation Plan was submitted and approved by EPD under EP Condition 2.12
Coral Translocation	Completed on 28 March 2018
Post-Translocation Coral Monitoring	Survey affected by missing of translocated and tagged coral colonies after typhoons in September 2018, completed on 28 March 2019.
Pre-construction Coral Survey and Tagging	Completed on 26 June 2018
Tagged Coral Monitoring	Survey obstructed due to missing of tagged coral colonies after typhoons in September 2018
Coral Survey and Re-tagging	Re-tagging at Indirect Impact Site was conducted on 23 November and Re-tagging at Control Site was conducted on 3 December 2018.
Post Re-tagging Coral Monitoring	On-going
Marine Mammal	
Vessel-based Line-transect Survey Baseline Monitoring	The baseline marine mammal monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under FEP Condition 3.4
Vessel-based Line-transect Survey Impact Monitoring	On-going
Land-based Theodolite Tracking	30 days of theodolite surveys were started on 21 Feb 2019 and completed in May 2019.

Parameters	Status
Passive Acoustic Monitoring	30 days of PAM surveys were started on 1 May 2019 and completed until the end of May 2019.
White-bellied Sea Eagle	
Baseline Monitoring	The baseline WBSE monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under FEP Condition 3.4
Impact Monitoring	On-going
Environmental Audit	
Site Inspection covering Measures of Air Quality, Noise Impact, Water Quality, Waste, Ecological Quality, Fisheries, Landscape and Visual	On-going
Mitigation Measures in Marine Mammal Watching Plan (MMWP)	On-going
Mitigation Measures in Detailed Monitoring Programme on Finless Porpoise (DMPFP)	On-going
Mitigation Measures in Vessel Travel Details	On-going
Daily Site Audit and Monitoring for Dredging Work	Completed

1.5.3 Other than the EM&A work by ET, environmental briefings, trainings and regular environmental management meetings were conducted, in order to enhance environmental awareness and closely monitor the environmental performance of the contractors.

1.5.4 The EM&A programme has been implemented in accordance with the recommendations presented in the approved EIA Report and the Updated EM&A Manual. A summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix B**.

2. MARINE WATER QUALITY MONITORING

2.1 Water Quality Requirements

- 2.1.1 To ensure no adverse water quality impact, water quality monitoring is recommended to be carried out at the nearby water sensitive receivers (WSRs) during construction phase including proposed reclamation, breakwater construction, etc.
- 2.1.2 In accordance with the Updated EM&A Manual, impact water quality monitoring were conducted 3 days per week at mid-flood and mid-ebb tide to obtain impact water quality levels at the eleven monitoring stations during general water quality monitoring for the reporting period.

2.2 Water Quality Parameters, Time, Frequency

- 2.2.1 Dissolved Oxygen (DO), Turbidity, Suspended Solids (SS), Salinity and pH have been undertaken at the eleven monitoring stations during general water quality monitoring.
- 2.2.2 DO, temperature, salinity, turbidity and pH have been measured in-situ and the SS has been assayed in a HOKLAS laboratory.
- 2.2.3 In associate with the water quality parameters, other relevant data were also measured, such as monitoring location/position, time, water depth, sampling depth, tidal stages, weather conditions and any special phenomena or work underway nearby were also recorded. The monitoring schedule is provided in **Appendix C**.
- 2.2.4 Impact water quality monitoring was conducted 3 days per week in the reporting period. All parameters were monitored during mid-flood and mid-ebb tides at three water depths for general water quality monitoring. The interval between two sets of monitoring has not been less than 36 hours.
- 2.2.5 **Table 2.1** summarizes the monitoring parameters, frequency and duration of the impact water quality monitoring during construction phase.

Table 2.1 Water Quality Monitoring Parameters, Frequency and Duration

Parameter, unit	Frequency	No. of Depths
<ul style="list-style-type: none"> • Water Depth (m) • Temperature (°C) • Salinity (ppt) • pH (pH unit) • Dissolved Oxygen (DO) (mg/L and % of saturation) • Turbidity (NTU) • Suspended Solids (SS), mg/L 	General water quality monitoring : 3 days per week, at mid-flood and mid-ebb tides	3 water depths: 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

2.3 Water Quality Monitoring Locations

2.3.1 Impact water quality monitoring was conducted at eleven monitoring locations (B1-B4, H1, C1, C2, F1, CR1, CR2 & M1) during general water quality monitoring as shown in **Figure 2.1**. As per the relocation proposal verified by IEC and approved by EPD, the monitoring location C1, C2, S2, F1 are relocated at C1A, C2A, S2A, F1A as equivalent points respectively to clear up the concerns from stakeholders.

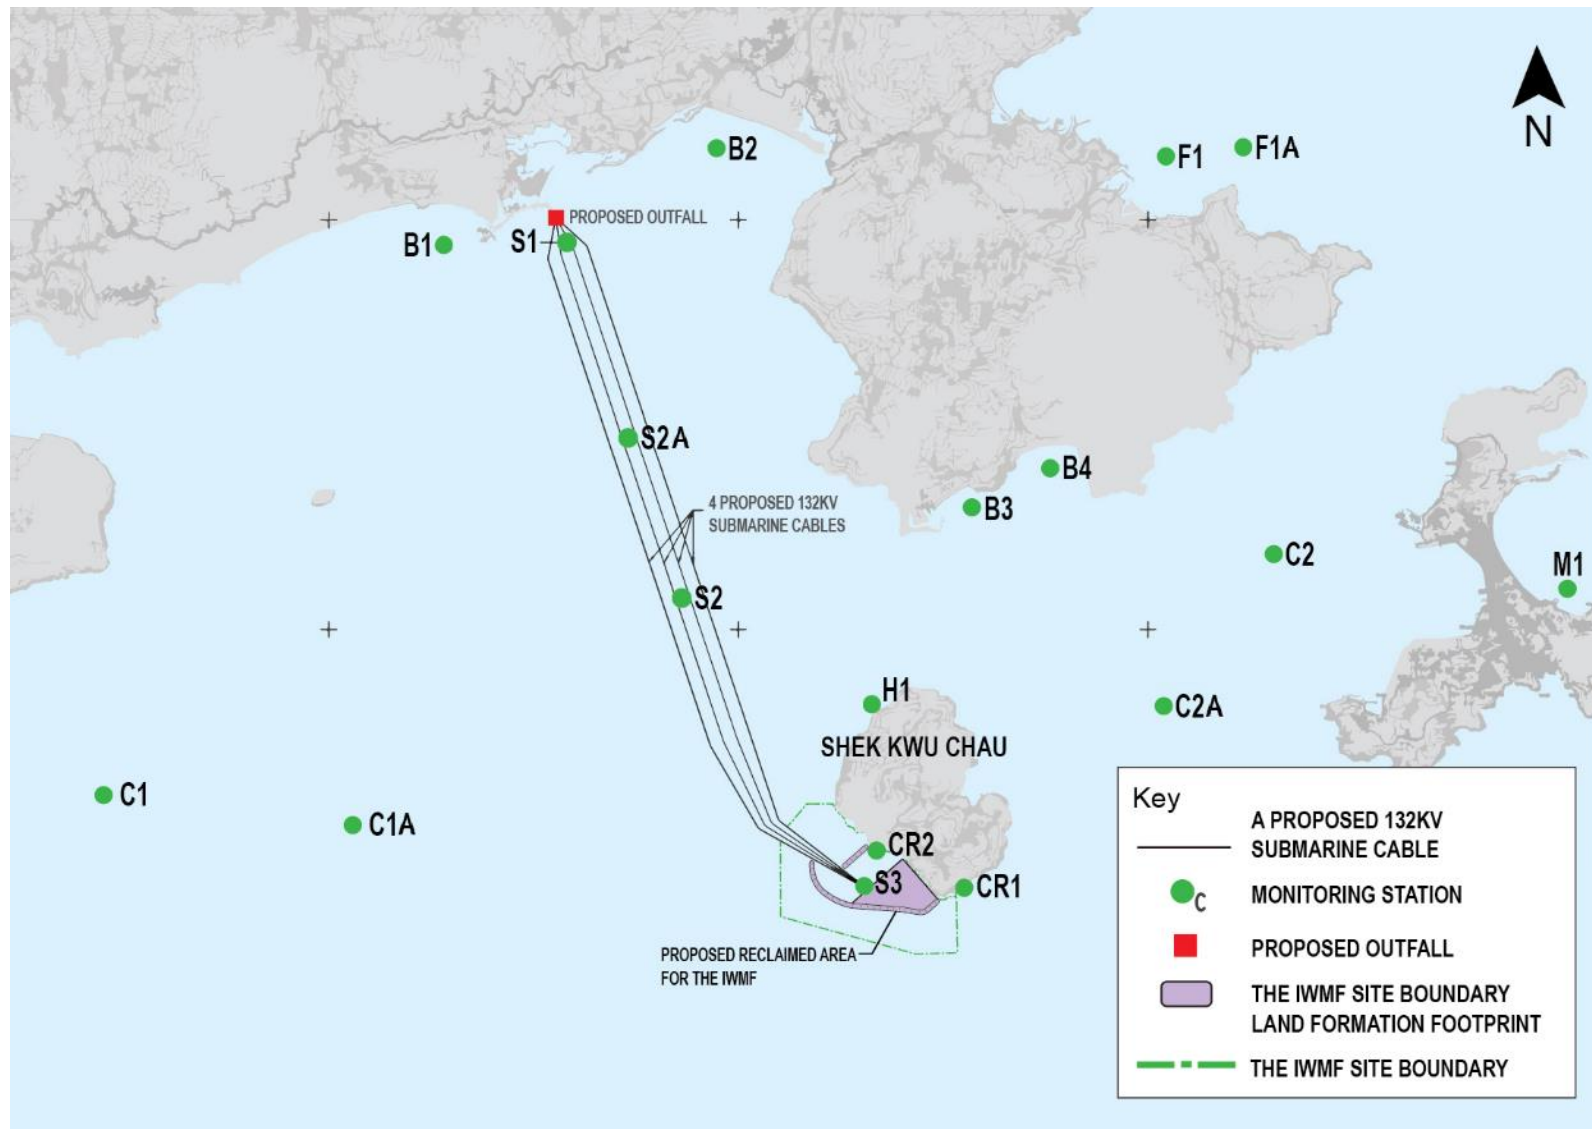


Figure 2.1 Water monitoring locations at Artificial Island near SKC

2.3.2 B1 to B4 are located at 4 beaches respectively at the southern shore of Lantau Island. Monitoring station H1 is located at the horseshoe crab habitat at northern SKC, while CR1 and CR2 are located at the coral communities at southwestern shore of SKC. Monitoring station F1 is located at the Cheung Sha Wan Fish Culture Zone while monitoring station M1 is located at Tung Wan at Cheung Chau. Monitoring station F1A is relocated for F1 at the Cheung Sha Wan Fish Culture Zone. S1, S2 and S3 are located at the northern landing site, midway and southern landing site of the proposed submarine cable, respectively. S2A is the relocated monitoring station of S2 which represents the midway landing site of the proposed submarine cable. S1, S2/S2A and S3 are required for monitoring due to the laying of submarine cable. Control stations C1 and C2 at far field locations are for comparison. Control stations C1A and C2A are relocated for C1 and C2 respectively as equivalent far field locations for comparison.

2.3.3 Fourteen monitoring stations are listed in **Table 2.2**:

Table 2.2 – Locations of Marine Water Quality Stations

Monitoring station	Description	Easting	Northing
B1	Beach – Cheung Sha Lower	813342	810316
B2	Beach – Pui O	815340	811025
B3	Beach – Yi Long Wan	817210	808395
B4	Beach – Tai Long Wan	817784	808682
H1	Horseshoe Crab – Shek Kwu Chau	816477	806953
C1	Control Station <small>(note i)</small>	810850	806288
C1A	Relocated Control Station	812823	806300
C2	Control Station <small>(note ii)</small>	819421	808053
C2A	Relocated Control Station	818869	806808
F1	Cheung Sha Wan Fish Culture Zone <small>(note iii)</small>	818631	810966
F1A	Cheung Sha Wan Fish Culture Zone	819109	810924
S1	Submarine Cable Landing Site	814245	810335
S2	Submarine Cable <small>(note iv)</small>	815076	807747
S2A	Submarine Cable	814808	808515
S3	Submarine Cable Landing Site	816420	805621
CR1	Coral	817144	805597
CR2	Coral	816512	805882
M1	Tung Wan	821572	807799

Note:

- i. Relocated to C1A in Mar 2019
- ii. Relocated to C2A in Mar 2019
- iii. Relocated to S2A in Mar 2019
- iv. Relocated to F1A in Mar 2019

2.4 Impact Monitoring Methodology

- 2.4.1 General water quality monitoring was conducted three days per week, at mid-flood and mid-ebb tides, at the designated water quality monitoring stations during the reporting period.
- 2.4.2 The interval between 2 sets of monitoring was not less than 36 hours. Sampling was collected at three water depths, namely, 1m below water surface, mid-depth and 1m above seabed, except where the water depth is less than 6m, the mid-depth was omitted. If the water depth was less than 3m, only the mid-depth station was monitored.
- 2.4.3 All observations and results were recorded in the data record sheets in **Appendix D**. Duplicate in-situ measurements and water sampling were carried out in each sampling event. The monitoring probes were retrieved out of water after the first measurement and then redeployed for the second measurement. When the difference in value between the first and second readings of DO or turbidity is more than 25% of the value of the first reading, the reading would be discarded and further readings would be taken.

In-situ Measurement

- 2.4.4 Levels of DO, pH, temperature, turbidity and salinity would be measured in-situ by portable and weatherproof measuring instrument, e.g. YSI ProDSS and Horiba U-53 Multiparameter complete with cable and sensor. (Refer to <http://www.ysi.com/ProDSS> for YSI ProDSS technical specification and <http://www.horiba.com/process-environmental/products/water-treatment-environment/details/u-50-multiparameter-water-quality-checker-368/> for Horiba U-53 technical specification). Water current velocity and Water Current direction would be measured by portable and weatherproof current meter, e.g. SonTek Hydrosurveyor (Refer to <https://www.sontek.com/media/pdfs/riversurveyor-s5-m9-brochure.pdf> for SonTek Hydrosurveyor M9 technical specification). Parameters measured by in-situ measurement is tabulated in **Table 2.3**

Table 2.3 – Parameters Measured by In-situ Measurement

Parameter	Resolution	Range
Temperature	0.1 °C	-5-70 °C
Dissolved Oxygen (DO)	0.01 mg/L	0-50.0 mg/L
Turbidity	0.1 NTU	0-1000 NTU
pH	pH 0.01	pH 0-14
Salinity	0.01 ppt	0-40 ppt
Water Current Velocity	0.001m/s	±20m/s
Water Current Direction	±1°	±2°

Laboratory Analysis

- 2.4.5 Analysis of SS shall be carried out in a HOKLAS accredited laboratory, as shown in **Appendix E**. Sufficient water samples shall be collected at the monitoring stations for carrying out the laboratory determinations. The determination work shall be started within 24 hours after collection of the water samples. Analytical methods and detection limits for SS is presented in **Table 2.4**.

Table 2.4 – Analytical Methods Applied to Water Quality Samples

Parameter	Analytical method	Detection Level
Suspended Solids, SS	APHA 2540 D _i	1 mg/L

Footnote:

- i. “APHA 2540 D” stands for American Public Health Association Standard Methods for the Examination of Water and Wastewater, 23rd Edition.

Field Log

2.4.6 Other relevant data was recorded, such as: monitoring location / position, time, water depth, weather conditions and any special phenomena underway near the monitoring station.

2.5 Monitoring Equipment

2.5.1 Equipment used in the impact water quality monitoring programme is summarized in **Table 2.5** below. Calibration certificates for the water quality monitoring equipment are attached in **Appendix F**.

Table 2.5 Impact Water Quality Monitoring Equipment

Monitored Parameter	Equipment	Brand and Model
DO, Temperature, Salinity, pH and Turbidity	Multi-functional Meter	Horiba U-53
Coordinates	Positioning Equipment	Garmin GPSMAP 78s
Water depth	Water Depth Detector	Hummingbird 160 Portable
SS	Water Sampler	Wildco 2 L Water Sampler with messenger

2.5.2 Dissolved Oxygen and Temperature Measuring Equipment

The instrument is a portable and weatherproof DO probe mounted on the multi-functional meter complete with cable and sensor and is powered by a DC supply source. The equipment was capable of measuring:

- A DO level in the range of 0 - 50 mg/L; and
- Temperature of -5 - 70 degree Celsius.

2.5.3 Turbidity Measurement Instrument

The instrument is a portable and weatherproof turbidity-measuring probe mounted on the multi-functional meter and is powered by a DC supply source. The instrument is equipped with a photoelectric sensor which is capable of measuring turbidity between 0 – 1000 NTU.

2.5.4 pH Measurement Instrument

The probe consists of a potentiometer, a glass electrode, a reference electrode and a temperature-compensating device mounted on the multi-functional meter. It is readable to 0.1 pH in a range of 0 to 14. Standard buffer solutions of at least pH 7 and pH 10 were used for calibration of the instrument before and after use.

2.5.5 Salinity Measurement Instrument

A portable salinometer mounted on the multi-functional meter capable of measuring salinity in the range of 0-40 parts per thousand (ppt) was provided for measuring salinity of the water at each monitoring location.

2.5.6 Sampler

The water sampler comprises a transparent PVC cylinder, with a capacity of not less than 2 litres, which can be effectively sealed with latex cups at both ends. The sampler has a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler is at the selected water depth.

2.5.7 Sample Containers and Storage

Water samples for SS were stored in high density polythene bottles with no preservative added, packed in ice (cooled to 4°C without being frozen) and delivered to the laboratory and analysed as soon as possible after collection. Sufficient volume of samples was collected to achieve the detection limit stated in **Table 2.4**.

2.5.8 Water Depth Detector

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station. This unit could either be hand-held or affixed to the bottom of the work boat, if the same vessel is to be used throughout the monitoring programme.

2.5.9 Monitoring Position Equipment

Hand-held digital Differential Global Positioning System (DGPS) with way point bearing indication and Radio Technical Commission for maritime (RTCM) Type 16 error message ‘screen pop-up’ facilities (for real-time auto-display of error messages and DGPS corrections from the Hong Kong Hydrographic Office) was provided and used to ensure that the water sampling locations were correct during the water quality monitoring work.

2.6 Maintenance and Calibration

2.6.1 The multi-functional meters were checked and calibrated before use. Multi-functional meters were certified by a laboratory accredited under HOKLAS or any other international accreditation scheme, and subsequently re-calibrated at three monthly intervals throughout all stages of the water quality monitoring. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before commencement of monitoring and after completion of all measurements each day. Calibration was not conducted at each monitoring location as daily calibration is adequate for the type of DO meter employed.

2.6.2 Sufficient stocks of spare parts were provided and maintained for replacements when necessary. Backup monitoring equipment was prepared for uninterrupted monitoring during equipment maintenance or calibration during monitoring.

2.7 Action and Limit Levels

2.7.1 The Action and Limit Levels have been set based on the derivation criteria specified in the Updated EM&A Manual and Detailed DCM Plan, as shown in **Table 2.6** below.

Table 2.6 Criteria of Action and Limit Levels for Water Quality

Parameters	Action	Limit
Construction Phase Impact Monitoring		
DO in mg/L	≤ 5 %-ile of baseline data	≤ 4
SS in mg/L	≥ 95 %-ile of baseline data or 120% of control station's SS at the same tide of the same day of measurement, whichever is higher	≥ 99 %-ile of baseline data or 130% of control station's SS at the same tide of the same day of measurement, whichever is higher
Turbidity in NTU	≥ 95 %-ile of baseline data or 120% of control station's turbidity at the same tide of the same day of measurement, whichever is higher	≥ 99 %-ile of baseline data or 130% of control station's turbidity at the same tide of the same day of measurement, whichever is higher
Temperature in °C	1.8°C above the temperature recorded at representative control station at the same tide of the same day	2°C above the temperature recorded at representative control station at the same tide of the same day
Total Alkalinity in mg/L	≥ 95 %-ile of baseline data or 120% of representative control station at the same tide of the same day, whichever is higher	≥ 99 %-ile of baseline data or 130% of representative control station at the same tide of the same day, whichever is higher

2.7.2 Based on the baseline monitoring data and the derivation criteria specified above, the Action/Limit Levels have been derived and are presented in **Table 2.7** and **Table 2.8** for both dry seasons (October – March) and wet seasons (April – September).

Table 2.7 Derived Action and Limit Levels for Water Quality Monitoring (Dry Season)

Parameters	Action	Limit
Construction Phase Impact Monitoring		
DO in mg/L	≤ 7.13	≤ 4
SS in mg/L	≥ 8 or 120% of control station's SS at the same tide of the same day of measurement, whichever is higher	≥ 10 or 130% of control station's SS at the same tide of the same day of measurement, whichever is higher

Parameters	Action	Limit
Turbidity in NTU	≥ 5.6 or 120% of control station's turbidity at the same tide of the same day of measurement, whichever is higher	≥ 12.8 or 130% of control station's turbidity at the same tide of the same day of measurement, whichever is higher
Temperature in °C	1.8°C above the temperature recorded at representative control station at the same tide of the same day	2°C above the temperature recorded at representative control station at the same tide of the same day
Total Alkalinity in mg/L	≥116 or 120% of control station's Total Alkalinity at the same tide of the same day of measurement, whichever is higher	≥ 118 or 130% of control station's Total Alkalinity at the same tide of the same day of measurement, whichever is higher

Notes:

- i. "Depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
- ii. For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
- iii. For turbidity, SS and Salinity, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.

Table 2.8 Derived Action and Limit Levels for Water Quality (Wet Season)

Parameters	Action	Limit
Construction Phase Impact Monitoring		
DO in mg/L	≤ 5.28	≤ 4
SS in mg/L	≥ 12 or 120% of control station's SS at the same tide of the same day of measurement, whichever is higher	≥ 14 or 130% of control station's SS at the same tide of the same day of measurement, whichever is higher
Turbidity in NTU	≥ 4.0 or 120% of control station's turbidity at the same tide of the same day of measurement, whichever is higher	≥ 4.3 or 130% of control station's turbidity at the same tide of the same day of measurement, whichever is higher
Temperature in °C	1.8°C above the temperature recorded at representative control station at the same tide of the same day	2°C above the temperature recorded at representative control station at the same tide of the same day
Total Alkalinity in mg/L	≥ 116 mg/L or 120% of representative control station at the same tide of the same day, whichever is higher	≥ 118 mg/L or 130% of representative control station at the same tide of the same day, whichever is higher

Notes:

- i. "Depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
- ii. For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
- iii. For turbidity, SS and Salinity, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.

2.7.3 If exceedances were found during water quality monitoring, the actions in accordance with the Event and Action Plan shall be carried out according to **Appendix G**.

2.8 Monitoring Results and Observations

2.8.1 As confirmed by the Contractor on 14 October 2020, all DCM works was completed on 14 October 2020, the post DCM water quality monitoring was completed for further 4 weeks (i.e. from 16 October 2020 to 14 November 2020) according to the approved Detailed Plan on Deep Cement Mixing. As all DCM work and post DCM water quality monitoring were completed, no water quality monitoring was conducted at S1, S2A and S3 during the reporting period and no total alkalinity measurement was made during the reporting period. General water quality monitoring at all the eleven monitoring stations were conducted on 2, 4, 7, 9, 12, 14, 16, 18, 20, 22, 24, 28 and 30 December 2020.

2.8.2 Monitoring results of 5 key parameters: Salinity, DO, turbidity, SS, pH and temperature in this reporting, are summarized in **Table 2.9**, and details results are presented in **Appendix D**.

Table 2.9 Summary of Impact Water Quality Monitoring Results

Locations		Parameters						
		Salinity (ppt)	Dissolved Oxygen (mg/L)		pH	Turbidity (NTU)	Suspended Solids (mg/L)	Temp.(°C)
			Surface & Middle	Bottom				
B1	Avg.	30.58	9.02	8.77	8.46	2.9	6.52	20.5
	Min.	29.84	7.41	6.65	8.08	2.0	2.00	18.7
	Max.	31.26	10.15	9.91	8.71	3.8	15.00	23.8
B2	Avg.	30.58	8.90	8.89	8.47	3.0	6.76	20.5
	Min.	29.52	6.68	6.32	8.07	1.9	2.00	18.7
	Max.	31.29	9.92	9.85	8.78	3.8	15.00	23.9
B3	Avg.	30.58	8.92	8.93	8.46	2.9	6.97	20.5
	Min.	29.53	7.49	6.61	8.07	2.0	3.00	18.7
	Max.	31.33	9.89	10.18	8.73	3.8	17.00	23.9
B4	Avg.	30.50	9.01	8.87	8.48	2.9	6.86	20.5
	Min.	29.46	7.08	6.87	8.05	2.0	2.00	18.6
	Max.	31.16	10.32	9.78	8.76	3.8	16.00	23.8
C1A	Avg.	30.57	8.93	8.79	8.48	3.0	7.33	20.4
	Min.	29.53	6.48	6.53	8.11	2.2	2.00	18.5
	Max.	31.31	10.04	10.17	8.78	3.9	15.00	23.8
C2A	Avg.	30.59	8.89	8.94	8.46	3.1	7.38	20.4
	Min.	29.61	6.74	7.62	8.10	2.1	3.00	18.4
	Max.	31.35	10.32	9.86	8.74	4.1	13.00	23.9
CR1	Avg.	30.59	8.88	8.92	8.46	3.0	7.51	20.4
	Min.	29.48	6.55	6.63	8.06	2.2	2.00	18.6
	Max.	31.33	10.22	9.88	8.73	3.9	14.00	23.8
CR2	Avg.	30.58	8.92	8.93	8.45	3.0	7.27	20.5
	Min.	29.55	6.89	6.35	8.06	2.1	2.00	18.6
	Max.	31.32	9.95	10.23	8.73	3.8	14.00	23.8
F1A	Avg.	30.57	8.78	8.95	8.46	2.9	6.72	20.5
	Min.	29.56	6.48	6.24	8.03	2.0	2.00	18.6
	Max.	31.34	10.13	10.18	8.75	3.9	12.00	23.8
H1	Avg.	30.57	8.85	8.85	8.47	2.9	6.79	20.4
	Min.	29.50	6.56	7.30	8.05	1.9	3.00	18.5
	Max.	31.25	10.18	10.34	8.76	3.9	11.00	23.8
M1	Avg.	30.55	8.90	8.95	8.46	2.9	6.92	20.4
	Min.	29.52	6.56	6.75	8.07	1.9	2.00	18.6
	Max.	31.30	10.10	9.99	8.79	3.9	13.00	23.8
S1	Avg.	-	-	-	-	-	-	-
	Min.	-	-	-	-	-	-	-
	Max.	-	-	-	-	-	-	-
S2A	Avg.	-	-	-	-	-	-	-
	Min.	-	-	-	-	-	-	-
	Max.	-	-	-	-	-	-	-
S3	Avg.	-	-	-	-	-	-	-
	Min.	-	-	-	-	-	-	-
	Max.	-	-	-	-	-	-	-

Notes:

- i. "Avg", "Min" and "Max" is the average, minimum and maximum respectively of the data from measurements conducted under mid-flood and mid-ebb tides at three water depths, except that of DO where the data for "Surface & Middle" and "Bottom" are calculated separately.
- ii. As all DCM works and post DCM water quality monitoring were completed, no water quality monitoring was conducted at S1, S2A and S3 in the report period.

- 2.8.3 During the impact monitoring period for December 2020, ten (10) of general water quality monitoring results of suspended solids (SS) obtained had exceeded Action Level. Eight (8) of general water quality monitoring results of SS obtained during the reporting period had exceeded the Limit Level.
- 2.8.4 Details of the exceedance are presented in **Section 8**.
- 2.8.5 Mitigation measures minimizing the adverse impacts on water implemented are listed in the implementation schedule given in **Appendix B**.

3. NOISE MONITORING

3.1 Monitoring Requirements

3.1.1 To ensure no adverse noise impact, noise monitoring is recommended to be carried out at the nearby noise sensitive receivers (NSRs) during construction phase.

3.1.2 In accordance with the Updated EM&A Manual, baseline noise level at the noise monitoring stations was established as presented in the Baseline Monitoring Report. Impact noise monitoring was conducted once per week in the form of 30-minutes measurements L_{eq} , L_{10} and L_{90} levels recorded at each monitoring station between 0700 and 1900 hours on normal weekdays.

3.1.3 In accordance with the Updated EM&A Manual, additional weekly impact monitoring should be carried out during respective restricted hours period (1900 – 0700 hours) if the construction works were conducted at evening and night time. Additional weekly noise monitoring was conducted once per week in the form of 5-minutes measurements L_{eq} , L_{10} and L_{90} levels recorded at each monitoring station between 1900 and 0700 hours as well as public holidays and Sundays.

3.2 Noise Monitoring Parameters, Time, Frequency

3.2.1 Impact noise monitoring was conducted weekly in the reporting period between 0700-1900 hours on normal weekdays. Additional impact noise monitoring was conducted weekly in the reporting period between 1900-0700 hours on all days as well as public holidays and Sundays.

3.2.2 Construction noise level measured in terms of the A-weighted equivalent continuous sound pressure level (L_{Aeq}). $L_{eq\ 30min}$ was used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. $L_{eq\ 5mins}$ was used as the monitoring parameter for the time period between 1900 and 0700 hours as well as public holidays and Sundays. **Table 3.1** summarizes the monitoring parameters, frequency and duration of the impact noise monitoring and additional impact noise monitoring. The monitoring schedule is provided in **Appendix C**.

Table 3.1 Noise Monitoring Parameters, Time, Frequency and Duration

Monitoring Station	Time	Duration	Parameters
M1/ N_S1, M2/ N_S2, M3/ N_S3	Day time: 0700-1900 hrs (during normal weekdays)	Once per week $L_{eq\ 5min}/L_{eq\ 30min}$ (average of 6 consecutive $L_{eq\ 5min}$)	L_{eq} , L_{10} & L_{90}
	Evening time: 1900-2300 hrs (including normal weekdays, also public holidays and Sundays)	Once per week $L_{eq\ 5min}$ (3 sets of $L_{eq\ 5min}$)	L_{eq} , L_{10} & L_{90}
	Night time: 2300-0700 hrs (including normal weekdays, also public holidays and Sundays)	Once per week $L_{eq\ 5min}$ (3 sets of $L_{eq\ 5min}$)	L_{eq} , L_{10} & L_{90}

3.3 Noise Monitoring Locations

3.3.1 Three noise monitoring locations for impact monitoring and additional impact monitoring at the nearby sensitive receivers are shown in **Figure 3.1**.

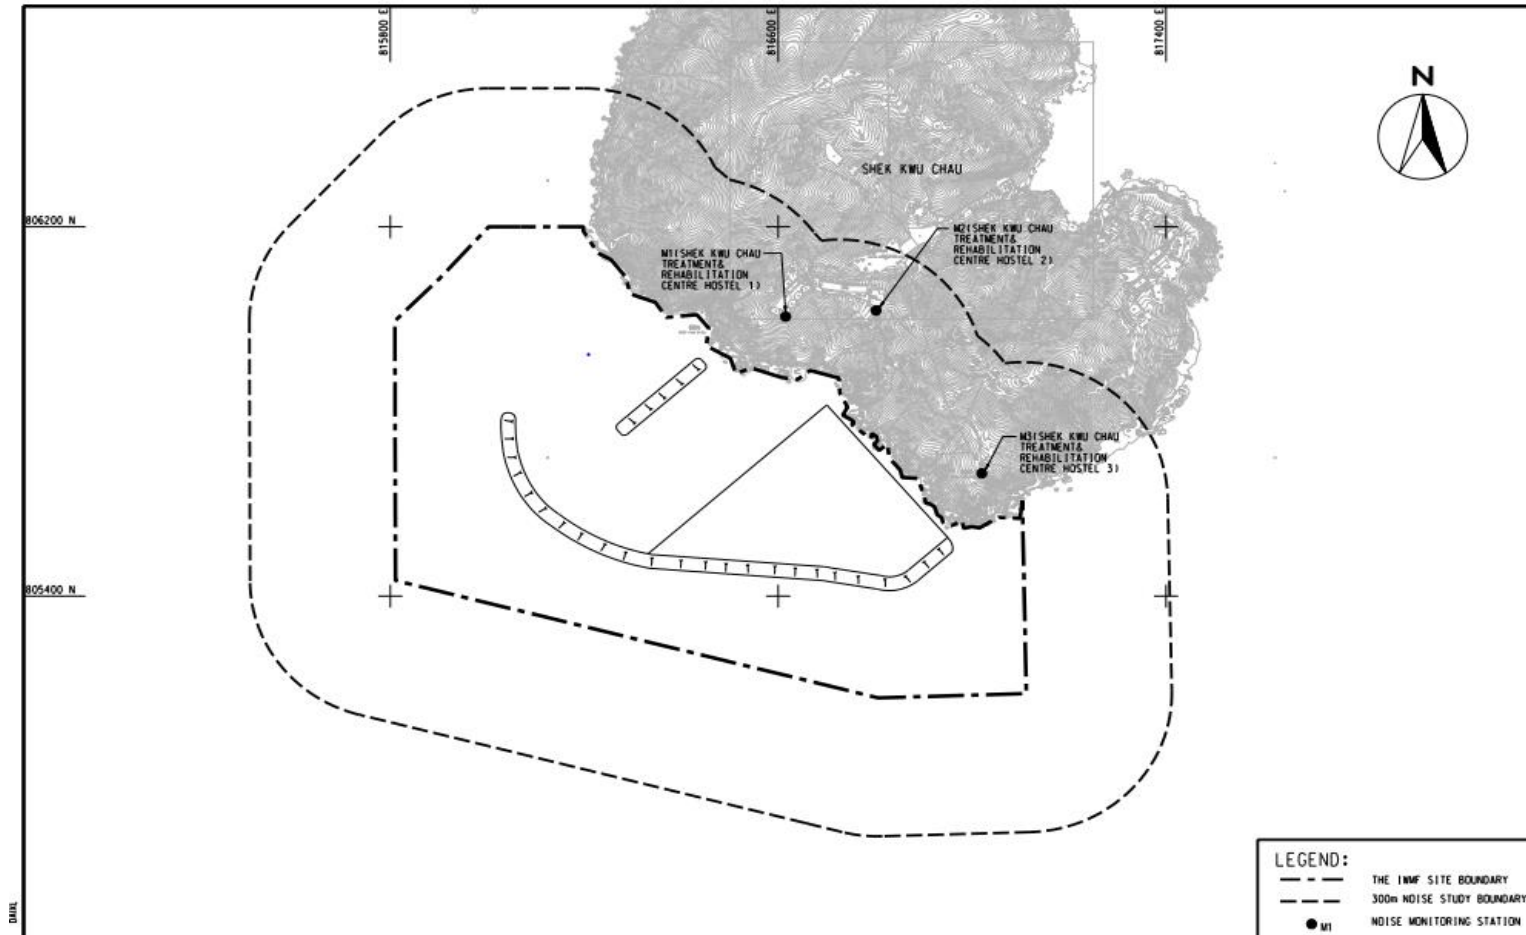


Figure 3.1 Noise monitoring locations at SKC

3.3.2 M1, M2 and M3 are Shek Kwu Chau Treatment and Rehabilitation Centre Hostel 1, 2 and 3 respectively of The Society for the Aid and Rehabilitation of Drug Abusers (SARDA) located at southern part of Shek Kwu Chau.

3.3.3 Measurements at M1 & M3 were conducted at a point 1m from the exterior of the sensitive receivers building façade and at a position 1.2m above the ground. Measurement setup at M3 has been varying with minor adjustment to minimize the disturbance to the users of Treatment Centre. Measurement at M2 was conducted at a point 1m from building façade of the ceiling of 1st floor level for avoidance of mutual disturbance with users of Treatment Centre. The minor adjustment of monitoring locations, which were in favour to mutual convenience with the users of Treatment Centre, were found with no effect on monitoring result based on on-site observation and experience from the Baseline monitoring of the Project. The noise monitoring stations are summarized in **Table 3.2** below.

Table 3.2 Noise Monitoring Location

Station	NSR ID in EIA Report	Noise Monitoring Location	Type of sensitive receiver(s)	Measurement Type
M1	N_S1	Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 1	Residential	Façade
M2	N_S2	Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 2	Residential	Façade
M3	N_S3	Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 3	Residential	Façade

3.4 Impact Monitoring Methodology

3.4.1 At each designated monitoring location, measurements of six 5-minutes A-weighted equivalent sound pressure level [$L_{eq\ 5min}$] was carried out between 0700 and 1900 hours for daytime measurements on a normal weekdays (exclude Sunday or general holiday). The measured six impact noise levels at each monitoring location shall then be averaged in logarithmic scale and expressed in terms of the 30 minutes A-weighted equivalent continuous sound pressure level ($L_{eq\ 30min}$) for the time period between 0700 and 1900 hours on normal weekdays.

3.4.2 At each designated monitoring location, measurements of three 5-minutes A-weighted equivalent sound pressure level [$L_{eq\ 5min}$] was carried out between 1900 and 0700 hours for evening time and night time measurements.

3.4.3 The monitoring procedures are as follows:

- The microphone head of the lead level meter was normally positioned 1m exterior of the noise sensitive façade and lowered sufficiently so that the building’s external wall acts as a reflecting surface.
- If there is a problem with the access to the normal monitoring position, an alternative may be chosen and appropriate correction would be applied according to acoustic principle when necessary. For reference, +3 dB(A) correction would be made for free-filed measurements.
- The battery condition was checked to ensure good functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - Frequency weight: A
 - Time weighting: Fast
 - Measurement time: 5 minutes

- Prior to and after noise measurement, the meter was calibrated using the calibrator for 94.0 dB at 1000Hz. If the difference in the calibration level before and after measurement is more than 1.0 dB, the measurement was considered invalid and repeat of noise measurement was required after re-calibration or repair of the equipment.
- For Noise monitoring was carried out for 30 mins by sound level meter. At the end of the monitoring period, noise levels in terms of L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded when the equipment were checked and inspected.
- All the monitoring data within the sound level meter system was downloaded through the computer software.

3.5 Monitoring Equipment

3.5.1 Integrated sound level meter was used for the noise monitoring. The meter shall comply with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications.

3.5.2 Equipment used in the impact noise monitoring programme is summarized in **Table 3.3** below. Calibration certificates for the noise monitoring equipment are attached in **Appendix H**.

Table 3.3 Impact Noise Monitoring Equipment

Equipment	Brand and Model
Sound Level Meter	NTi XL2 SVANTEK 971
Sound Level Meter Calibrator	Pulsar 105

3.6 Maintenance and Calibration

3.6.1 The maintenance and calibration procedures were as follows:

- The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- The sound level meter and calibrator were checked and calibrated at yearly intervals
- Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration levels from before and after the noise measurement agree to within 1.0dB.

3.7 Action and Limit Levels

3.7.1 The Action/Limit Levels in line with the criteria of Practice Note for Professional Persons (ProPECC PN 2/93) “Noise from Construction Activities – Non-statutory Controls” and Technical Memorandum on Environmental Impact Assessment Process issued by HKSAR Environmental Protection Department [“EPD”] under the Environmental Impact Assessment Ordinance, Cap 499, S.16 is presented in **Table 3.4**.

Table 3.4 Action and Limit Levels for Noise per Updated EM&A Manual

Time Period	Action	Limit (dB(A))
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)

Notes: If works are to be carried out during restricted hours, the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority have to be followed.

3.7.2 If exceedances were found during noise monitoring. The actions in accordance with the Event and Action Plan shall be carried out according to **Appendix I**.

3.8 Monitoring Results and Observations

3.8.1 Impact monitoring for noise impact for daytime was carried out on 1, 7, 14, 21 & 28 December 2020. Impact monitoring for noise impact for evening time and night time was carried out on 1&2, 7&8, 14&15, 21&22, 28&29 December 2020. The impact noise levels at Noise Monitoring Stations at SKC (i.e. M1/N_S1 to M3/N_S3) are summarized in **Table 3.6**, **Table 3.7** and **Table 3.8** respectively. Details of noise monitoring results are presented in **Appendix J**.

3.8.2 Major construction activity, major noise source and extreme weather which might affect the results were recorded during the impact monitoring.

3.8.3 According to our field observations, the major noise source identified at the alternative noise monitoring station in the reporting month are summarised in **Table 3.5**. No noticeable noise source was found near the monitoring station M2 and air conditioning units were observed nearby monitoring stations M1 and M3.

Table 3.5 Summary of Field Observation

Monitoring Station	Major Noise Source
M1	Nil
M2	Nil
M3	Nil

No data from impact monitoring during daytime has exceeded the stipulated limit level at 75 dB(A).

Table 3.6 Summary of Impact Noise Monitoring Results during Day Time (0700 – 1900 hours)

Location	Measured Noise Level in dB(A)		
	Range of $L_{eq\ 30min}$	Range of $L_{10\ 30min}$	Range of $L_{90\ 30min}$
M1	54.7 – 59.6	56.6 – 65.1	46.7 – 49.4
M2	56.8 – 69.8	61.6 – 72.5	47.1 – 52.8
M3	50.0 – 61.2	56.5 – 65.8	44.1 – 56.5

Applicable mitigation measures for construction works are fully implemented as shown in **Appendix B**, where double-glazed windows and air conditioning system were also installed and confirmed operable for the NSRs (N_S1, N_S2 & N_S3).

During the noise monitoring event, frontline staff of ET had inquired the treatment centre users on any noise disturbance from the construction activities at evening and night time, where no complaint and adverse opinions was received.

Data from impact monitoring during evening time and night time were compared with the NCO criteria. Where site inspection and auditing on Contractor’s record have shown that the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority for construction works during restricted hours were followed. No inappropriate practice was spotted during evening time and night time construction works, thus the stipulated requirement on noise impact control during night time and evening time was achieved.

Table 3.7 Summary of Additional Impact Noise Monitoring Results during Evening Time (1900 – 2300 hours)

Location	Measured Noise Level in dB(A)		
	Range of $L_{eq\ 5min}$	Range of $L_{10\ 5min}$	Range of $L_{90\ 5min}$
M1	51.7 – 63.4	63.0 – 67.4	45.1 – 59.9
M2	50.3 – 59.5	51.5 – 63.4	47.0 – 57.8
M3	48.0 – 61.4	49.0 – 66.0	45.3 – 56.7

Table 3.8 Summary of Additional Impact Noise Monitoring Results during Night Time (2300 – 0700 hours)

Location	Measured Noise Level in dB(A)		
	Range of $L_{eq\ 5min}$	Range of $L_{10\ 5min}$	Range of $L_{90\ 5min}$
M1	53.6 – 63.2	56.7 – 67.2	42.2 – 64.4
M2	50.9 – 60.1	53.5 – 66.4	46.5 – 57.4
M3	48.2 – 62.1	53.2 – 65.3	44.3 – 59.7

4. WASTE

- 4.1 The waste generated from this Project includes inert construction and demolition (C&D) materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials.
- 4.2 As advised by the Contractor, 0.0 m³ of C&D material was generated on site in the reporting month. For C&D waste, no metals were generated and collected by registered recycling collector. 0 kg of paper was generated on site and collected by the registered recycling collector. No plastic waste was collected by registered recycling collector. 0.0 L of chemical waste was collected by the licensed chemical waste collector. 13.0 m³ of other types of wastes (e.g. general refuse) was generated on site and disposed of at designated landfill. 0.0 m³ of sand fill, 174,980.0 m³ of public fill and 57,838.0 m³ of fill rock were imported during the reporting period.
- 4.3 Chemical waste generated from the cleaning of oil stain and leakage on deck of barges was stored in the chemical waste storage area on the barges.
- 4.4 With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in **Table 4.1**. Details of cumulative waste management data are presented as a waste flow table in **Appendix K**.

Table 4.1 Quantities of Waste Generated from the Project during Dec 2020

Reporting Month	Actual Quantities of Inert C&D Materials Generated Monthly								Actual Quantities of C&D Wastes Generated Monthly					
	Total Quantity Generated	Hard Rock and Large Broken Concrete (see Note 1)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill			Metals	Paper / cardboard packaging	Plastics (see Note 2)	Chemical Waste		Others, e.g. general refuse (see Note 3)
						Sand	Public Fill	Rock						
	(in ,000 m ³)	(in ,000 m ³)	(in ,000 m ³)	(in ,000 m ³)	(in ,000 m ³)	(in ,000m ³)			(in ,000 kg)	(in ,000kg)	(in ,000 kg)	(in ,000 kg)	(in ,000 L)	(in ,000m ³)
Dec 2020	0	0	0	0	0	0	174.9800	57.8380	0	0	0	0	0	0.0130

- Notes:
- (1) Broken concrete for recycling into aggregates.
 - (2) Plastics refer to plastic bottles/ containers, plastic sheets/ foam from packaging materials.
 - (3) Use the conversion factor: 1 full load of dumping truck being equivalent to 6.5m³ by volume.

4.5 Although there is not much waste generation anticipated in the coming month from the Project, the Contractor is advised to sort and store any solid and liquid waste on-site properly prior to disposal.

5. CORAL

5.1 Coral Monitoring Requirements

5.1.1 To monitor the health condition of corals during different phases, corals located within areas likely to be affected by the Project, corals located at control sites (areas unlikely to be affected by the Project), the trans-located coral colonies as well as the tagged natural coral colonies at the recipient site were chosen, in order to identify any adverse indirect impact from the marine works. The size, percentage cover and health condition of corals (i.e. any sign of abnormal appearance, such as layer of mucus, bleaching, partial mortality etc.) at representative transects should be recorded during each monitoring.

5.2 Coral Monitoring Parameters, Time, Frequency

5.2.1 Rapid Ecological Assessment (REA) survey was conducted on 26 June 2018 at the suggested control site and indirect impact site within two weeks before commencement of the construction work which was 29 June 2018. 10 selected hard coral colonies with the similar species were tagged at both control and indirect impact sites. Following coral translocation in the recipient site R3, 16 coral colonies attached to rocks less than 50 cm in diameter were translocated and tagged, as well as 10 selected natural coral colonies, at the recipient site. One additional REA survey was conducted in December 2018 to further assess the seabed condition at Indirect Impact Site after Typhoon Mangkhut.

5.2.2 Tagged coral colonies at the suggested control site and indirect impact site are being monitored weekly for the first month and followed by monthly monitoring for two months. Quarterly monitoring will be carried out after the first three-months monthly monitoring for until the end of the construction phase. The selected Control Site is located at Yuen Kong Chau of Soko Islands about 7 km away from the project area. Tagged coral colonies at the proposed recipient site are being monitored quarterly for one year. The selected recipient site R3 is located at the opposite side of the Project area at about 2 km away. The detailed survey of the Control Site and Impact Site were conducted before the commencement of the Construction Phase.

5.2.3 Monitoring recorded the following parameters (using the same methodology adopted during the pre-translocation survey); the size, presence, health conditions (percentage of mortality/bleaching) and percentage of sediment of each tagged coral colony. The general environmental conditions including weather, sea, and tidal conditions of impact site, control site and recipient site were monitored.

5.2.4 **Table 5.1** summarizes the monitoring locations, time and frequency of the tagged coral colonies monitoring. The monitoring schedule is provided in **Appendix C**.

Table 5.1 Tagged Coral Monitoring Locations, Time and Frequency

Monitoring Location	Monitoring Month/Year	Frequency	No. of Monitoring Survey
10 selected hard coral colonies at control site / indirect impact site	1 st Month	Weekly Survey	4
	2 nd to 3 th Months	Monthly Survey	2
	4 th Month (postponed to 5 th month due to diver accident in Shek Kwu Chau in October 2018)	Re-tagging of Coral Colonies in Indirect Impact Site after Typhoon Mangkhut	

Monitoring Location	Monitoring Month/Year	Frequency	No. of Monitoring Survey
	4 th Month (postponed to 5 th month due to diver accident in Shek Kwu Chau in October 2018 and further postpone to 6 th month due to adverse weather)	Re-tagging of Coral Colonies in Control Site after Typhoon Mangkhut	
	5 th Month (postponed to 6 th month due to diver accident in Shek Kwu Chau and further postponed to 7 th month due to delay of re-tagging activities at both Indirect Impact Site and Control Site)	Post Re-tagging Monthly Survey	1
	7 th to 76 th Months (postponed to 8 th to 76 th month due to diver accident in Shek Kwu Chau in October 2018)	Quarterly Survey	23
16 translocated hard coral colonies and 10 selected natural hard coral colonies at recipient site R3	1 st Year	Quarterly Survey	4

5.3 Coral Monitoring Locations

5.3.1 Location of the ten tagged coral colonies at each of the proposed indirect impact site (re-tagging after typhoon Mangkhut), control site (baseline) and recipient site R3 (translocation) are shown in **Figure 5.1**, **Figure 5.2** and **Figure 5.3** respectively:

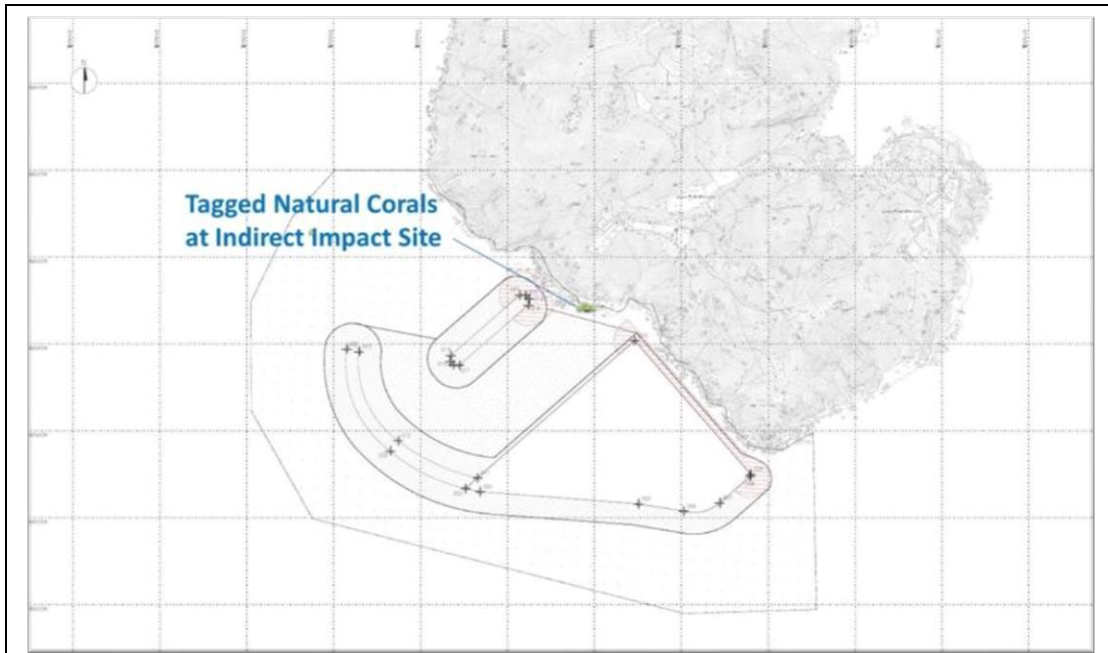


Figure 5.1 Tagged Natural Corals at Indirect Impact Site Near SKC for re-tagging after typhoon Mangkhut

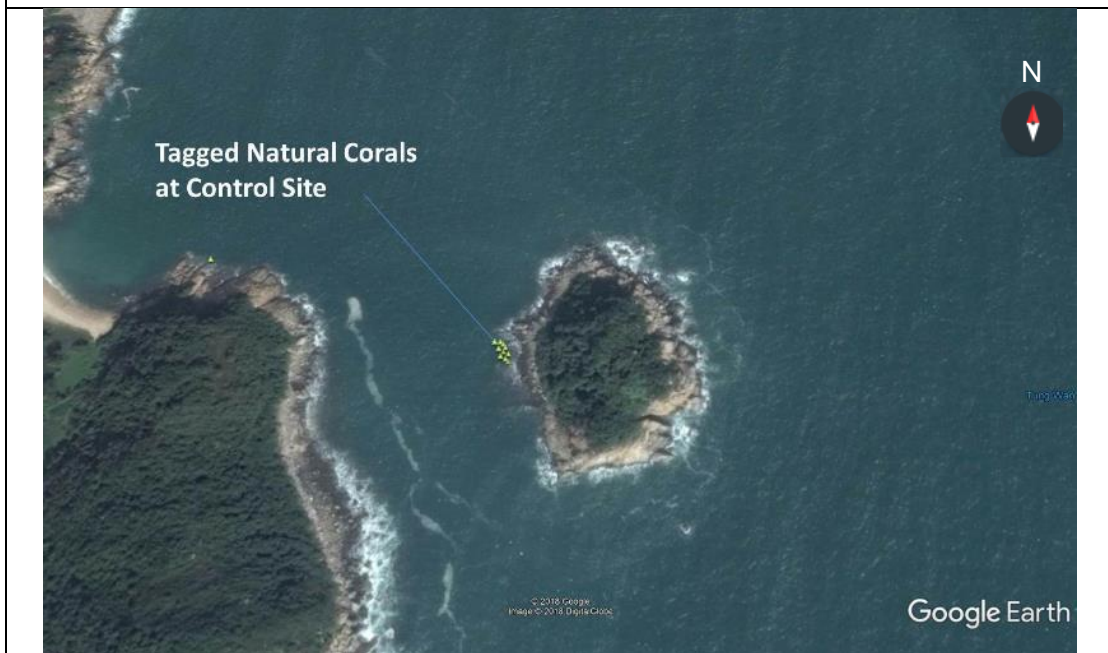


Figure 5.2 Tagged Natural Corals at Control Site Near Yuen Kong Chau for re-tagging after typhoon Mangkhut



Figure 5.3 Tagged Translocation Corals at Recipient Site R3 near SKC

5.3.2 The GPS coordinates of the tagged coral colonies, retagged coral colonies and recipient site were shown in **Table 5.2**, **Table 5.3** and **Table 5.4** respectively.

Table 5.2 Tagged Natural Corals during Baseline and Re-tagged Natural Corals after Typhoon Manghkut at Control Site near Yuen Long Chau

Coral #	GPS Coordinates	
1	N22°09'45.96"	E113°54'57.81"
2R	N22°11'29.12"	E113°59'09.01"
3	N22°09'45.81"	E113°54'57.78"
4	N22°09'45.70"	E113°54'57.95"
5R	N22°11'29.10"	E113°59'09.18"
6	N22°09'45.75"	E113°54'58.02"
7R	N22°11'29.17"	E113°59'08.86"
7	N22°09'45.65"	E113°54'57.94"
8	N22°09'45.53"	E113°54'57.90"
9	N22°09'46.23"	E113°54'54.70"
10R	N22°11'29.18"	E113°59'08.91"

Notes:

- i. The re-tagged corals were marked as ##R.

Table 5.3 Re-tagged Natural Corals after Typhoon Manghkut at Indirect Impact Site near SKC

Coral # ^{note i}	GPS Coordinates	
11R	N22°11'29.14"	E113°59'08.92"
12R	N22°11'29.12"	E113°59'09.01"
13R	N22°11'29.11"	E113°59'09.07"
14R	N22°11'29.13"	E113°59'09.12"
15R	N22°11'29.10"	E113°59'09.18"
16R	N22°11'29.07"	E113°59'09.23"

Coral # ^{note i}	GPS Coordinates	
17R	N22°11'29.17"	E113°59'08.86"
18R	N22°11'29.14"	E113°59'08.94"
19R	N22°11'29.20"	E113°59'08.81"
20R	N22°11'29.18"	E113°59'08.91"

Notes:

- i. The re-tagged corals were marked as ##**R**.

Table 5.4 GPS Coordinates of Recipient Site R3

Site	GPS Coordinates	
R3	N22°11'43.69"	E113°28.99"

5.4 Impact Monitoring Methodology

5.4.1 Health status of coral was assessed by the following criteria:

- Hard coral: Percentage of surface area exhibiting partial mortality and blanched/bleached area of each coral colony and degree of sedimentation.

5.5 Action and Limit Levels

- 5.5.1 Monitoring result was reviewed and compared against the below Action Level and Limit Level (AL/LL) as set with the below **Table 5.5** and **Table 5.6**.

Table 5.5 Action and Limit Levels for Construction Phase Coral Monitoring

Parameter	Action Level	Limit Level
Mortality	If during Impact Monitoring a 15% increase in the percentage of partial mortality on the corals occurs at more than 20% of the tagged indirect impact site coral colonies that is not recorded on the tagged corals at the control site, then the Action Level is exceeded.	If during Impact Monitoring a 25% increase in the percentage of partial mortality on the corals occurs at more than 20% of the tagged indirect impact site coral colonies that is not recorded on the tagged corals at the control site, then the Limit Level is exceeded.

Table 5.6 Action and Limit Levels for Post-Translocation Coral Monitoring

Parameter	Action Level	Limit Level
Mortality	If during Post-Translocation Monitoring a 15% increase in the percentage of partial mortality on the corals occurs at more than 20% of the translocated coral colonies that is not recorded on the original corals in the recipient site, then the Action Level is exceeded.	If during Post-Translocation Monitoring a 25% increase in the percentage of partial mortality on the corals occurs at more than 20% of the translocated coral colonies that is not recorded on the original corals in the recipient site, then the Limit Level is exceeded.

5.5.2 If exceedance was found during coral monitoring. The actions in accordance with the Event and Action Plan should be carried out according to **Appendix L**.

5.6 Monitoring Results and Observations

5.6.1 The 8th quarterly coral monitoring during construction phase at both Indirect Impact Site and Control Site was conducted on 23 Dec 2020 and the weather condition was summarized in **Table 5.7**.

Table 5.7 Weather Condition for the 8th Quarterly Coral Monitoring during Construction Phase at both Indirect Impact Site and Control Site

Date	Condition	Average Underwater Visibility
23 Dec 2020	- North to Northeast wind force 4-5 - Sunny period	Less than 0.5m

5.6.2 Ten (10) hard coral colonies were monitored at each Control site and Indirect Impact Site as suggested in the Construction Phase Monitoring Plan. The general health conditions (size, mortality, bleaching and sediment) were recorded and summarized in **Table 5.8** and **Table 5.9**. Photos of each coral colonies were taken during the monitoring activities shown in **Photo Plate 5.1** and **5.2**.

Table 5.8 Sizes, Condition, Mortality, Bleaching and Sediment of 10 Natural Coral Colonies at Control Site during 8th Quarterly Coral Monitoring

Tag #	Species	Size (cm) – Max. Diameter	Condition	Mortality (%)		Bleaching (%)		Sediment (%)	
				Baseline	23/12	Baseline	23/12	Baseline	23/12
1	<i>Goniopora stutchburyi</i>	25	Fair	0	0	0	0	0	0
2R	<i>Goniopora stutchburyi</i>	10	Good	0	0	0	0	0	0
3	<i>Psammocora superficialis</i>	18	Fair	0	0	0	0	0	0
4	<i>Turbinaria peltata</i>	13	Good	0	0	0	0	0	0
5R	<i>Goniopora stutchburyi</i>	18	Good	0	0	0	0	0	0
6	<i>Cyphastrea serailia</i>	43	Fair	0	0	0	0	0	0
7R	<i>Coscinaraea</i> sp.	15	Good	0	0	0	0	0	0
8	<i>Goniopora stutchburyi</i>	21	Good	0	0	0	0	0	0
9	<i>Goniopora stutchburyi</i>	11	Fair	0	0	0	0	0	0
10R	<i>Goniopora stutchburyi</i>	20	Good	0	0	0	0	0	0

Notes:

- i. The re-tagged corals were marked as ##R.


Table 5.9 Sizes, Condition, Mortality, Bleaching and Sediment of 10 Natural Coral Colonies at Indirect Impact Site during 8th Quarterly Coral Monitoring





Tag #	Species	Size (cm) – Max. Diameter	Condition	Mortality (%)		Bleaching (%)		Sediment (%)	
				Baseline	23/12	Baseline	23/12	Baseline	23/12
11R	<i>Cyphastrea serailia</i>	48	Good	0	0	0	0	0	0
12R	<i>Favites chinensis</i>	27	Good	0	0	0	0	0	0
13R	<i>Turbinaria peltata</i>	21	Good	0	0	0	0	0	0
14R	<i>Favites chinensis</i>	8	Good	0	0	0	0	0	0
15R	<i>Goniopora stutchburyi</i>	11	Good	0	0	0	0	0	0
16R	<i>Psammocora superficialis</i>	27	Good	0	0	0	0	0	0
17R	<i>Favites chinensis</i>	15	Good	0	0	0	0	0	0
18R	<i>Psammocora superficialis</i>	39	Good	0	0	0	0	0	0
19R	<i>Psammocora superficialis</i>	42	Good	0	0	0	0	0	0
20R	<i>Psammocora superficialis</i>	29	Good	0	0	0	0	0	0





Notes:


- i. The re-tagged corals were marked as ##R.

Photo Plate 5.1 Ten (10) Monitored Corals at Control Site

Tag #	23 Dec 2020
#1	 <p style="text-align: center;"><i>Goniopora stutchburyi</i></p>

Tag #	23 Dec 2020	
#2R		 <p data-bbox="788 645 1062 674"><i>Goniopora stutchburyi</i></p>
#3		 <p data-bbox="788 1086 1062 1115"><i>Psammocora superficialis</i></p>
#4		 <p data-bbox="826 1527 1024 1556"><i>Turbinaria peltata</i></p>
#5R		 <p data-bbox="788 1968 1062 1998"><i>Goniopora stutchburyi</i></p>



Tag #	23 Dec 2020	
#6		 <p data-bbox="817 640 1034 672"><i>Cyphastrea serailia</i></p>
#7R		 <p data-bbox="826 1079 1024 1111"><i>Coscinaraea</i> sp.</p>
#8		 <p data-bbox="801 1518 1050 1550"><i>Goniopora stutchburyi</i></p>
#9		 <p data-bbox="801 1957 1050 1989"><i>Goniopora stutchburyi</i></p>




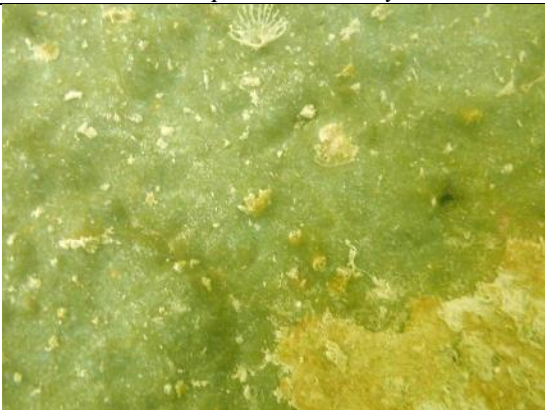
Tag #	23 Dec 2020
#10R	 <p data-bbox="799 640 1050 672"><i>Goniopora stutchburyi</i></p>





Notes:

- i. The re-tagged corals were marked as ##R.

Photo Plate 5.2 Ten (10) Monitored Corals at Indirect Impact Site

Tag #	23 Dec 2020
#11R	 <p data-bbox="807 1245 1043 1279"><i>Cyphastrea serailia</i></p>
#12R	 <p data-bbox="820 1686 1031 1722"><i>Favites chinensis</i></p>

Tag #	23 Dec 2020	
#13R		 <p data-bbox="810 640 1038 674"><i>Turbinaria peltata</i></p>
#14R		 <p data-bbox="818 1081 1031 1115"><i>Favites chinensis</i></p>
#15R		 <p data-bbox="786 1523 1062 1556"><i>Goniopora stutchburyi</i></p>
#16R		 <p data-bbox="767 1964 1082 1998"><i>Psammocora superficialis</i></p>

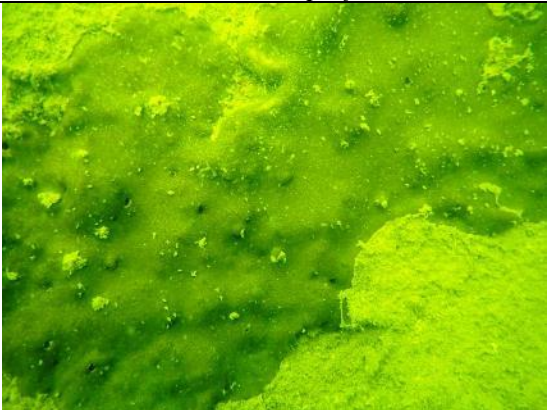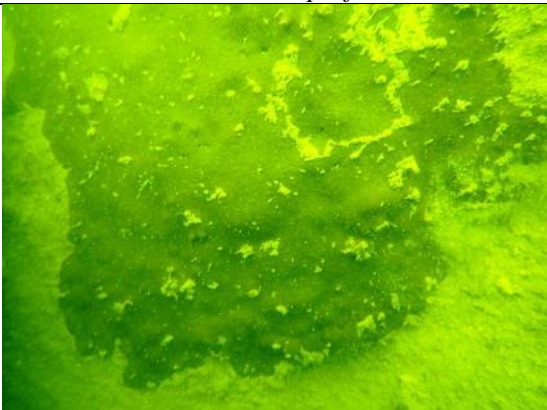Tag #	23 Dec 2020	
#17R		 <p data-bbox="820 645 1027 674"><i>Favites chinensis</i></p>
#18R		 <p data-bbox="769 1086 1082 1115"><i>Psammocora superficialis</i></p>
#19R		 <p data-bbox="769 1527 1082 1556"><i>Psammocora superficialis</i></p>
#20R		 <p data-bbox="769 1968 1082 1998"><i>Psammocora superficialis</i></p>

Notes:

- i. The re-tagged corals were marked as **##R**.
- 5.6.3 The coral re-tagging activities were carried out in the control site and indirect impact area on 23 November and 3 December 2018. Four and ten hard coral colonies were successfully re-tagged at both control and indirect impact sites respectively. Each re-tagged and remained coral colonies were photographed.
- 5.6.4 All tagged and re-tagged coral colonies showed good health condition during the 8th Quarterly Construction Phase Monitoring. There was no increased level of mortality, bleaching and sediment when compared with the baseline results.
- 5.6.5 No sediment, bleaching or increased mortality in the general condition of coral colonies were observed during the eighth construction phase monitoring period. No deterioration of the coral community was observed in the ecological monitoring results when compared with the baseline ecological monitoring results. There is no AL/LL exceedance during the monitoring period. Photos of each tagged corals colonies were taken and shown in **Photo Plates 5.1** and **5.2**.

6. MARINE MAMMAL

6.1 Monitoring Requirements

- 6.1.1 The marine mammal monitoring programme would focus on Finless Porpoise, as the study area near Shek Kwu Chau has been identified as a hotspot for this species, while the Chinese White Dolphins rarely occurred there in the past.
- 6.1.2 The monitoring will verify the predicted impacts on marine mammals, and examine whether the mitigation measures recommended in the EIA report have been effectively implemented to protect marine mammals from negative impacts from construction activities.
- 6.1.3 The Vessel-based Line-transect Survey, the Passive Acoustic Monitoring and the Land-based Theodolite Tracking will be conducted to provide systematic, quantitative measurements of occurrence, encounter rate, habitat use, movement and behavioural patterns of marine mammals within or near the Project Area during construction and operational phases.
- 6.1.4 The mammal monitoring works during construction consist of the following three survey methods:
- Vessel-based Line-transect Survey – to monitor the occurrence of Finless Porpoises (and Chinese White Dolphins) in the study area during construction works, by comparing with the findings of the pre-construction marine mammal monitoring;
 - Passive Acoustic Monitoring – to study the usage of the Project Area and two control sites in South Lantau Waters by Finless Porpoise during construction works, in reference with the baseline findings of the pre-construction marine mammal monitoring; and
 - Land-based Theodolite Tracking – to study the movement and behavioral pattern of Finless Porpoise within and around the Project Area during construction works.
- 6.1.5 The marine mammal observation works of Marine Mammal Exclusion Zone (MMEZ) and Marine Mammal Watching as two of the specific mitigation measures recommended in the approved EIA report shall be fully and properly implemented for the Project to minimize disturbance on Finless Porpoise during construction and operational phases.

6.2 Survey Methods

6.2.1 Vessel-based Line-transect Survey

- 6.2.1.1 For the vessel-based marine mammal surveys, the monitoring team adopted the standard line-transect method (Buckland et al. 2001) as same as that adopted during the EIA study and pre-construction phase monitoring to allow fair comparison of marine mammal monitoring results.
- 6.2.1.2 Eight transect lines are set at Southeast Lantau survey area, including Shek Kwu Chau, waters between Shek Kwu Chau and the Soko Islands, inshore waters of Lantau Island (e.g. Pui O Wan) as well as southwest corner of Cheung Chau as shown in **Figure 6.1** below:

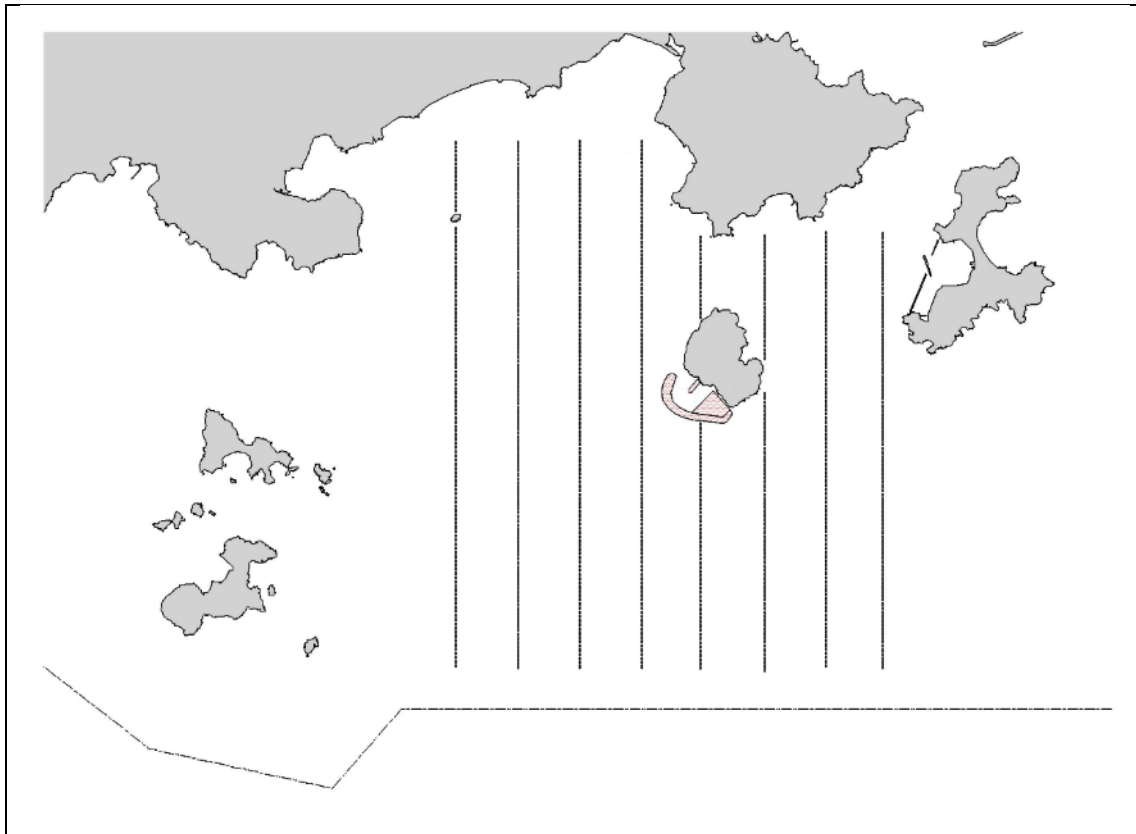


Figure 6.1 Line Transects for Marine Mammal Surveys

6.2.1.3 The surveys should cover all 4 seasons in order to take natural fluctuation and seasonal variations into account for data analysis of distribution, encounter rate, density and habitat use of both porpoises and dolphins (if any). In comparison to the baseline monitoring results, results from the analysed construction phase monitoring data would allow the detection of any changes of their usage of habitat, in response to the scheduled construction works. The monitoring surveys shall be conducted throughout the construction phase involving marine construction work with the frequency shown in **Table 6.1** below:

Table 6.1 Vessel-based Line-transect Survey Frequency

Season	Months	Frequency
Peak Season	December, January, February, March, April & May	Twice per month
Non-peak Season	June, July, August, September, October & November	Once per month

6.2.1.4 For each vessel survey, a 15-m inboard vessel with an open upper deck (about 4.5 m above water surface) would be used to make observations from the flying bridge area. Two experienced marine mammal observers (a data recorder and a primary observer) would make up the on-effort survey team, and the survey vessel would transit different transect lines at a constant speed of 13-15 km per hour. The data recorder shall search with unaided eyes and fill out the datasheets, while the primary observer shall search for dolphins and porpoises continuously through 7 x 50 marine binoculars. Both observers shall search the sea ahead of the vessel, between 270° and 90° (in relation to the bow, which is defined as 0°). Two additional experienced observers shall be available on the boat to work in shift (i.e. rotate every 30 minutes) in order to minimize fatigue of the survey team members. All observers shall be experienced

in small cetacean survey techniques and identifying local cetacean species with extensive training by marine mammal specialist of the ET.

- 6.2.1.5 During on-effort survey periods, the survey team shall record effort data including time, position (latitude and longitude), weather conditions (Beaufort sea state and visibility), and distance travelled in each series (a continuous period of search effort) with the assistance of a handheld GPS (Garmin eTrex Legend). Data including time, position and vessel speed would also be automatically and continuously logged by handheld GPS throughout the entire survey for subsequent review.
- 6.2.1.6 When porpoises or dolphins are sighted, the survey team shall end the survey effort, and immediately record the initial sighting distance and angle of the porpoise or dolphin group from the survey vessel, as well as the sighting time and position. Then the research vessel shall be diverted from its course to approach the animals for species identification, group size estimation, assessment of group composition, behavioural observations, and collection of identification photos (feasible only for Chinese White Dolphin). The perpendicular distance (PSD) of the porpoise or dolphin group to the transect line would then be calculated from the initial sighting distance and angle, which shall be used in the line-transect analysis for density and abundance estimation.
- 6.2.1.7 The line-transect survey data shall be integrated with a Geographic Information System (GIS) to visualize and interpret different spatial and temporal patterns of porpoise and dolphin distribution using their sighting positions collected from vessel surveys. Location data of porpoise and dolphin groups would be plotted on map layers of Hong Kong using a desktop GIS (e.g. ArcView© 3.1) to examine their distribution patterns in details. The encounter rate could be used as an indicator to determine areas or time periods of importance to porpoises within the study area. For encounter rate analysis of finless porpoises, only survey data collected under Beaufort 2 or below condition would be used for encounter rate analysis.
- 6.2.1.8 To take into account of the variations of survey effort across different sections within survey area, the quantitative grid analysis of habitat use would be conducted to examine finless porpoise usage among 1-km² grids within the Southeast Lantau survey area. For the grid analysis, SPSE (sighting density) and DPSE (porpoise density) values would be deduced for evaluation on level of porpoise usage. First, positions of on-effort porpoise sightings from the study period are plotted onto 68 grids (1 km x 1 km each) within the survey area. Sighting density grids and porpoise density grids shall then be normalized with the amount of survey effort conducted within each grid. The total amount of survey effort spent on each grid shall be calculated by examining the survey coverage on each line-transect survey to determine how many times the grid had been surveyed during study period. With the amount of survey effort calculated for each grid, the sighting density and porpoise density of each grid shall be further normalized (i.e. divided by the unit of survey effort).
- 6.2.1.9 The newly-derived unit for sighting density was termed SPSE, representing the number of on-effort sightings per 100 units of survey effort. In addition, the derived unit for actual porpoise density was termed DPSE, representing the number of dolphins/porpoise per 100 units of survey effort. Among the 1-km² grids that were partially covered by land, the percentage of sea area was calculated using GIS tools, and their SPSE and DPSE values were adjusted accordingly. The following formulae shall be used to estimate SPSE and DPSE in each 1-km² grid within the study area:

$$SPSE = ((S / E) \times 100) / SA\%$$

$$DPSE = ((D / E) \times 100) / SA\%$$

where S = total number of on-effort sightings
 D = total number of dolphins/porpoises from on-effort sightings
 E = total number of units of survey effort
 SA% = percentage of sea area

6.2.2 Passive Acoustic Monitoring (PAM)

The PAM aims to study the usage of an area by Finless Porpoise by using an array of automated static porpoise detectors (e.g. C-POD) which would be deployed at different locations to detect the unique ultra-high frequency sounds produced by Finless Porpoise. During the construction period, the PAM survey will be conducted including placement of two passive porpoise detectors outside the Project Area as control site (i.e. within Pui O Wan and to the south of Tai A Chau) and one porpoise detector within the Project Area (i.e. near Shek Kwu Chau) as shown in **Figure 6.2** below.

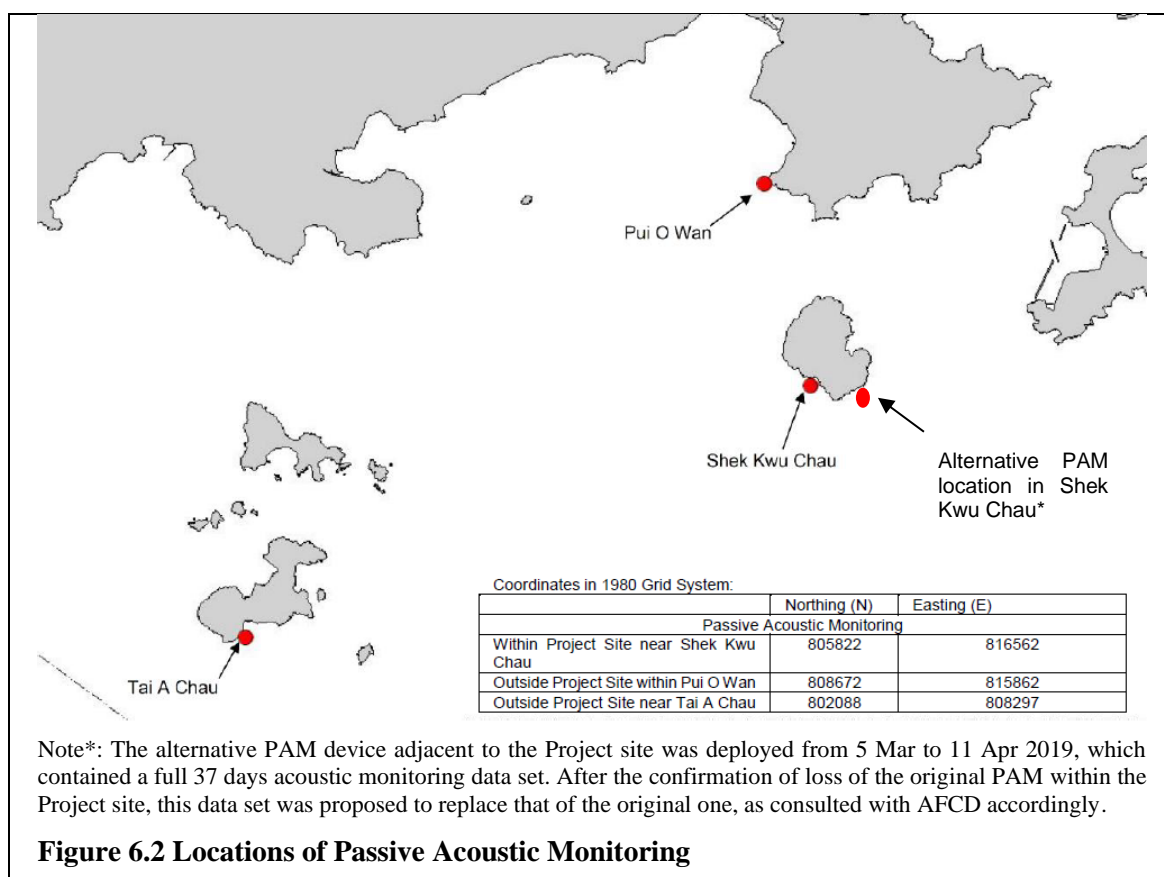


Figure 6.2 Locations of Passive Acoustic Monitoring

6.2.3 These three detectors will be deployed on-site to carry out 24-hours monitoring for a period listed as **Table 6.2** below during the construction phase.

Table 6.2 PAM Deployment Period

Season	Months	Deployment Period
Peak Season	December, January, February, March, April or May	At least 30 days during the peak months of porpoise occurrence in South Lantau waters

6.2.3.1 The automated static porpoise detectors shall detect the presence and number of finless porpoise and Chinese White Dolphins respectively over the deployment period,

with the false signal such as boat sonar and sediment transport noise distinguished and filtered out. The detectors shall be deployed and retrieved by professional dive team on the seabed of the three selected location shown in **Figure 6.2**. During each deployment, the C-POD unit serial numbers as well as the time and date of deployments shall be recorded. Information including the GPS positions and water depth at each of the deployment locations shall also be obtained.

6.2.3.2 The diel patterns (i.e. 24-hour activity pattern) of finless porpoise occurrence among the three sites at Shek Kwu Chau, Tai A Chau and Pui O Wan shall be analyzed. Peaks and troughs of finless porpoise occurrence per hour of day would be identified and compared with the results obtained from pre-construction monitoring.

6.2.4 Land-based Theodolite Tracking

6.2.4.1 The Land-based Theodolite Tracking study would use the same station as in the AFCD monitoring study (same as the baseline monitoring location), which is situated at the southwest side of Shek Kwu Chau (GPS position: 22°11.47' N and 113°59.33' E) as shown in below **Figure 6.3**. The station was selected based on its height above sea level (at least 20 metres), close proximity to shore, and relatively unobstructed views of the entire Project Area to the southwest of Shek Kwu Chau. The height of the Shek Kwu Chau Station established by the HKCRP team is 74.6 m high at mean low water, and only a few hundred metres to the IWMF reclamation site, which is ideal for the purpose for the present behavioural and movement monitoring of finless porpoises as well during construction phase considering there as an un-obstructed vantage point at a height above the Project Site.

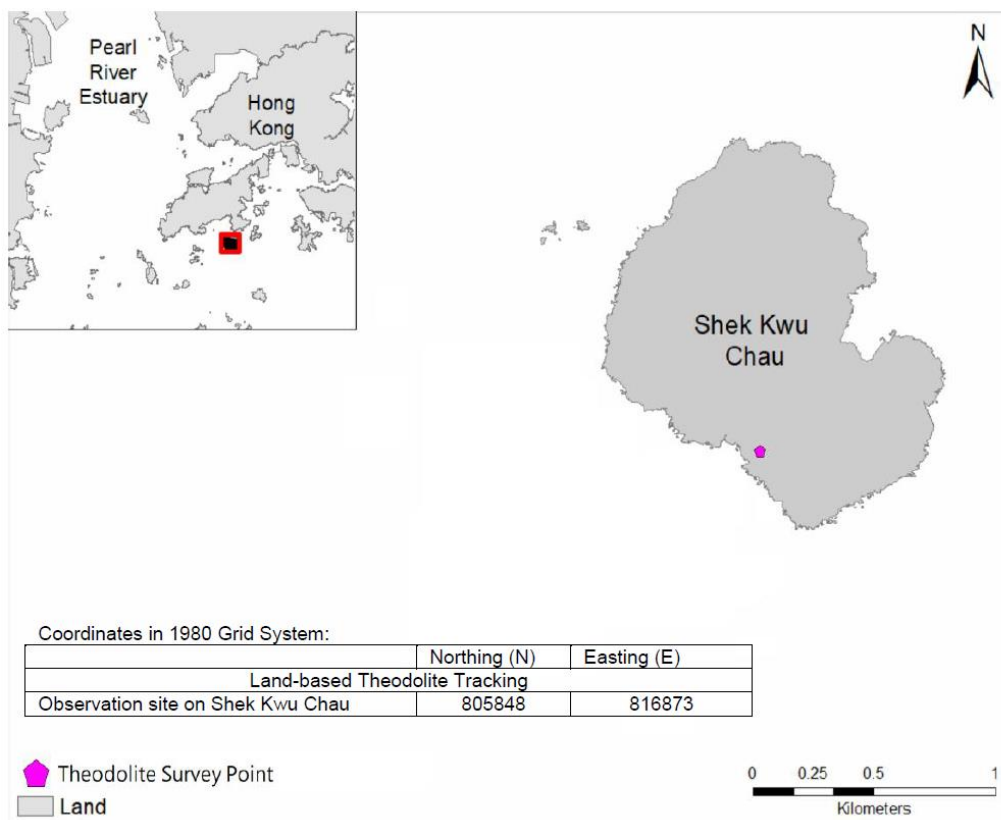


Figure 6.3 Locations of Land-based Theodolite Tracking

During the construction phase, Land-based Theodolite Tracking will be carried out for approximately six hours of tracking for each day of field work for a period listed as **Table 6.3** below, preferably at the initial stage of the construction period (i.e. December 2018 to May 2019).

Table 6.3 Land-based Theodolite Tracking Survey Period

Season	Months	Survey Period
Peak Season	December, January, February, March, April or May	30 days during the peak months of porpoise occurrence in South Lantau waters

6.2.4.2 The monitoring period for land-based theodolite tracking will be proposed to be overlapped with the PAM. The monitoring team consists of one experienced theodolite operator and at least two field observers for assistance. To conduct theodolite tracking, the observers will search systematically for Finless Porpoise using the unaided eye and 7 x 50 handheld binoculars on each survey day throughout the study area. When an individual or group of porpoises is located, a theodolite tracking session will be initiated and focal follow methods will be used to track the porpoise(s). Behavioural state data (i.e. resting, milling, travelling, feeding and socializing) shall also be recorded every 5 minutes for the focal individual or group. Positions of porpoises and boats shall be measured using a digital theodolite connected to a laptop computer. This tracking survey was conducted during the peak season between December 2018 and May 2019 for 30 surveys spanning across 15-16 weeks during the peak season to provide good temporal coverage during the initial stage of the construction period.

6.3 Specific Mitigation Measures

6.3.1 Monitored exclusion zones

6.3.1.1 A MMEZ with 250 m distance from silt curtain shall be established during the above situation. If 3 or more construction vessels are required with MMO's duty and operating in close proximity, for the purpose of avoiding accidental entrance to the works area by Marine Mammal, a cluster MMEZ plan will be implemented to form a MMEZ with 250 m distance from the boundary of a work area as indicated in Figure 1 for reference. A team of MMO (i.e. at least two MMOs per day/night shift teams) would be arranged at the out-lying construction vessels to form the cluster MMEZ. The MMEZ serves as a monitoring approach to provide appropriate and immediate actions once finless porpoise or Chinese White Dolphin is sighted within the MMEZ. All MMEZ will be monitored by competent Marine Mammal Observers (MMOs) to be provided by the Environmental Team for the IWMF and trained by the Marine Mammal Monitoring Specialist of the ET who is independent from KSZHJV. The marine mammal observer(s) shall be independent of the construction contractor and shall form part of the Environmental Team and have the power to call-off construction activities.

6.3.1.2 According to the Condition 2.25 of the FEP, MMEZ should be implemented during the installation/re-installation/relocation process of floating type silt curtains in order to avoid the accidental entrance and entrapment of marine mammals within the silt curtains. Also, marine construction works expected to produce underwater acoustic disturbance as per Condition 2.27 of the FEP, especially within December and May, would require the implementation of MMEZ, which currently all those specific construction activities have been replaced by less acoustically disturbing construction methods such as Deep Cement Mixing (DCM) and Precast Concrete Blocks

Installation as discussed in Section 5.3 of the Detailed Monitoring Programme on Finless Porpoise, however, MMEZ would also be implemented for precautionary purpose for DCM works.

- 6.3.1.3 A MMEZ with 250 m distance from the boundary of a work area shall be established during the above situation. A typical MMEZ is indicated in **Figure 6.4** for reference. The MMEZ serves as a monitoring approach to provide appropriate and immediate actions once finless porpoise or Chinese White Dolphin is sighted within the MMEZ. All MMEZ will be monitored by competent Marine Mammal Observers (MMOs) to be provided by the Environmental Team (ET) for the IWMF and trained by the Marine Mammal Monitoring Specialist of the ET who is independent from KSZHJV.

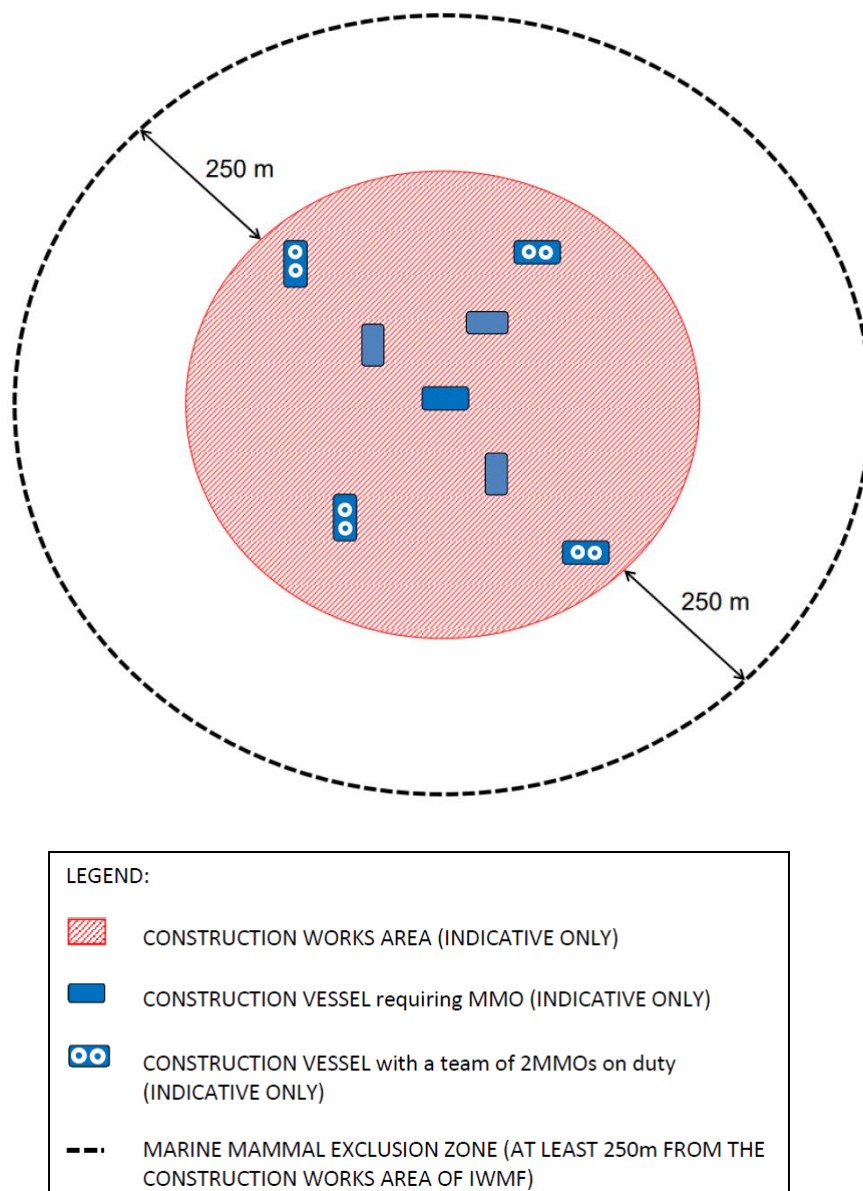


Figure 6.4 Illustration of Typical MMEZ

- 6.3.1.4 Prior to the commencement of construction activity, our MMOs shall ensure the boundary of a marine work area and setting up of the MMEZ for the work area and get access to the monitoring location on a barge or a lookout point where there is no obstructed views for monitoring the MMEZ during the construction activity. The

MMEZ shall be scanned thoroughly by a MMO for any presence of marine mammal e.g. finless porpoise for an initial period of 30 minutes. Construction activity shall only be commenced after the MMO has confirmed that the MMEZ is clear of the marine mammal for the initial period of 30 minutes. The MMO shall then inform the construction superintendent through mobile phone or handheld transceivers to certify the commencement of construction activity. The MMEZ monitoring shall be carried on throughout the period for all active construction activities requiring implementation of MMEZ.

- 6.3.1.5 When any mammal marine, e.g. Finless Porpoise, is detected by the MMO within the MMEZ during construction, the MMO shall inform the construction superintendent immediately through mobile phone or handheld transceivers to cease construction activity within the MMEZ. Construction activity shall not be re-commenced until the MMO confirms that the MMEZ is continuously clear of marine mammal for a period of 30 minutes. The MMO shall then inform the construction superintendent through mobile phone or handheld transceivers to certify the re-commencement of construction activity.
- 6.3.1.6 As there could be a number of Contractors working at the same time within a work area for the IWMF project, a full contact list of MMEZ monitoring team members of the ET and the relevant responsible construction superintendents of the Contractor at the site shall be prepared, updated regularly and circulated to all parties involved in the MMEZ monitoring. With a full contact list, our MMOs shall be able to find out the contacts of corresponding persons in case of marine mammal sighting within and near the MMEZ or emergent occurrence of any unpredictable impact on marine mammal.
- 6.3.1.7 If a marine mammal is still observed in close vicinity but outside the MMEZ, the MMO shall inform the construction superintendent about the presence of marine mammal. The MMO shall remain in position and closely observe the movement of the marine mammal as well as searching for the appearance of any other marine mammal within the MMEZ. No matter the marine mammal is observed within or in close vicinity but outside the MMEZ, the construction superintendent or relevant persons shall inform all vessel captains involved in construction activities around the MMEZ to pay special attention of the presence of the marine mammal in order to reduce chance of collision with them. In case of injury or live-stranded marine mammal being found within the MMEZ, the marine mammal observer shall immediately inform the construction superintendent to suspend construction activities within the works area and contact AFCD through “1823” marine mammal stranding hotline.
- 6.3.2 Marine mammal watching plan
- 6.3.2.1 Upon the completion of silt curtain installation/re-installation/relocation, the marine works would be conducted within an enclosed environment within the silt curtain. Subsequently, Visual Inspection of the Waters Surrounded by Silt Curtains (Section 2.1, MMWP) and Regular Inspection of Deployed Silt Curtain (Section 2.2, MMWP) inspection under Marine Mammal Watching Plan would be implemented (where applicable, Marine Mammal Exclusion Zone shall be conducted at the meantime).
- 6.3.2.2 Before commencement of dredging/sand blanket laying work at each designated area, a trained MMO shall check whether position frame silt curtains are ready, well prepared and operated without any obvious damage. Also, the MMO shall confirm the presence of the relevant frontline staff of the main contractor or its sub-contractors and engineers on board to ensure the effective communication, coordination and

implementation of the response plan in relation to any incidents involving marine mammals within the waters surrounded by the position frame type silt curtains and the work areas. Also, there are lookout points at an elevated level on each barge, clear and safe access at the edges of the derrick lighter/ flag-top barge for inspection during dredging/sand blanket laying works, provision of sufficient lighting is required if working at night.

- 6.3.2.3 During the operation, the inspection will be conducted daily. The MMO will walk along the edge of derrick lighter (DL) and flag-top barge (FB) along the position frame silt curtain or proper location without obstacles where appropriate to inspect the position frame silt curtain with naked eyes, the MMO will check that the position frame silt curtains are maintained in the correct positions with no obvious defects / entanglement and there is no observable muddy water passing through the position frame silt curtain system. Any floating refuse trapped by the silt curtain shall be removed as part of the regular inspection. For night inspection, spotlight will be used to provide sufficient brightness to assist the inspection in dark condition.
- 6.3.2.4 For the re-deployment of the localized silt curtains (frame-type, cage-type or enclosed floating-type silt curtains), MMO will conduct visual inspection to confirm that there is no presence of marine mammal within the localized silt curtains (frame-type, cage-type or enclosed floating-type silt curtains). Visual inspection will be conducted every an hour by MMO for confirming that there is no any marine mammal observed in the surrounding area of the deployed silt curtain during re-deployment of localized silt curtains (frame-type, cage-type or enclosed floating-type silt curtains). The duration will be subject to various conditions, e.g. weather or angle of observation. The works can only commence after confirming that the surrounding waters of the localized silt curtains has not contain any marine mammal. Thereafter, frontline staff, i.e. foremen, site agent, superintendents and engineers will assist our MMO in implementing the plan from the active work fronts within the waters surrounded by the silt curtains throughout the work period. The MMO will conduct regular check to observe the presence of any marine mammal around the localized silt curtain or being trapped by the localized silt curtain daily. The MMOs will also check if the localized silt curtains are in correct positions.
- 6.3.2.5 The MMO shall fill up our Marine Mammal Sighting Record Sheet. After inspection, those records should be kept properly and submitted to the project team. In case there is any marine mammal being found, the MMO should carry out the response actions and communicate with relevant parties to stop and then resume work after the discovered marine mammal leaves. After lifting up and mobilization of silt curtain, the MMO will repeat the procedures of regular and visual inspection until the end of the construction works.
- 6.3.2.6 Each lookout point will have an unobstructed view to waters around the DL and FB. The MMO will move around the DL and FB to establish a clear and unobstructed view as much as they can without compromising the safety concern. When appropriate, the lookout point can be replaced by a proper location if unobstructed view can be assured.

6.4 Results and Observations

6.4.1 Vessel-based Line-transect Survey

6.4.1.1 The monthly survey was conducted on 8 & 17 December 2020. As this is the designated peak season (December – May), two surveys were completed. A total of 81.1 km on effort (transects only) survey length was completed, 91.6% of which was conducted at Beaufort Sea State 2 or better (Table 6.4). No finless porpoise was recorded.

Table 6.4 Summary of Vessel-based Line-transect Survey Effort

Date	Area*	Beaufort	Effort (km)	Season	Vessel	Effort Type**
8 Dec 2020	SEL	1	4.2	WINTER	SEAMAR HK	P
		2	30.6			
		3	5.7			
17 Dec 2020	SEL	1	6.9	WINTER	SEAMAR HK	P
		2	32.6			
		3	1.1			

* As shown in **Figure 6.1**

** P (from AFCD) denotes the ON EFFORT survey on the transect line, not the adjoining passages

6.4.1.2 A review of the long term AFCD marine mammal monitoring programme, the EIA and the pre-construction baseline monitoring report for this project was conducted. Pre-construction baseline monitoring was conducted in Feb - Apr 2018 and the EIA was conducted during the peak porpoise months (Dec 2008 to May 2009). The AFCD long term monitoring data and December 2018 & 2019 impact survey results could be compared directly to December 2020 Impact Survey results. It was noted that the 6th & 18th month of impact monitoring is December 2018 & 2019 respectively and these data were included.

6.4.1.3 A review of the Beaufort Sea State in December survey conditions between 2009 and 2019 (only data available from AFCD at time of writing; (AFCD 2018¹; 2017²; 2016³; 2015⁴; 2014⁵; 2013⁶; 2012⁷; 2011⁸; 2010⁹), EIA 2009 and Baseline 2018 & Impact 2019) show that between 33.7% and 100.0 % of survey effort had been conducted at Beaufort Sea State 2 or better in the past. During December 2019 Impact monitoring, 48.2 % of the survey effort was conducted at Beaufort 2 or better. For this project in December 2020, 91.6 % of the survey was conducted at Beaufort Sea State 2 or better and, as such, survey conditions in December 2020 were typical of previous AFCD surveys

6.4.1.4 A review of the porpoise sightings in the survey area for December between 2009-2019 (no AFCD survey was conducted in 2013) indicated that there were fluctuations between the number of sightings usually recorded. For all weather conditions, and for the nine years data available, two years recorded zero (0) sightings (2011 & 2012 conducted by AFCD), two year recorded one (1) sighting (2010 & 2015 conducted by AFCD), two year recorded two (2) sighting (2016 & 2017 conducted by AFCD), one year recorded three (3) sighting (2013 conducted by AFCD), one year recorded four (4) sighting (2009 conducted by AFCD) and one year recorded five (5) sightings (2014 conducted by AFCD). For impact monitoring in December 2018 & 2019, five (5) sighting and two (2) sighting were recorded respectively. For impact monitoring in 2020 conducted by ET, no finless porpoise sighting was recorded. Effort varied considerably between years and the average number of sightings (per km) was

0.00km⁻¹. For December 2018 & 2019, the calculated encounter rates were 0.05 & 0.04 sightings km⁻¹ respectively. There is no trend in encounter rates recorded by the AFCD long term monitoring programme, the inherent variability for surveys that focus on relatively small populations of highly mobile individuals is highlighted.

6.4.1.5 The impacts of the Project on marine mammals as predicted in the EIA were that construction activities would cause individuals to move away from the area. With only a small area being surveyed by vessels, with no control area, and as porpoise density is obviously low in such a small area, it is difficult to discern significant changes in sightings occurrence from vessel surveys alone. The sightings data presented in AFCD long term monitoring reports indicate that a sighting rate of 0 and 2.6 (per 40 km) for the month of December was common. Since construction commenced, there had been five or two finless porpoise sightings recorded in the month of December. This observation is only for daylight hours, and visual detection. The number of sightings in December 2020 is comparable to the numbers recorded during AFCD long term monitoring studies, prior to the commencement of IWMF and the first two year's impact monitoring records.

6.4.1.6 This observation was only for daylight hours, and visual detection. The analyses of the static PAM dataset provided detailed information on diurnal occurrence patterns. Each static PAM station recorded porpoise at each site every day of the PAM study and therefore, showed that the area immediately adjacent to the Project site has not been abandoned during parts of the designated peak season for porpoise. It was noted that the encounter rate for December 2020 was equal to impact monitoring result of December 2018 & 2019, prior to early construction stage at SKC.

6.4.2 PAM and Land-based Theodolite Tracking

6.4.2.1 30 days of PAM surveys were started at 1 May 2019 and completed until the end of May 2019. Multiple PAM systems were deployed at three sites. The PAM system located at the IWMF was lost, however, an alternative data set had been identified. The PAM systems at the two control sites Tai A Chau and Pui O were recovered on 3 August 2019. A summary of marine mammal detections showed that porpoise were recorded every day of deployment at each site, but at varying frequencies. The detailed theodolite result was presented in 17th Monthly EM&A report (November 2019) while detailed PAM result was presented in 18th Monthly EM&A report (December 2019).

6.4.2.2 For the baseline study, the DPM for each site was 11,160 (Shek Kwu Chau), 16,089 (Tai A Chau) and 3645 (Pui O Wan), totalling 30,894 DPM across all three sites, compared to DPMs of 4740 (Shek Kwu Chau), 7725 (Tai A Chau) and 23,986 (Pui O Wan), totalling 36,451 DPM, for the impact phase study. As the impact phase study was longer than the baseline study, it is not appropriate to directly compare total counts of DPM, however, the DPM rate (the average number of detections per day) for each site can be more directly compared. During the baseline study, Shek Kwu Chau averaged 338.2 DPM per day compared to 124.8 DPM per day, during the impact phase study. This showed a decrease in the daily average of porpoise detection at Shek Kwu Chau. During the baseline study, Tai A Chau averaged 487.6 DPM per day compared to 179.7 DPM per day, during the impact phase study. This showed a decrease in the daily average of porpoise detection at Tai A Chau. During the baseline study, Pui O Wan averaged 98.5 DPM per day compared to 557.8 DPM per day, during the impact phase study. This showed a significant increase in the daily average of porpoise detections at Pui O Wan.

- 6.4.2.3 Overall, the PAM study showed that porpoise continue to consistently utilise the Shek Kwu Chau habitat immediately adjacent to the IWMF construction activities, although to a lesser degree than that prior to construction activities. In addition, the Pui O Wan site, which is 2.5 km away from the IWMF construction area, was also consistently utilised during the impact phase PAM study. A continued assessment of fine scale habitat use, particularly through PAM which yielded large quantities of data, would allow a more comprehensive assessment of the EIA predictions.
- 6.4.2.4 Theodolite surveys were completed in May 2019. In total, thirty four days of theodolite tracking were completed between February - May 2019, comprising 167 hours and 49 minutes of observation. No Chinese white dolphin was observed and only one finless was recorded. The finless porpoise encounter rate was calculated as 0.006 finless porpoise per hour, in all weather conditions.
- 6.4.2.5 A total of 2620 vessels of ten different types were observed and tracked within or in the proximity of the IWMF construction site. These comprised fishing boats (236), speed boats (29), container boats (155), government boats (22), high speed ferries (53), others (13) and IWMF-Related construction platforms (974), tug boats (240), transportation boats (363), construction boats (531) and approximately 8 buoys were present marking the site boundary.
- 6.4.2.6 The baseline theodolite tracking was conducted immediately prior to and during the site preparation activities of the site. The baseline data records a decrease in porpoise sightings as site preparation activities commenced and notes that the decrease was most likely due to the onset of site preparation activities. The impact theodolite tracking conducted for this study records a marked increase in the number of Project related vessels and platforms and, in agreement with baseline conclusions, shows a concomitant decrease in finless porpoise sightings.
- 6.4.3 Specific Mitigation Measures
- 6.4.3.1 Silt curtains were deployed for reclamation works during the reporting period. Teams of two MMO were on duty for monitoring of the Marine Mammal Exclusion Zone (MMEZ) for installation/re-installation/relocation process of silt curtains, and the marine mammal trapping checking and silt curtains inspection in accordance with the Detailed Monitoring Programme of Finless Porpoise and Marine Mammal Watching Plan respectively. Trainings for the MMO were provided by the ET prior to the aforementioned works, with a cumulative total of 98 individuals being trained and the training records kept by the ET. From the Marine Mammal Watching observation records and MMEZ monitoring log records, no Finless Porpoise or other marine mammals were observed within or around the MMEZ and silt curtains in the reporting month.

6.4.5 References

1. Agriculture, Fisheries and Conservation Department (AFCD) 2018. *Annual Marine Mammal Monitoring Programme April 2017-March 2018*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
2. Agriculture, Fisheries and Conservation Department (AFCD) 2017. *Annual Marine Mammal Monitoring Programme April 2016-March 2017*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
3. Agriculture, Fisheries and Conservation Department (AFCD) 2016. *Annual Marine Mammal Monitoring Programme April 2015-March 2016*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
4. Agriculture, Fisheries and Conservation Department (AFCD) 2015. *Annual Marine Mammal Monitoring Programme April 2014-March 2015*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
5. Agriculture, Fisheries and Conservation Department (AFCD) 2014. *Annual Marine Mammal Monitoring Programme April 2013-March 2014*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
6. Agriculture, Fisheries and Conservation Department (AFCD) 2013. *Annual Marine Mammal Monitoring Programme April 2012-March 2013*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
7. Agriculture, Fisheries and Conservation Department (AFCD) 2012. *Annual Marine Mammal Monitoring Programme April 2011-March 2012*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
8. Agriculture, Fisheries and Conservation Department (AFCD) 2011. *Annual Marine Mammal Monitoring Programme April 2010-March 2011*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html
9. Agriculture, Fisheries and Conservation Department (AFCD) 2010. *Annual Marine Mammal Monitoring Programme April 2009-March 2010*) The Agriculture, Fisheries and Conservation Department, Government of the Hong Kong SAR.
http://www.afcd.gov.hk/english/conservation/con_mar/con_mar_chi_chi_chi/con_mar_chi_chi_chi.html

7. WHITE-BELLIED SEA EAGLE

7.1 Monitoring Requirement

7.1.1 On Shek Kwu Chau Island, a nest of WBSE is located about 60 m above ground within a hillside shrubland habitat, 130 m in-land from shore, about 550 m away from the proposed reclaimed land, with no human access. 3 phases monitoring programme will be comprised of pre-construction phase, construction phase and operation phase.

7.1.2 The Pre-Construction WBSE monitoring was started on 30 January 2018 and the location of WBSE nest was confirmed on 21 February 2018 and it is located at the western part of SKC Island (Figure 7.1). Two adults and two chicks were also recorded on 5th March 2018 survey till the end of the Pre-construction monitoring on 15th May 2018. Construction Phase monitoring were carried out followed by the commencement of the Construction Phase on 28th June 2018.

7.2 WBSE Monitoring Parameters, Time, Frequency

7.2.1 The objective of the construction phase monitoring should be to verify the utilisation of the area by WBSE, their responses to construction disturbance, as well as the effectiveness of the proposed mitigation measures. Throughout the construction phase, field surveys should be conducted twice per month during their core breeding season (from December to May), and once per month outside their core breeding season (from June to November). The monitoring frequency should be increased to weekly during the incubation period of each year. In order to confirm their foraging ground near the construction site, it is necessary to conduct daily monitoring during the first week of nestling period in each year.

7.2.2 Since the location of the WBSE nest was located at the southwest of SKC within the hillside shrubland, it is impossible to observe the eggs during incubation period. Therefore, monitoring with increased frequency during incubation period will be continued until chick was seen in the nest. Daily monitoring will be carried out once any chick is recorded during the monitoring day. The monitoring schedule during the reporting period is provided in **Appendix C**.

7.3 Monitoring Location

7.3.1 Since there are no suitable land footings along the coast of SKC, only boat surveys were conducted. On Shek Kwu Chau Island, a nest of WBSE is located about 60 m above ground within a hillside shrubland habitat, 130 m in-land from shore, about 550 m away from the proposed reclaimed land, with no human access.

7.4 Monitoring Methodology

7.4.1 Information to be collected included feeding, perching/roosting, preening, soaring, flying, nesting and territorial guarding and the time spent on each activity. The responses and reactions to any disturbance to the WBSEs were also recorded and examined in conjunction with the construction noise and/or other events in the vicinity. Other disturbances such as weather condition, or invasion by other fauna species were also recorded.

7.4.2 Binocular, scope, camera, lens and GPS device used are summarized as **Table 7.1** below:

Table 7.1 List of Equipment Used during Construction Phase Monitoring

Equipment	Quantity
Swarovski EL 8.5 x 42 Binocular	1
Swarovski EL Range 8 x 42 Binocular	1
Swarovski ATX 25-60 x 85 Spotting Scope	1
Canon 1Dx Mark II Camera	1
Canon EF300mm F2.8 Lens with Canon 2x Teleconverter	1
Canon PowerShot G7X Camera	1
Garmin GPSMAP 64S	1

7.4.3 If event such as absence of White-bellied Sea Eagle during a whole day of monitoring was found during WBSE monitoring, the actions in accordance with the Event and Action Plan should be carried out according to **Appendix M**.

7.5 Results and Observations

7.5.1 To verify the utilization of the area by WBSE, their responses to construction disturbance, as well as the effectiveness of the proposed mitigation measures. Since there is no landing point along the western part of SKC, boat survey was used for the monitoring survey. In order to increase the chance of finding the WBSEs, monitoring survey was carried out early in the morning. The weather condition of monitoring survey was shown in **Table 7.2**.

Table 7.2 Weather Conditions during the WBSE Monitoring

Date	Condition	Temperature (°C)
15 Dec 2020	- North to northeast wind force 5 - Sunny period	19
23 Dec 2020	- North to northeast wind force 4 to 5 - Sunny period	20
31 Dec 2020	- East to northeast wind force 4 to 5 - Sunny period	18

7.5.2 During the monitoring survey, two adult WBSEs were recorded near Shek Kwu Chau area. However, it was found that the WBSEs moved back to old nest for incubation (**Figure 7.1**). No abnormal behavior of the recorded adults during the December 2020 construction phase monitoring. Only two adults of WBSE (**Figure 7.2**) were only recorded during the morning surveys. All marine works during the monitoring period did not show any impact to the WBSE.

7.5.3 No disturbances from anthropogenic activities on the island were recorded during the monitoring survey. No invasion of other fauna species was recorded as well.

7.5.4 Since incubation was recorded, construction phase monitoring (twice per month) were changed to weekly monitoring starting from 31 December 2020. Also, as it is not possible to record the number of eggs in the nest, weekly monitoring will be continued until chick was seen in the nest.



Figure 7.1 Location of WBSE Nest on SKC

7.5.5 Photo record of WBSE from the survey this month is shown below:



Adult WBSE recorded staying in the old nest



Adult WBSE recorded staying in the old nest



Empty new nest

Figure 7.2 Photo Records of WBSE on SKC During the Reporting Period

8. SUMMARY OF MONITORING EXCEEDANCE, COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

8.1 The Environmental Complaint Handling Procedure is shown in below **Figure 8.1**:

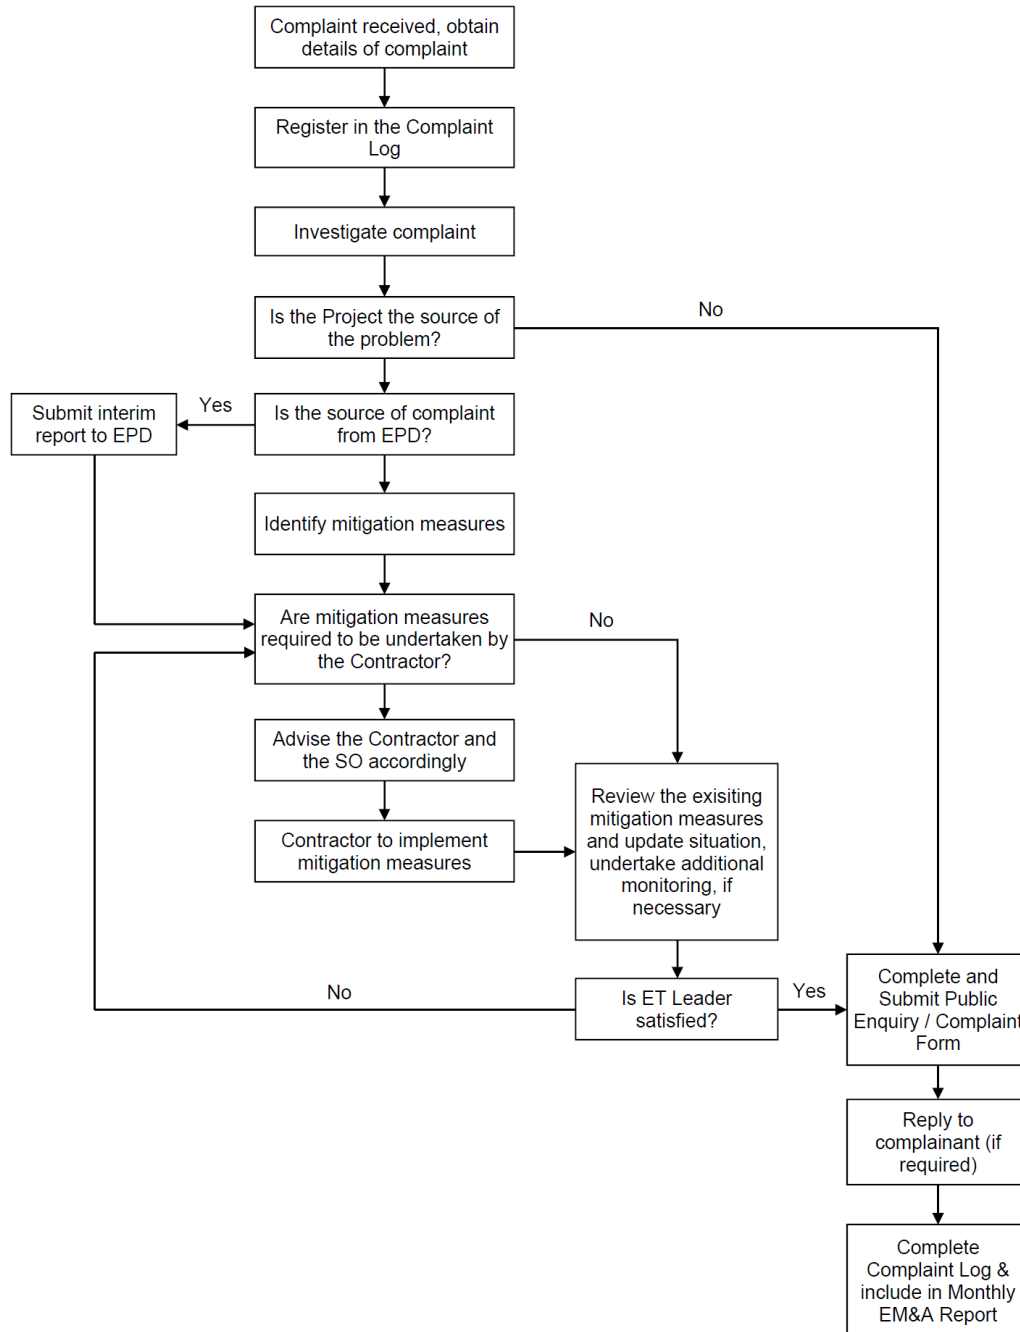


Figure 8.1 Environmental Complaint Handling Procedures

8.2 No exceedance of the Action and Limit Levels of the regular WBSE monitoring was recorded during the reporting period.

Table 8.1 Summary of SS Compliance Status at Impact Stations (Mid-Ebb Tide)

Date	B1	B2	B3	B4	CR1	CR2	F1A	H1	S1	S2A	S3	M1
2-12-2020												
4-12-2020												
7-12-2020												
9-12-2020												
12-12-2020												
14-12-2020												
16-12-2020												
18-12-2020												
20-12-2020												
22-12-2020												
24-12-2020												
28-12-2020												
30-12-2020												
No. of SS Exceedances	1	0	2	0	1	2	2	0	0	0	0	0

Note 1: Detailed results are presented in **Appendix D**

Legend:

	No exceedance of Action Level and Limit Level
	Exceedance of Action Level recorded at monitoring station located downstream of the Project based on dominant tidal flow
	Exceedance of Action Level recorded at monitoring station located upstream/unrelated stream (neither upstream nor downstream, far away) of the Project based on dominant tidal flow
	Exceedance of Limit Level recorded at monitoring station located downstream of the Project based on dominant tidal flow
	Exceedance of Limit Level recorded at monitoring station located upstream/unrelated stream of the Project based on dominant tidal flow
	Upstream/unrelated stream station with respect to IWMF Project during the respective tide based on dominant tidal flow
	Downstream station with respect to IWMF Project during the respective tide based on dominant tidal flow/station within the Project site
	NA for measurement
	Cancelled due to incident or adverse weather

Table 8.2 Summary of SS Compliance Status at Impact Stations (Mid-Flood Tide)

Date	B1	B2	B3	B4	CR1	CR2	F1A	H1	S1	S2A	S3	M1
2-12-2020												
4-12-2020												
7-12-2020												
9-12-2020												
12-12-2020												
14-12-2020												
16-12-2020												
18-12-2020												
20-12-2020												
22-12-2020												
24-12-2020												
28-12-2020												
30-12-2020												
No. of SS Exceedances	2	2	2	2	0	1	0	1	0	0	0	0

Note 1: Detailed results are presented in **Appendix D**

Legend:

	No exceedance of Action Level and Limit Level
	Exceedance of Action Level recorded at monitoring station located downstream of the Project based on dominant tidal flow
	Exceedance of Action Level recorded at monitoring station located upstream/unrelated stream (neither upstream nor downstream, far away) of the Project based on dominant tidal flow
	Exceedance of Limit Level recorded at monitoring station located downstream of the Project based on dominant tidal flow
	Exceedance of Limit Level recorded at monitoring station located upstream/unrelated stream of the Project based on dominant tidal flow
	Upstream/unrelated stream station with respect to IWMF Project during the respective tide based on dominant tidal flow
	Downstream station with respect to IWMF Project during the respective tide based on dominant tidal flow/station within the Project site
	NA for measurement
	Cancelled due to incident or adverse weather

- 8.3 Ten (10) of the general water quality monitoring results of suspended solids (SS) obtained had exceeded Action Level. Eight (8) of general water quality monitoring results of SS obtained during the reporting period had exceeded the Limit Level. Investigation was carried out immediately for each of the exceedance cases during the reporting period.
- 8.4 No project-related Action Level & Limit Level exceedance was recorded from the 1 December 2020 to 31 December 2020 as shown in **Appendix N**.
- 8.5 The Contractor has been reminded that all measures recommended in the deposited Silt Curtain Deployment Plan shall be fully and properly implemented for the Project as per Clause 2.6A of the FEP.
- 8.6 No notification of summons and prosecution was received in the reporting period.
- 8.7 Statistics on complaints, notifications of summons and successful prosecutions are summarized in **Appendix O**.

9. EM&A SITE INSPECTION

- 9.1 Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, site inspections were carried out on 1, 8, 17, 22 & 29 December 2020 at the site portions listed in **Table 9.1** below.

Table 9.1 Site Inspection Record

Date	Inspected Site Portion	Time
1 December 2020	Portion 1, 1A & 1B (near SKC)	10:15 – 11:15 AM
8 December 2020	Portion 1, 1A & 1B (near SKC)	07:30 – 08:30 PM
17 December 2020	Portion 1, 1A & 1B (near SKC)	10:30 – 11:30 AM
22 December 2020	Portion 1, 1A & 1B (near SKC)	10:30 – 11:30 AM
29 December 2020	Portion 1, 1A & 1B (near SKC)	10:30 – 11:30 AM

- 9.2 One joint site inspection with IEC was carried out on 22 December 2020.
- 9.3 Environmental deficiencies were observed during weekly site inspection. Key observations during the site inspections and during the reporting period are summarized in **Table 9.2**.

Table 9.2 Site Observations

Date	Environmental Observations	Follow-up Status
1 December 2020 (Site inspection)	<u>Observation(s) and Recommendation(s)</u> 1. On A2&A3, chemical waste cabinet was not locked up. General waste was observed inside the chemical waste cabinet, general waste should be removed. Construction material should not be stored on the top of cabinet.	1. Chemical waste cabinet had been locked up and cleared.
8 December 2020 (Site inspection)	<u>Observation(s) and Recommendation(s)</u> 1. On 宏建 3, soil was observed on the edge of the barge, soil should be removed.	1. Soil had been removed from the edge of 宏建 3.
17 December 2020 (Site inspection)	<u>Observation(s) and Recommendation(s)</u> No major observation was observed.	Nil.
22 December 2020 (Site inspection)	<u>Observation(s) and Recommendation(s)</u> 1. On 三航 305, chemicals-in use should be placed on drip tray and oil stain was observed on the deck near the chemicals 2. On 三航 305, no EP & CNP was displayed.	1. The used chemicals had been removed and disposed as chemical waste. The sand for oil stain removal had been disposed as chemical waste. 2. CNP and EP had been displayed in the envelope.

Date	Environmental Observations	Follow-up Status
29 December 2020 (Site inspection)	<u>Observation(s) and Recommendation(s)</u> No major observation was observed.	Nil.

- 9.4 The Contractor had rectified all the observations identified during environmental site inspections in the reporting period. The Contractor had been reminded to suspend the related works immediately if silt curtain was found any damage in the future, until fixing of damaged silt curtain is completed.
- 9.5 According to the EIA Study Report, Environmental Permit, contract documents and Updated EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in **Appendix B**.

10. FUTURE KEY ISSUES

10.1 Works to be undertaken in the next reporting month are:

- Placing rock filter at reclamation area
- Installation of Caisson
- Reclamation works
- Installation of Chinese Pod

10.2 Potential environmental impacts arising from the above construction activities are mainly associated with water quality, construction noise, waste management and ecology.

10.3 The key environmental mitigation measures for the Project in the coming reporting period expected to be associated with the construction activities include:

- Reduction of noise from equipment and machinery on-site;
- Installation of silt curtains for reclamation works;
- Sorting, recycling, storage and disposal of general refuse and construction waste;
- Management of chemicals and avoidance of oil spillage on-site, especially under heavy rains and adverse weather; and
- Implementation of MMEZ and inspection of enclosed environment within silt curtains as per DMPFP;
- Regulation on rate and means for filling works as stipulated in Table 1 of FEP or the approved Supporting Document for Reviewing Dredging Rate and Filling Rate, whichever is applicable;
- Confirmation of the absence of silt content in the rock filling material and the filling work is properly conducted;
- Installation process of floating silt curtain according to approved Silt Curtain Deployment Plan.

10.4 The tentative schedule of regular construction noise, water quality and ecology monitoring in the next reporting period is presented in **Appendix P**. The regular construction noise, water quality and ecology monitoring will be conducted at the same monitoring locations in the next reporting period.

11. CONCLUSION AND RECOMMENDATIONS

- 11.1 This 30th monthly Environmental Monitoring and Audit (EM&A) Report presents the EM&A works undertaken during the period from 1 December to 31 December 2020, in accordance with the Updated EM&A Manual and the requirement under EP-429/2012/A and FEP-01/429/2012/A.
- 11.2 Construction noise, water quality, construction waste, marine mammal and WBSE monitoring were carried out in the reporting period. No project-related exceedance of the Action and Limit Level was recorded from 1 December 2020 to 31 December 2020.
- 11.3 Weekly environmental site inspections were conducted during the reporting period. Environmental deficiencies were observed during site inspection and were rectified.
- 11.4 According to the environmental site inspections performed in the reporting month, the Contractor was reminded to pay attention on on-site housekeeping and the proper storage of the chemicals and construction waste.
- 11.5 Regarding to the deployment of silt curtains as a principal water quality impact mitigation measures on various marine works, the Contractor has been reminded to follow strictly to the design and checking procedure as specified in the Silt Curtain Deployment Plan. The Contractor is reminded that all measures recommended in the deposited silt curtain deployment plan shall be fully and properly implemented for the Project as per EP condition 2.6 of the FEP.
- 11.6 No environmental complaint was received in the reporting period.
- 11.7 No notification of summon or prosecution was received since commencement of the Contract.
- 11.8 The ET will keep track of the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Appendix A Master Programme

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021		
									Dec	Jan	Feb	Mar	
									37	38	39	40	
EP_SP_66_12-WP5A-M37 Programme for Design and Construction Works WP5A-M37													
EP_SP_66_12-WP5A-M37.01 Key Dates													
EP_SP_66_12-WP5A-M37.01.1 Contractual Key Dates													
EP_SP_66_12-WP5A-M37.01.1.1 Design and Construction Phase													
01-1000	Contract Award/Date of Acceptance of Tender	0	22-Nov-17 A					100%					
01-1010	Date of Commencement of the Design and the Works	0	15-Dec-17 A					100%					
01-1015(3)(M12)	Original Substantial Completion of the Works	0		27-Jul-24*		27-Jul-24	0	0%					
01-1020	Extended Substantial Completion of The Works	0		17-May-25*		17-May-25	0	0%					
EP_SP_66_12-WP5A-M37.01.1.3 Extension of Time Granted													
01-1015-1(3)(M12)	Extension of time granted (Claim No.1 to No.49) *Claim No.9 excluded	294	27-Jul-24	17-May-25	27-Jul-24	17-May-25	0	0%					
01-1060	Issuance of FS Certificate	0		02-Dec-24*		02-Dec-24	0	0%					
EP_SP_66_12-WP5A-M37.01.2 Operation Phase													
01-1030	Commencement of Operation	0	16-May-25*		16-May-25		0	0%					
01-1230	Issue Certificate of Completion of the Works (56 days after Substantial Completion)	0		12-Jul-25*		12-Jul-25	0	0%					
EP_SP_66_12-WP5A-M37.03 Licence/Permit Applications													
EP_SP_66_12-WP5A-M37.03.1 License/Permit for Construction													
03-1090	EPD APCO (SP) License for Concrete Batching Plant	270	31-Dec-20	26-Sep-21	21-Jun-21	17-Mar-22	172	0%	31-Dec-20				
03-1360(2)	CNP for 24Hrs	48	02-Aug-19 A	16-Feb-21*	31-Dec-20	16-Feb-21	0	73.63%					
03-1370_1(M34)	Landscape and Visual Plan	180	31-Dec-20	28-Jun-21	06-Sep-21	04-Mar-22	249	0%	31-Dec-20				
EP_SP_66_12-WP5A-M37.03.4 Fire Services Installations (FSI) Certificate													
EP_SP_66_12-WP5A-M37.03.4.3 Fire Engineering Report													
05-3000	Preparation and Submission of Fire Engineering Report to FSD	80	10-Apr-19 A	20-Mar-21	30-Jan-21	19-Apr-21	30	85.45%				20-Mar-21, F	
05-4450	Approval of Fire Engineering Report by FSD	14	21-Mar-21	03-Apr-21	20-Apr-21	03-May-21	30	0%				21-Mar-21	
EP_SP_66_12-WP5A-M37.03.4.1 Fire Services Installations Certificate Inspection													
03-1555(5a)	General Building Plans and FSI Provision Design Submission to FSD	90	03-Feb-21	03-May-21	03-Feb-21	03-May-21	0	0%			03-Feb-21		
EP_SP_66_12-WP5A-M37.03.5 Air Pollution Control (Specified Processes) License													
03-1730(3)	Early Engagement With EPD SP Licensing Department for Information exchange	200	27-Dec-18 A	18-Jul-21	07-Oct-21	24-Apr-22	280	66.67%					
EP_SP_66_12-WP5A-M37.04 General Submissions													
EP_SP_66_12-WP5A-M37.04.1 Contractor's Plans Submission and Approval													
04-1100(1)	Technical Resources Plan (TRP)	60	19-Dec-17 A	28-Feb-21*	31-Dec-20	28-Feb-21	0	30%				Technical Resources Plan (TRP), 28-Feb-21	
04-1200(1)	Works Plan (WP)	60	18-Dec-17 A	28-Feb-21*	31-Dec-20	28-Feb-21	0	30%				Works Plan (WP), 28-Feb-21*, 28-Feb-21	
04-1400(1)	Operation Plan (OP)	60	18-Dec-17 A	28-Feb-21*	31-Dec-20	28-Feb-21	0	75%				Operation Plan (OP), 28-Feb-21*, 28-Feb-21	
04-1450(1)	Asset Management Plan (AMP)	120	06-Mar-21*	03-Jul-21	21-Nov-21	20-Mar-22	260	0%				06-Mar-21*	
04-1500(1)	Handback Plan (HP)	120	06-Mar-21*	03-Jul-21	21-Nov-21	20-Mar-22	260	0%				06-Mar-21*	
EP_SP_66_12-WP5A-M37.04.1.1 Provisional Assessment (PA)													
04-1500(1)10	Preliminary Assessment	180	31-Dec-20	28-Jun-21	22-Nov-25	20-May-26	1787	0%	31-Dec-20				
EP_SP_66_12-WP5A-M37.05 Design Submissions													
EP_SP_66_12-WP5A-M37.05.01 AIP Design Package Submissions													
EP_SP_66_12-WP5A-M37.05.01.01 AIP Process and Layout Design (2.1)													
EP_SP_66_12-WP5A-M37.05.01.01.2 MSW treatment process design for mechanical treatment (2.1.02)													
05-1090	Mechanical Treatment Plant	105	31-Dec-20*	14-Apr-21	03-Jan-21	17-Apr-21	3	0%	31-Dec-20*				
EP_SP_66_12-WP5A-M37.05.01.01.6 Site Master Layout Plan and Plant Layout (2.1.06)													
05-3020	Site Master Layout Plan and Plant Layout	36	27-Apr-18 A	04-Feb-21	06-Feb-21	13-Mar-21	37	65%			04-Feb-21, Site Master Layout Plan and Plant Layout, Site Master Layout		
EP_SP_66_12-WP5A-M37.05.01.01.7 Statutory Fire Compliance (2.1.25)													
05-2990	Fire Safety Compliance	124	10-Apr-19 A	03-May-21	31-Dec-20	03-May-21	0	0%					
EP_SP_66_12-WP5A-M37.05.01.02 AIP Ground Treatment, Reclamation, Seawall, Breakwater, Berth (2.2)													
05-1280	Draft plan of 2D/3D modelling works for seawall and breakwater design (2.2.05)	15	03-May-18	14-Jan-21	07-Apr-21	21-Apr-21	97	80%			14-Jan-21, Draft plan of 2D/3D modelling works for seawall and breakwater design (2.2.05), Draft plan		
05-2970	Onshore crane Facility (2.2.11)	135	31-Dec-20*	14-May-21	03-May-21	14-Sep-21	123	0%	31-Dec-20*				
05-2980	Onshore vessel power supply system (2.2.12)	30	20-Aug-20 A	29-Jan-21	01-Dec-20	30-Dec-20	-30	77.78%			Onshore vessel power supply system (2.2.12), 29-Jan-21, 29-Jan-21, Onshore v		
EP_SP_66_12-WP5A-M37.05.01.03 AIP Incineration Plant Buildings (2.3)													
EP_SP_66_12-WP5A-M37.05.01.03.1 General Layout Drawings and Fire Safety Strategy (2.3.00)													
05-1210	Process Building	30	03-Oct-18 A	29-Jan-21	25-Apr-21	24-May-21	115	5%			29-Jan-21, Process Building, Process Building, 29-Jan-21		
05-1220	ACC Equipment Structure	30	03-Oct-20 A	29-Jan-21	24-Jan-21	22-Feb-21	24	77.78%			29-Jan-21, ACC Equipment Structure, ACC Equipment Structure, 29-Jan-21		
05-1250	Chimney and viewing platform	135	31-Dec-20	14-May-21	25-May-21	06-Oct-21	145	0%	31-Dec-20				
EP_SP_66_12-WP5A-M37.05.01.03.2 Foundation design (2.3.01)													
05-3030	Process Building Waste Bunker, Tipping Hall, Basin Area and Workshop	43	11-Aug-20 A	11-Feb-21	23-Jul-21	03-Sep-21	204	5%			11-Feb-21, Process Building Waste Bunker, Tipping Hall, Basin		
05-3040	ACC Equipment Structure	43	11-Aug-20 A	11-Feb-21	13-Oct-21	24-Nov-21	286	0%			11-Feb-21, ACC Equipment Structure, ACC Equipment Structure		
05-3070	Chimney and viewing platform	135	31-Dec-20*	14-May-21	30-Jul-21	11-Dec-21	211	0%	31-Dec-20*				
05-3090	Reception Pavilion	135	31-Dec-20*	14-May-21	01-Apr-22	13-Aug-22	456	0%	31-Dec-20*				
EP_SP_66_12-WP5A-M37.05.01.03.3 Structural design (2.3.02)													
05-1300	ACC Equipment Structure	0	23-Jul-19 A	20-Sep-19 A				0%					
05-1330	Chimney and viewing platform	135	31-May-19	14-May-21	08-May-22	19-Sep-22	493	5%					
EP_SP_66_12-WP5A-M37.05.01.03.6 Fire services installation design (2.3.05)													
EP_SP_66_12-WP5A-M37.05.01.03.6.1 Process Building (2.3.05.01)													
05-1510	Fire Systems	105	10-Jan-19 A	14-Apr-21	21-Apr-21	03-Aug-21	111	5%					
05-1520	Fire engineering	30	05-Mar-21	03-Apr-21	05-Jul-21	03-Aug-21	122	0%				05-Mar-21	
05-1530	FS schematics	7	10-Jan-19 A	06-Jan-21	13-Jul-21	19-Jul-21	194	5%			06-Jan-21, FS schematics, FS schematics, 06-Jan-21		
EP_SP_66_12-WP5A-M37.05.01.03.6.3 Turbin Hall Building (2.3.05.03)													

Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

■ Remaining Work ◆ Actual Milestone
■ Actual Work ◆ Critical Milestone
■ Critical Remaining Work
◆ Milestone

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021	
									Dec 37	Jan 38	Feb 39	Mar 40
05-5400	Fire Systems (2.3.05.03.01)	105	28-Dec-18 A	14-Apr-21	21-Apr-21	03-Aug-21	111	5%				
05-5410 (M22)	Fire engineering	30	05-Mar-21	03-Apr-21	05-Jul-21	03-Aug-21	122	0%				
05-5420 (M22)	FS schematics (2.3.05.03.03)	105	28-Dec-18 A	14-Apr-21	06-Apr-21	19-Jul-21	96	5%				05-Mar-21
EP_SP_66_12-WP5A-M37.05.01.03.6.5 Elevated Drive Way and Associated Structures (2.3.05.05)												
05-5445 (M22)	Fire Systems	105	16-Dec-19 A	14-Apr-21	21-Apr-21	03-Aug-21	111	5%				
05-5450 (M22)	FS schematics	149	16-Dec-19 A	28-May-21	21-Feb-21	19-Jul-21	52	5%				
EP_SP_66_12-WP5A-M37.05.01.03.6.6 Reception Pavilion (2.3.05.06)												
05-5460 (M22)	Fire Systems (2.3.05.06.01)	105	04-Oct-19 A	14-Apr-21	21-Apr-21	03-Aug-21	111	5%				
05-5470 (M22)	FS schematics (2.3.05.06.03)	148	04-Oct-19 A	27-May-21	22-Feb-21	19-Jul-21	53	5%				
EP_SP_66_12-WP5A-M37.05.01.03.6.7 Compressor & Closed Circuit (2.3.05.07)												
05-5480 (M22)	Fire Systems (2.3.05.07.01)	133	11-Sep-19 A	12-May-21	24-Mar-21	03-Aug-21	83	5%				
05-5490 (M22)	FS schematics (2.3.05.07.03)	105	11-Sep-19 A	14-Apr-21	06-Apr-21	19-Jul-21	96	25%				
EP_SP_66_12-WP5A-M37.05.01.03.7 Building services design (excluding fire services installation design) (2.3.06)												
05-1550	Electrical Services and Lighting	45	10-Jan-19 A	13-Feb-21	21-Apr-21	04-Jun-21	111	5%				13-Feb-21, Electrical Services and Lighting, Electrical Servi
05-1560	MVAC (6 Packages)	89	10-Jan-19 A	30-Mar-21	02-Dec-20	01-Mar-21	-28	15%				
05-1570	Odour Control	70	11-Jul-18 A	10-Mar-21	05-Jan-21	15-Mar-21	5	5%				10-Mar-21, Odour Control
05-1580	Plumbing	53	15-Jan-19 A	21-Feb-21	13-Jan-21	06-Mar-21	14	75%				21-Feb-21, Plumbing, Plumbing, 21-Feb-21
05-1590	Drainage (7 Packages)	65	15-Jan-19 A	05-Mar-21	01-Jan-21	06-Mar-21	1	25%				05-Mar-21, Drainage (7 Package
05-1600	ELV (7 Packages)	76	10-Jan-19 A	16-Mar-21	04-Jun-21	18-Aug-21	155	65%				16-Mar-21, ELV (7
05-1610	Lifts and Escalators (2 Packages)	90	30-Dec-19 A	30-Mar-21	23-Dec-20	22-Mar-21	-8	5%				
05-1630	Building Management System (BMS) (7 Packages)	62	23-Oct-20 A	02-Mar-21	10-Oct-21	10-Dec-21	283	5%				02-Mar-21, Building Management Sys
05-1770	Vehicle & Container Wash System	135	31-Dec-20*	14-May-21	12-Dec-20	25-Apr-21	-19	0%				31-Dec-20*
05-1770-1 (M20)	Water Cannon System	135	11-Jun-19 A	14-May-21	25-Feb-21	09-Jul-21	56	5%				
05-1770-2 (5a)	Process CCTV System	135	31-Dec-20	14-May-21	25-Feb-21	09-Jul-21	56	0%				31-Dec-20
EP_SP_66_12-WP5A-M37.05.01.04 AIP Mechanical Treatment Plant Building (2.4)												
05-1640	Architectural Design (2.4.00)	60	07-Sep-18 A	28-Feb-21	05-Feb-21	05-Apr-21	36	65%				28-Feb-21, Architectural Design (2.4.00
05-1650	Foundation design (2.4.01)	105	31-Dec-20	14-Apr-21	20-Feb-21	04-Jun-21	51	100%				31-Dec-20
05-1660	Structural design (2.4.02)	105	15-Apr-21*	28-Jul-21	30-Oct-21	11-Feb-22	198	100%				
05-1670	Electrical and instrumentation works design (2.4.03)	105	31-Dec-20	14-Apr-21	29-Apr-21	11-Aug-21	119	0%				31-Dec-20
05-1680	Mechanical works design (2.4.04)	105	31-Dec-20	14-Apr-21	03-Jan-21	17-Apr-21	3	0%				31-Dec-20
05-1690	Fire services installation design (2.4.05) (3 Packages)	95	20-Mar-19 A	05-Apr-21	15-Apr-21	19-Jul-21	106	0%				
EP_SP_66_12-WP5A-M37.05.01.04.7 Building services design (excluding fire services installation design) (2.4.06)												
05-1700	LV and Emergency Power Distribution Design	17	20-Mar-19 A	16-Jan-21	19-May-21	04-Jun-21	139	5%				16-Jan-21, LV and Emergency Power Distribution Design, LV and Emergency Power Distribution D
05-1710	MVAC	75	25-Mar-19 A	15-Mar-21	17-Dec-20	01-Mar-21	-14	5%				MVAC, 15-Mar-21,
05-1720	Odour Control	105	31-Dec-20*	14-Apr-21	01-Dec-20	15-Mar-21	-30	0%				31-Dec-20*
05-1730	Plumbing	105	20-Mar-19 A	14-Apr-21	22-Nov-20	06-Mar-21	-39	65%				
05-1740	Drainage	88	20-Mar-19 A	28-Mar-21	22-Feb-21	20-May-21	53	5%				21
05-1750	ELV	135	20-Mar-19 A	14-May-21	06-Apr-21	18-Aug-21	96	0%				
05-1760	Lifts	135	30-Dec-19 A	14-May-21	17-Mar-21	29-Jul-21	76	0%				
05-1760-1 (M20)	Building Management System (BMS)	135	31-Dec-20	14-May-21	15-May-21	26-Sep-21	135	0%				31-Dec-20
EP_SP_66_12-WP5A-M37.05.01.05 AIP Wastewater Treatment Plant (2.5)												
05-1780	Architectural Design (2.5.00)	60	03-Oct-18 A	28-Feb-21	13-May-21	11-Jul-21	133	65%				28-Feb-21, Architectural Design (2.5.00
05-2790	Fire services installation design (2.5.05)	90	16-Jan-19 A	30-Mar-21	21-Apr-21	19-Jul-21	111	5%				
EP_SP_66_12-WP5A-M37.05.01.05.7 Building services design (excluding fire services installation design) (2.5.06)												
05-1830	LV and Emergency Power Distribution Design (2.5.06.01)	30	16-Jan-19 A	29-Jan-21	06-May-21	04-Jun-21	126	25%				29-Jan-21, LV and Emergency Power Distribution Design (2.5.06.01), LV and Em
05-1840	MVAC (2.5.06.02)	75	16-Jan-19 A	15-Mar-21	01-Jan-21	16-Mar-21	1	25%				15-Mar-21, MVAC (
05-1850	Odour Control (2.5.06.03)	105	31-Dec-20*	14-Apr-21	01-Dec-20	15-Mar-21	-30	0%				31-Dec-20*
05-1860	Plumbing (2.5.06.04)	90	16-Jan-19 A	30-Mar-21	07-Dec-20	06-Mar-21	-24	25%				
05-1870	Drainage (2.5.06.05)	30	16-Jan-19 A	29-Jan-21	05-Feb-21	06-Mar-21	36	25%				29-Jan-21, Drainage (2.5.06.05), Drainage (2.5.06.05), 29-Jan-21
05-1880	ELV (2.5.06.06)	76	16-Jan-19 A	16-Mar-21	04-Jun-21	18-Aug-21	155	25%				16-Mar-21, ELV (2
EP_SP_66_12-WP5A-M37.05.01.06 AIP Water Treatment Plant Building (2.6)												
05-1900	Architectural Design (2.6.00)	60	07-Sep-18 A	28-Feb-21	05-Feb-21	05-Apr-21	36	65%				28-Feb-21, Architectural Design (2.6.00
05-1950	Fire services installation design (2.6.05) (3 Packages)	85	20-Mar-19 A	26-Mar-21	25-Apr-21	19-Jul-21	116	19%				26-M
EP_SP_66_12-WP5A-M37.05.01.06.7 Building services design (excluding fire services installation design) (2.6.06)												
05-1960	Electrical Services and Lighting (2.6.06.01)	75	20-Mar-19 A	15-Mar-21	05-Jun-21	18-Aug-21	156	5%				15-Mar-21, Electric
05-1970	MVAC	75	25-Mar-19 A	15-Mar-21	17-Dec-20	01-Mar-21	-14	5%				MVAC, 15-Mar-21,
05-1990	Plumbing	105	20-Mar-19 A	14-Apr-21	22-Nov-20	06-Mar-21	-39	5%				
05-2000	Drainage	88	20-Mar-19 A	28-Mar-21	22-Feb-21	20-May-21	53	5%				21
05-2010	ELV	135	20-Mar-19 A	14-May-21	06-Apr-21	18-Aug-21	96	5%				
EP_SP_66_12-WP5A-M37.05.01.07 AIP Administration Building (2.7)												
05-2020	Architectural Design (2.7.00)	60	03-Aug-18 A	28-Feb-21	05-Feb-21	05-Apr-21	36	65%				28-Feb-21, Architectural Design (2.7.00
05-2030	Foundation design (2.7.01)	135	31-Dec-20	14-May-21	16-May-21	27-Sep-21	136	0%				31-Dec-20
05-2040	Structural design (2.7.02)	135	15-May-21	26-Sep-21	01-Oct-21	12-Feb-22	139	0%				
05-2050	Electrical and instrumentation works design (2.7.03)	135	31-Dec-20*	14-May-21	28-Feb-21	12-Jul-21	59	0%				31-Dec-20*
05-2060	Fire services installation design (3 Packages) (2.7.04)	122	03-Sep-19 A	02-May-21	19-Mar-21	19-Jul-21	79	9.5%				
EP_SP_66_12-WP5A-M37.05.01.07.6 Building services design (excluding fire services installation design) (2.7.05)												
05-2070	Electrical Services and Lighting (2.7.05.01)	75	03-Sep-19 A	15-Mar-21	05-Jun-21	18-Aug-21	156	5%				15-Mar-21, Electric
05-2080	MVAC	75	03-Sep-19 A	15-Mar-21	17-Dec-20	01-Mar-21	-14	5%				MVAC, 15-Mar-21,







Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

■ Remaining Work ◆ Actual Milestone
■ Actual Work ◆ Critical Milestone
■ Critical Remaining Work
◆ Milestone

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021	
									Dec	Jan	Feb	Mar
05-2100	Plumbing	0	03-Sep-19 A	31-Dec-20	06-Mar-21	06-Mar-21	66	5%				
05-2110	Drainage	88	03-Sep-19 A	28-Mar-21	22-Feb-21	20-May-21	53	5%				
05-2120	ELV	76	03-Sep-19 A	16-Mar-21	04-Jun-21	18-Aug-21	155	5%				
05-2130	Lifts and Escalators	135	30-Dec-19 A	14-May-21	28-Nov-20	11-Apr-21	-33	5%				
05-2130-1(M20)	Building Management System (BMS)	135	01-Feb-21*	15-Jun-21	29-Jul-21	10-Dec-21	178	0%				
EP_SP_66_12-WP5A-M37.05.01.08 AIP IWMF Substation (2.8)												
05-2170	Electrical and instrumentation works design (2.8.03) (14 Packages)	30	25-Oct-19 A	29-Jan-21	26-Nov-20	25-Dec-20	-35	55%				
05-2190	Fire services installation design (2.8.05) (2 Packages)	64	27-Nov-18 A	04-Mar-21	17-Apr-21	19-Jun-21	107	65%				
EP_SP_66_12-WP5A-M37.05.01.08.7 Building services design (excluding fire services installation design) (2.8.06)												
05-2240-1(M20)	Building Management System (BMS)	0	24-Dec-19 A	19-Jun-20 A				65%				
EP_SP_66_12-WP5A-M37.05.01.1 AIP Chimney												
EP_SP_66_12-WP5A-M37.05.01.1.1 Building services design (excluding fire services installation design)												
05-5430(5a)	Electrical Services and Lighting	135	31-Dec-20	14-May-21	02-Jan-22	16-May-22	367	0%				
05-5440(5a)	MVAC	105	31-Dec-20	14-Apr-21	01-Feb-22	16-May-22	397	0%				
05-5450(5a)	Plumbing	105	31-Dec-20	14-Apr-21	01-Feb-22	16-May-22	397	0%				
05-5460(5a)	Drainage	135	31-Dec-20	14-May-21	02-Jan-22	16-May-22	367	0%				
05-5470(5a)	ELV	135	31-Dec-20	14-May-21	02-Jan-22	16-May-22	367	0%				
05-5480(5a)	Lift	135	31-Dec-20	14-May-21	02-Jan-22	16-May-22	367	0%				
05-5490(5a)	Building Management System (BMS)	89	24-Dec-19 A	29-Mar-21	17-Feb-22	16-May-22	413	25%				
EP_SP_66_12-WP5A-M37.05.01.2 AIP Weighbridge												
EP_SP_66_12-WP5A-M37.05.01.2.1 Building services design (excluding fire services installation design)												
05-5500(5a)	Electrical Services and Lighting	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	0%				
05-5510(5a)	MVAC	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	0%				
05-5520(5a)	Plumbing	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	25%				
05-5530(5a)	Drainage	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	0%				
05-5540(5a)	ELV	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	0%				
05-5550(5a)	Lift	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	0%				
05-5560(5a)	Building Management System (BMS)	105	31-Dec-20	14-Apr-21	14-Dec-20	28-Mar-21	-17	0%				
EP_SP_66_12-WP5A-M37.05.01.09 AIP Air Quality Monitoring Stations (2.9)												
05-2250	Design of the Air Quality Monitoring Stations (2.9.01)	44	01-Oct-20 A	12-Feb-21	31-Dec-20	12-Feb-21	0	63.33%				
EP_SP_66_12-WP5A-M37.05.01.10 AIP Roads and Utilities (2.10)												
EP_SP_66_12-WP5A-M37.05.01.10.2 Sewerage design on the Artificial Island (2.10.02)												
05-2290	Contaminated Sewerage concept / sizing	135	18-Sep-19 A	14-May-21	25-Oct-21	08-Mar-22	298	5%				
EP_SP_66_12-WP5A-M37.05.01.10.3 Drainage system design on the Artificial Island (2.10.03)												
05-2310	First Flush Drainage System concept / sizing	135	22-May-19	14-May-21	29-Dec-20	12-May-21	-2	5%				
EP_SP_66_12-WP5A-M37.05.01.10.4 Water supply system design on the Artificial Island (2.10.04)												
05-2330	Reuse Water Distribution System (2.10.04.02)	0	15-Nov-19 A	11-Nov-20 A				65%				
05-2340	Reuse Water Distribution System - Irrigation System (2.10.04.03)	0	15-Nov-19 A	11-Nov-20 A				0%				
05-2350	Rainwater harvesting System (2.10.04.04)	135	13-Nov-20 A	14-May-21	22-Nov-20	05-Apr-21	-39	5%				
05-2360	Water Tanks (2.10.04.05)	135	31-Dec-20*	14-May-21	24-Nov-21	07-Apr-22	328	0%				
05-2370	External FS Systems (2.10.04.06)	135	04-Nov-19 A	14-May-21	24-Nov-21	07-Apr-22	328	65%				
05-2370-1(M24)	E&M system for seawater intake and brine discharge (2.10.04.07)	90	30-Aug-19 A	30-Mar-21	28-Jul-21	25-Oct-21	209	5%				
05-2370-2(M24)	Building Services system for seawater intake and brine discharge (2.10.04.09)	90	11-Mar-20 A	30-Mar-21	06-Apr-21	04-Jul-21	96	5%				
05-2370-3(5a)	Chemical scrubber system for odour control (2.10.04.10)	90	31-Dec-20*	30-Mar-21	02-Dec-20	01-Mar-21	-29	0%				
EP_SP_66_12-WP5A-M37.05.01.10.6 Design of telecommunication and other utilities (2.10.06)												
05-2380	Power Distribution System concept / schematics (2.10.06.01)	135	31-Dec-20*	14-May-21	17-Mar-21	29-Jul-21	76	0%				
05-2400	Lightning Protection System concept / schematics (2.10.06.03)	0	27-Dec-19 A	29-Oct-20 A				65%				
05-2410	Site ELV Network System - Communications System concept / schematics (2.10.06.04)	135	09-Mar-20 A	14-May-21	17-Mar-21	29-Jul-21	76	5%				
05-2420	Site ELV Network System - Security Systems concept / schematics (2.10.06.05)	135	09-Mar-20 A	14-May-21	17-Mar-21	29-Jul-21	76	5%				
05-2430	Site ELV Network System - Navigation aids concept / schematics (2.10.06.06)	135	31-Dec-20*	14-May-21	17-Mar-21	29-Jul-21	76	0%				
05-2440	Microwave transmission of FS direct link (2.10.06.07)	90	27-Nov-18 A	30-Mar-21	01-May-21	29-Jul-21	121	33.33%				
05-2450	Fuel Handling System concept / schematics (2.10.06.08)	135	24-Jan-20 A	14-May-21	25-Aug-22	06-Jan-23	602	5%				
05-3190	Computerised Maintenance Management System (CMMS)	75	10-Jun-19 A	15-Mar-21	15-Apr-21	28-Jun-21	105	65%				
05-3200	Information and Document Management System (IDMS)	75	15-Jul-19 A	15-Mar-21	15-Apr-21	28-Jun-21	105	65%				
05-3200-1(M34)	Design of Pipe / Utilities Trenches concept (2.10.06.09.01)	105	31-Dec-20*	14-Apr-21	11-Nov-21	23-Feb-22	315	0%				
05-3200-2(M34)	Sitewide Utilities Trenches Design (2.10.06.09.02)	105	22-Oct-20 A	14-Apr-21	11-Nov-21	23-Feb-22	315	5%				
05-3840 (M22)	Automatic Traffic Control System (ATCS) (2.10.06.12)	90	31-Dec-20	30-Mar-21	19-Jun-21	16-Sep-21	170	0%				
EP_SP_66_12-WP5A-M37.05.01.10.7 Utility ducts/Pipebridges design (2.10.25)												
05-2480	Pipebridge network - Layout	120	31-Dec-20	29-Apr-21	13-Dec-20	11-Apr-21	-18	0%				
05-2490	Pipebridge network - Foundation Plan	60	24-Jun-20 A	28-Feb-21	13-Dec-20	10-Feb-21	-18	5%				
05-2500	Pipebridge network - Structure Plan	60	24-Jun-20 A	28-Feb-21	13-Dec-20	10-Feb-21	-18	5%				
EP_SP_66_12-WP5A-M37.05.01.11 AIP Architectural, Finishes and Landscaping Works (2.11)												
EP_SP_66_12-WP5A-M37.05.01.11.1 External and internal finishes design for Incineration Plant Buildings (2.11.01)												
05-2510	External and internal finishes design for Incineration Plant Building (6 Packages)	137	04-May-20	16-May-21	23-Aug-21	06-Jan-22	235	5%				
05-2520	External and internal finishes design for ACC Equipment Structure	137	31-Dec-20*	16-May-21	27-Jun-21	10-Nov-21	178	0%				
05-2530	External and internal finishes design for Turbine Hall Building (3 Packages)	137	04-May-20	16-May-21	21-Nov-21	06-Apr-22	325	5%				
05-2540	External and internal finishes design for Air Compressor Building (3 Packages)	137	04-May-20	16-May-21	04-Nov-21	20-Mar-22	308	5%				
05-2550	External and internal finishes design for Chimney (6 Packages)	137	31-Dec-20*	16-May-21	22-Oct-21	07-Mar-22	295	0%				
05-2560	External and internal finishes design for Reception Pavilion (5 Packages)	137	30-Mar-20 A	16-May-21	22-Oct-21	07-Mar-22	295	5%				

Programme for Design and Construction Works
December 2020 Update (Rev WP-5A-M37)

	Remaining Work		Actual Milestone
	Actual Work		Critical Milestone
	Critical Remaining Work		
	Milestone		

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021	
									Dec	Jan	Feb	Mar
									37	38	39	40
EP_SP_66_12-WP5A-M37.05.01.11.2 External and internal finishes design for MT Plant Building (2.11.02)												
05-2570	External and internal finishes design for MT Plant Building (7 Packages)	136	27-Apr-20 A	15-May-21	28-Sep-21	10-Feb-22	271	5%				
EP_SP_66_12-WP5A-M37.05.01.11.3 External and internal finishes design for the Wastewater Treatment Plant (2.11.03)												
05-2580	External and internal finishes design for the Wastewater Treatment Plant (3 Packages)	135	31-Dec-20*	14-May-21	29-Sep-21	10-Feb-22	272	0%			31-Dec-20*	
EP_SP_66_12-WP5A-M37.05.01.11.4 External and internal finishes design for the Water Treatment Plant Building (2.11.04)												
05-2590	External and internal finishes design for the Water Treatment Plant Building (3 Packages)	135	31-Dec-20*	14-May-21	29-Sep-21	10-Feb-22	272	0%			31-Dec-20*	
EP_SP_66_12-WP5A-M37.05.01.11.5 External and internal finishes design for the Administration Building (2.11.05)												
05-2600	External and internal finishes design for the Administration Building (6 Packages)	135	27-Apr-20 A	14-May-21	30-Dec-21	13-May-22	364	5%				
EP_SP_66_12-WP5A-M37.05.01.11.6 External and internal finishes design for the IWMF Substation (2.11.06)												
05-2610	External and internal finishes design for the IWMF Substation (4 Packages)	105	30-Mar-20 A	14-Apr-21	31-Dec-20	14-Apr-21	0	5%				
EP_SP_66_12-WP5A-M37.05.01.11.7 Landscape masterplan (2.11.07)												
05-2620	Water Feature (2.11.07.01)	105	19-Jun-20 A	28-Jun-21	20-Nov-21	04-Mar-22	249	5%				
05-2630	Planting details	105	16-Mar-21*	28-Jun-21	20-Nov-21	04-Mar-22	249	0%				16-Mar-21*
05-2920_1(M34)	Turbine Hall Building (2.11.07.04)	105	08-May-20	28-Jun-21	03-Feb-22	18-May-22	324	5%				
05-2920_2(M34)	Reception Pavilion (2.11.07.06)	105	08-May-20	14-Apr-21	03-Feb-22	18-May-22	399	5%				
05-2920_3(M34)	MT Plant Building and Water Treatment Plant Building (2.11.07.07)	105	08-May-20	28-Jun-21	03-Feb-22	18-May-22	324	5%				
05-2920_4(M34)	Administration Building (2.11.07.08)	105	08-May-20	28-Jun-21	03-Feb-22	18-May-22	324	5%				
05-2920_5(M34)	IWMF Substation (2.11.07.09)	105	08-May-20	28-Jun-21	03-Feb-22	18-May-22	324	5%				
05-2920_6(M34)	Process Building (2.11.07.10)	105	08-May-20	28-Jun-21	03-Feb-22	18-May-22	324	5%				
EP_SP_66_12-WP5A-M37.05.01.11.8 Architectural Detailing - Site Wide (2.11.29)												
05-2640	Architectural Detailing - Site Wide Concept	137	31-Dec-20*	16-May-21	27-Dec-20	12-May-21	-4	0%			31-Dec-20*	
EP_SP_66_12-WP5A-M37.05.01.11.9 External and internal finishes design for Elavated Driveway												
05-5410	External and internal finishes design for Elavated Driveway	137	31-Dec-20*	16-May-21	27-Sep-22	10-Feb-23	635	0%			31-Dec-20*	
EP_SP_66_12-WP5A-M37.05.01.12 AIP Testing and Commissioning (2.12)												
05-2650	Factory Acceptance Testing plan (2.12.01.01) (1 Packages)	180	23-Apr-19 A	28-Jun-21	18-Apr-21	14-Oct-21	108	5%				
05-2650-1(5)	Factory Acceptance Testing plan (2.12.01.02-06) (7 Packages)	258	23-Apr-19 A	14-Sep-21	22-Mar-21	04-Dec-21	81	0%				
05-2660	Site Acceptance Testing plan (2.12.02)	105	31-Dec-20*	14-Apr-21	24-Jan-21	08-May-21	24	0%			31-Dec-20*	
05-2670	System commissioning plan (2.12.03)	105	31-Dec-20*	14-Apr-21	10-Dec-20	24-Mar-21	-21	0%			31-Dec-20*	
EP_SP_66_12-WP5A-M37.05.01.13 AIP Transportation Facilities for the Operation (2.13)												
05-2690	Design of vehicles for MSW and Ash and Residues delivery (2.13.01)	105	29-Jun-20 A	14-Apr-21	05-Dec-20	19-Mar-21	-26	5%				
05-2700	Design of marine vessels for the use of the Employer and visitors (2.13.02)	105	08-Sep-20 A	14-Apr-21	13-May-21	25-Aug-21	133	5%				
EP_SP_66_12-WP5A-M37.05.01.14 AIP Miscellaneous Works (2.14)												
05-2720	Design of visitors and environmental education facilities (2.14.02)	105	06-Jul-20 A	14-Apr-21	15-Jul-21	27-Oct-21	196	5%				
EP_SP_66_12-WP5A-M37.05.01.15 AIP Miscellaneous Detailing (2.15)												
05-2730	Covered walkway at passenger berth (2.15.02)	105	31-Dec-20*	14-Apr-21	31-Dec-20	14-Apr-21	0	0%			31-Dec-20*	
05-2750	Weighbridge office (2.15.04)	105	31-Dec-20*	14-Apr-21	12-Feb-21	27-May-21	43	0%			31-Dec-20*	
EP_SP_66_12-WP5A-M37.05.01.16 AIP Auxiliary Plant Systems (2.16)												
05-2770	Vehicle Fuel Filling Station (2.16.02)	135	31-Dec-20	14-May-21	22-Jan-22	05-Jun-22	387	0%			31-Dec-20	
05-2780	Stores systems (2.16.03)	135	22-Jan-21*	05-Jun-21	08-Mar-22	20-Jul-22	410	0%			22-Jan-21*	
05-2780-1(5a)	IWMF Laboratory (2.16.04)	135	13-May-20	14-May-21	03-Sep-21	15-Jan-22	246	5%				
05-2780-2(5a)	hoisting systems (2.16.09)	135	16-Sep-20 A	14-May-21	25-Apr-21	06-Sep-21	115	5%				
EP_SP_66_12-WP5A-M37.05.02 DDA Design Package Submissions												
EP_SP_66_12-WP5A-M37.05.02.01 DDA Process and Layout Design (2.1)												
EP_SP_66_12-WP5A-M37.05.02.01.1 MSW treatment process design for incineration (2.1.13)												
05-5090	Incineration System (2.1.13.01) (2 Packages) (link up with 05-3610)	65	30-Jul-20 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%				
05-5100	Heat Recovery Boiler (2.1.13.02) (2 Packages) (link up with 05-3620)	65	23-Apr-20 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%				
05-5110	Ash Cranes (2.1.13.04) (2 Packages)	105	31-Dec-20	14-Apr-21	19-Dec-20	02-Apr-21	-12	0%			31-Dec-20	
05-5120	Leachate Collection and Treatment (2.1.13.05) (2 Packages)	105	31-Dec-20*	14-Apr-21	28-Jan-21	12-May-21	28	0%			31-Dec-20*	
05-5130	Waste Water Treatment System (2.1.13.06) (2 Packages)	105	31-Dec-20	14-Apr-21	22-Aug-21	04-Dec-21	234	0%			31-Dec-20	
05-5140	Overall Plan Water Scheme (2.1.13.07)	105	31-Dec-20	14-Apr-21	18-Feb-21	02-Jun-21	49	0%			31-Dec-20	
05-5150	Boiler Feed Water System (2.1.13.03) (2 Packages)	65	03-Aug-20 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	45%				
EP_SP_66_12-WP5A-M37.05.02.01.2 MSW treatment process design for mechanical treatment (2.1.14)												
05-3510	Water Treatment Plant and Boiler Water Treatment (Demin Unit) Plant	105	19-Dec-20 A	14-Apr-21	03-Jan-21	17-Apr-21	3	5%			19-Dec-20 A, 19-Dec-20 A	
EP_SP_66_12-WP5A-M37.05.02.01.3 Waste heat recovery and Power generation system (2.1.15)												
05-5220	Power Island (Steam Turbine Generator, Pressure Reducing and Desuperheating Station, Air Cooled Condenser)	105	25-May-20	14-Apr-21	19-Jan-21	03-May-21	19	5%				
05-5230	Closed Circuit Cooling Water System	105	20-Apr-20 A	14-Apr-21	22-Oct-21	03-Feb-22	295	5%				
05-5240	Compressed Air Plants	105	31-Dec-20	14-Apr-21	22-Oct-21	03-Feb-22	295	0%			31-Dec-20	
EP_SP_66_12-WP5A-M37.05.02.01.4 Flue gas treatment process design for incineration (2.1.16)												
05-4660	Flue Gas Treatment System (2 Packages)	65	23-Apr-20 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%				
05-4980	Boiler ash and APC residue handling and solidification (2 Packages)	65	23-Apr-20 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%				
EP_SP_66_12-WP5A-M37.05.02.01.5 Logistic arrangement design for MSW and Ash and Residues (2.1.17)												
05-4390	Weighbridge Systems	105	31-Dec-20	14-Apr-21	17-Jun-21	29-Sep-21	168	0%			31-Dec-20	
05-4400	Waste Crane and Grapple System	105	06-Jul-20 A	14-Apr-21	19-Dec-20	02-Apr-21	-12	5%				
05-4410	Mechanical Shredder	105	31-Dec-20	14-Apr-21	23-Nov-21	07-Mar-22	327	0%			31-Dec-20	
EP_SP_66_12-WP5A-M37.05.02.01.6 Site Master Layout Plan and Plant Layout (2.1.18)												
05-3520	Site Master Layout Plan and Plant Layout	105	07-Mar-21	19-Jun-21	13-Apr-21	26-Jul-21	37	0%				07-Mar-21
EP_SP_66_12-WP5A-M37.05.02.01.7 Statutory Fire Compliance (2.1.26)												
05-4420	Fire Safety Compliance	122	10-Apr-19 A	03-May-21	04-Apr-21	03-Aug-21	92	0%				
EP_SP_66_12-WP5A-M37.05.02.02 DDA Ground Treatment, Reclamation, Seawall, Breakwater, Berth (2.2)												

Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

■ Remaining Work ◆ Actual Milestone
■ Actual Work ◆ Critical Milestone
■ Critical Remaining Work
◆ Milestone

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021		
									Dec	Jan	Feb	Mar	
									37	38	39	40	
05-3450	Seawall design (2.2.20)	30	12-Nov-18 A	29-Jan-21	23-Mar-21	21-Apr-21	82	65%			29-Jan-21, Seawall design (2.2.20), Seawall design (2.2.20), 29-Jan-21		
05-3460	Breakwater design (2.2.21)	105	12-Apr-19 A	14-Apr-21	13-Jun-22	25-Sep-22	529	65%					
05-3470	Berth design (2.2.22)	30	01-Nov-18 A	29-Jan-21	23-Mar-21	21-Apr-21	82	65%			29-Jan-21, Berth design (2.2.22), Berth design (2.2.22), 29-Jan-21		
05-3490	Onshore vessel power supply system (2.2.24)	135	30-Jan-21	13-Jun-21	31-Dec-20	14-May-21	-30	0%			30-Jan-21		
EP_SP_66_12-WP5A-M37.05.02.03 DDA Incineration Plant Buildings (2.3)													
EP_SP_66_12-WP5A-M37.05.02.03.1 General Layout Drawings and Fire Safety Strategy (2.3.25)													
05-3290	Process Building	135	30-Jan-21	13-Jun-21	25-May-21	06-Oct-21	115	0%			30-Jan-21		
05-3300	ACC Equipment Structure	135	30-Jan-21	13-Jun-21	23-Feb-21	07-Jul-21	24	0%			30-Jan-21		
EP_SP_66_12-WP5A-M37.05.02.03.2 Foundation design (2.3.13)													
05-3220	Process Building Waste Bunker, Tipping Hall, Basin Area and Workshop	137	19-Mar-21	02-Aug-21	09-Oct-21	22-Feb-22	204	0%			19-Mar-21		
05-3230	ACC Equipment Structure	137	19-Mar-21	02-Aug-21	30-Dec-21	15-May-22	286	0%			19-Mar-21		
EP_SP_66_12-WP5A-M37.05.02.03.3 Structural design (2.3.14)													
05-5340	ACC Equipment Structure	189	31-Dec-20*	07-Jul-21	25-Jan-21	01-Aug-21	25	0%			31-Dec-20*		
05-5350	Turbine Hall Building (2.3.14.03)	189	31-Dec-20*	07-Jul-21	13-Jun-22	18-Dec-22	529	0%			31-Dec-20*		
05-5360	Compressor and CCCW Building	189	31-Dec-20*	07-Jul-21	07-Sep-22	14-Mar-23	615	0%			31-Dec-20*		
05-5380	Chimney, Elevated Drive Way and associated structures and Reception Pavilion	189	31-Dec-20*	07-Jul-21	14-May-22	18-Nov-22	499	0%			31-Dec-20*		
05-5390	Reception Pavilion Structural Design	189	28-May-20	07-Jul-21	15-Sep-22	22-Mar-23	623	5%					
EP_SP_66_12-WP5A-M37.05.02.03.4 Electrical and instrumentation works design (2.3.15)													
05-3360	11kV/380V Power Transformers and 11kV Earthing Transformer	75	22-Sep-20 A	13-Jun-21	01-Mar-21	14-May-21	-30	5%					
05-3370	E&I Package 1 (Process Island)	209	31-Dec-20	27-Jul-21	29-Nov-20	25-Jun-21	-32	0%			31-Dec-20		
05-3380	E&I Package 2 (Power Island)	165	31-Dec-20	13-Jun-21	30-Nov-20	13-May-21	-31	0%			31-Dec-20		
EP_SP_66_12-WP5A-M37.05.02.03.8 Operation Management System (2.3.15.04)													
05-3390	Supervisory Control/Data Acquisition/ Distributed Control (SCADA/DCS) System (12 Packages)	105	08-Jun-20 A	14-Apr-21	10-Jan-22	24-Apr-22	375	5%					
05-3420	Automatic License Plate and Container Recognition System (ALPCRS)	105	27-Sep-21	09-Jan-22	10-Jan-22	24-Apr-22	105	0%					
EP_SP_66_12-WP5A-M37.05.02.03.5 Mechanical works design (2.3.16)													
EP_SP_66_12-WP5A-M37.05.02.03.5.1 Plant and Equipment													
05-3580	Weighbridge Systems	105	31-Dec-20	14-Apr-21	17-Jun-21	29-Sep-21	168	0%			31-Dec-20		
05-3590	Waste Crane and Grapple System	105	30-Sep-20 A	14-Apr-21	19-Dec-20	02-Apr-21	-12	5%					
05-3600	Mechanical Shredder	105	09-Oct-20 A	14-Apr-21	23-Nov-21	07-Mar-22	327	0%					
05-3610	Incineration System (9 Packages)	65	13-Feb-19 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%			Incineration System (9 Packages)		
05-3620	Heat Recovery Boiler (8 Packages)	103	17-May-19	12-Apr-21	28-Jan-21	10-May-21	28	5%					
05-3630	Boiler Feed Water Systems (4 Packages)	65	16-Jul-19 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%			Boiler Feed Water Systems (4 Packages)		
05-3640	Ash cranes	105	31-Dec-20	14-Apr-21	19-Dec-20	02-Apr-21	-12	0%			31-Dec-20		
05-3650	Leachate collection and treatment	105	31-Dec-20*	14-Apr-21	28-Jan-21	12-May-21	28	0%			31-Dec-20*		
05-3790	Flue Gas Treatment System (12 Packages)	65	15-Oct-19 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%			Flue Gas Treatment System (12 Packages)		
05-3800	Boiler ash and APC residue handling and solidification	65	09-Jun-20 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	5%			Boiler ash and APC residue handling and solidification		
05-3810	Steam Turbine Generator (STG) and Pressure Reducing and Desuperheating Station (PRDS)	105	30-Jul-20 A	14-Apr-21	19-Jan-21	03-May-21	19	5%					
05-3820	Air cooled condenser	105	30-Jul-20 A	14-Apr-21	19-Jan-21	03-May-21	19	5%					
05-3825(3)	Closed Circuit Cooling Water System	105	30-Jul-20 A	14-Apr-21	15-May-21	27-Aug-21	135	5%					
EP_SP_66_12-WP5A-M37.05.02.03.5.2 Process Pipeworks (Incl. Ductworks) and Valves													
05-3840	Process island (furnace-boiler-FGC)	82	16-May-19	22-Mar-21	07-Oct-21	27-Dec-21	280	0%			22-Mar-21		
05-4350	Pipebridge A (Between Process island & Turbine Hall)	105	01-Mar-21	13-Jun-21	12-May-21	24-Aug-21	72	0%			01-Mar-21		
05-4360	Compressed Air Plant area	105	31-Dec-20	14-Apr-21	08-Jul-21	20-Oct-21	189	0%			31-Dec-20		
05-4370	Pipebridge B (Between CCCW Area & Turbine Hall)	105	31-Dec-20	14-Apr-21	12-May-21	24-Aug-21	132	0%			31-Dec-20		
05-4380	Pipebridge C (Between Turbine Hall & ACC Yard)	105	31-Dec-20	14-Apr-21	12-May-21	24-Aug-21	132	0%			31-Dec-20		
05-4950	Turbine Hall	105	31-Dec-20	14-Apr-21	30-Nov-20	14-Mar-21	-31	0%			31-Dec-20		
05-4970	CCCW Area	105	31-Dec-20	14-Apr-21	08-Jul-21	20-Oct-21	189	0%			31-Dec-20		
EP_SP_66_12-WP5A-M37.05.02.03.5.3 Process steel structure support (For equipment, piping & duct, cable tray etc)													
05-3530	Process island (furnace-boiler-FGC) (3 Packages)	105	02-Aug-19 A	14-Apr-21	15-Feb-21	30-May-21	46	0%					
05-3540	Pipebridge (Between Process island & Turbine Hall)	105	31-Dec-20	14-Apr-21	12-May-21	24-Aug-21	132	0%			31-Dec-20		
05-3550	Turbine Hall	34	30-Jul-20 A	02-Feb-21	01-Dec-20	03-Jan-21	-30	0%			Turbine Hall, 02-Feb-21, 02-Feb-21, Turbine Hall		
05-3560	Pipebridge (Between CCCW Area & Turbine Hall)	105	28-Aug-20 A	14-Apr-21	12-May-21	24-Aug-21	132	5%					
05-3570	Pipebridge (Between Turbine Hall & ACC Yard)	105	28-Aug-20 A	14-Apr-21	12-May-21	24-Aug-21	132	5%					
EP_SP_66_12-WP5A-M37.05.02.03.5.4 Equipment and piping insulation													
05-4500	Incineration System	105	31-Dec-20*	14-Apr-21	24-Jun-21	06-Oct-21	175	0%			31-Dec-20*		
05-4510	Heat Recovery Boiler	105	31-Dec-20*	14-Apr-21	24-Jun-21	06-Oct-21	175	0%			31-Dec-20*		
05-4520	Boiler Feed Water Systems	105	31-Dec-20*	14-Apr-21	08-Jul-21	20-Oct-21	189	0%			31-Dec-20*		
05-4530	Flue Gas Treatment System	105	31-Dec-20*	14-Apr-21	24-Jun-21	06-Oct-21	175	0%			31-Dec-20*		
05-4540	Boiler ash and APC residue handling and solidification	105	31-Dec-20*	14-Apr-21	08-Jul-21	20-Oct-21	189	0%			31-Dec-20*		
05-4550	Steam Turbine Generator (STG) and Pressure Reducing and Desuperheating Station (PRDS)	105	31-Dec-20	14-Apr-21	24-Jun-21	06-Oct-21	175	0%			31-Dec-20		
05-4560	Air cooled condenser	105	31-Dec-20	14-Apr-21	08-Jul-21	20-Oct-21	189	0%			31-Dec-20		
05-4570	Closed Circuit Cooling Water System	105	31-Dec-20	14-Apr-21	15-May-21	27-Aug-21	135	0%			31-Dec-20		
EP_SP_66_12-WP5A-M37.05.02.03.7 Building services design (excluding fire services installation design) (2.3.18)													
05-3700	MVAC (6 Packages)	135	30-Mar-21	12-Aug-21	02-Mar-21	14-Jul-21	-28	0%			30-Mar-21		
05-3770	Building Management System (BMS) ELV (7 Packages)	135	03-Mar-21	15-Jul-21	11-Dec-21	24-Apr-22	283	0%			03-Mar-21		
EP_SP_66_12-WP5A-M37.05.02.04 DDA Mechanical Treatment Plant Building (2.4)													
05-5160	Architectural Design (2.4.25)	105	01-Mar-21*	13-Jun-21	06-Apr-21	19-Jul-21	36	0%			01-Mar-21*		
05-5170	Foundation design (2.4.13)	105	15-Apr-21	28-Jul-21	05-Jun-21	17-Sep-21	51	0%					







Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

■ Remaining Work ◆ Actual Milestone
■ Actual Work ◆ Critical Milestone
■ Critical Remaining Work
◆ Milestone

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021	
									Dec	Jan	Feb	Mar
05-5180	Structural design (2.4.14)	105	29-Jul-21	10-Nov-21	12-Feb-22	27-May-22	198	0%				
05-5190	Electrical and instrumentation works design (2.4.15)	105	15-Apr-21	28-Jul-21	12-Aug-21	24-Nov-21	119	0%				
05-5200	Mechanical works design (2.4.16)	105	15-Apr-21	28-Jul-21	18-Apr-21	31-Jul-21	3	0%				
05-5210	Fire services installation design (2.4.17)	105	14-Jun-21	26-Sep-21	20-Jul-21	01-Nov-21	36	0%				
EP_SP_66_12-WP5A-M37.05.02.04.7 Building services design (excluding fire services installation design) (2.4.18)												
05-3850	LV and Emergency Power Distribution Design	135	02-Apr-21*	14-Aug-21	19-Aug-21	31-Dec-21	139	0%				02-Apr-21*
05-3860	MVAC	135	16-Mar-21	28-Jul-21	02-Mar-21	14-Jul-21	-14	0%				16-Mar-21
05-3870	Odour Control	135	15-Apr-21	27-Aug-21	16-Mar-21	28-Jul-21	-30	0%				
05-3880	Plumbing	135	29-Jun-21	10-Nov-21	21-May-21	02-Oct-21	-39	0%				
05-3890	Drainage	135	28-Mar-21	10-Aug-21	21-May-21	02-Oct-21	53	0%				28-Mar-21
05-3900	Lighting and small power	135	15-May-21	26-Sep-21	19-Aug-21	31-Dec-21	96	0%				
05-3910	Lifts and Escalators	135	29-Jul-21	10-Dec-21	13-Oct-21	24-Feb-22	76	0%				
05-3910-1(M20)	Building Management System (BMS)	135	29-Jul-21	10-Dec-21	11-Dec-21	24-Apr-22	135	0%				
EP_SP_66_12-WP5A-M37.05.02.05 DDA Wastewater Treatment Plant (2.5)												
05-3920	Architectural Design (2.5.25)	75	01-Mar-21*	14-May-21	12-Jul-21	24-Sep-21	133	0%				01-Mar-21*
05-3930	Foundation design (2.5.13)	135	31-Dec-20	14-May-21	11-Oct-21	22-Feb-22	284	0%	31-Dec-20			
05-3950	Electrical and instrumentation works design (2.5.15)	135	31-Dec-20	14-May-21	04-May-21	15-Sep-21	124	0%	31-Dec-20			
EP_SP_66_12-WP5A-M37.05.02.05.7 Building services design (excluding fire services installation design) (2.5.18)												
05-3990	MVAC	120	16-Mar-21	13-Jul-21	17-Mar-21	14-Jul-21	1	0%				16-Mar-21
05-4030	ELV	135	17-Mar-21	29-Jul-21	19-Aug-21	31-Dec-21	155	0%				17-Mar-21
EP_SP_66_12-WP5A-M37.05.02.06 DDA Water Treatment Plant Building (2.6)												
05-4050	Architectural Design (2.6.25)	105	01-Mar-21	13-Jun-21	06-Apr-21	19-Jul-21	36	0%				01-Mar-21
05-4060	Foundation design (2.6.13)	180	31-Dec-20	28-Jun-21	22-Mar-21	17-Sep-21	81	0%	31-Dec-20			
05-4080	Electrical and instrumentation works design (2.6.15)	105	31-Dec-20	14-Apr-21	03-Jun-21	15-Sep-21	154	0%	31-Dec-20			
05-4090	Mechanical works design (2.6.16)	105	31-Dec-20	14-Apr-21	03-Jun-21	15-Sep-21	154	0%	31-Dec-20			
EP_SP_66_12-WP5A-M37.05.02.06.7 Building services design (excluding fire services installation design) (2.6.18)												
05-4110	Electrical Services and Lighting	135	16-Mar-21	28-Jul-21	19-Aug-21	31-Dec-21	156	0%				16-Mar-21
05-4120	MVAC	135	16-Mar-21	28-Jul-21	02-Mar-21	14-Jul-21	-14	0%				16-Mar-21
05-4150	Drainage	135	28-Mar-21	10-Aug-21	21-May-21	02-Oct-21	53	0%				28-Mar-21
EP_SP_66_12-WP5A-M37.05.02.07 DDA Administration Building (2.7)												
05-4170	Architectural Design (2.7.21)	105	01-Mar-21*	13-Jun-21	06-Apr-21	19-Jul-21	36	0%				01-Mar-21*
05-4180	Foundation design (2.7.11)	135	15-May-21	26-Sep-21	28-Sep-21	09-Feb-22	136	0%				
05-4190	Structural design (2.7.12)	135	27-Sep-21	08-Feb-22	13-Feb-22	27-Jun-22	139	0%				
05-4200	Electrical and instrumentation works design (2.7.13)	135	15-May-21	26-Sep-21	13-Jul-21	24-Nov-21	59	0%				
05-4210	Fire services installation design (2.7.14)	105	14-Jun-21	26-Sep-21	20-Jul-21	01-Nov-21	36	0%				
EP_SP_66_12-WP5A-M37.05.02.07.6 Building services design (excluding fire services installation design) (2.7.15)												
05-4220	Electrical Services and Lighting	135	16-Mar-21	28-Jul-21	19-Aug-21	31-Dec-21	156	0%				16-Mar-21
05-4230	MVAC	135	16-Mar-21	28-Jul-21	02-Mar-21	14-Jul-21	-14	0%				16-Mar-21
05-4250	Plumbing	135	16-Mar-21	28-Jul-21	21-May-21	02-Oct-21	66	0%				16-Mar-21
05-4260	Drainage	135	28-Mar-21	10-Aug-21	21-May-21	02-Oct-21	53	0%				28-Mar-21
05-4270	ELV	135	17-Mar-21	29-Jul-21	19-Aug-21	31-Dec-21	155	0%				17-Mar-21
05-4280	Lifts and Escalators	135	29-Jul-21	10-Dec-21	26-Jun-21	07-Nov-21	-33	0%				
05-4280-1(M20)	Building Management System (BMS)	135	16-Jun-21	28-Oct-21	11-Dec-21	24-Apr-22	178	0%				
EP_SP_66_12-WP5A-M37.05.02.08 DDA IWMF Substation (2.8)												
05-4290	Architectural Design (2.8.25)	105	31-Dec-20*	14-Apr-21	07-Mar-21	19-Jun-21	66	0%	31-Dec-20*			
05-4300	Foundation design (2.8.13)	200	31-Dec-20	18-Jul-21	11-Jul-21	26-Jan-22	192	0%	31-Dec-20			
05-4310	Structural design (2.8.14)	195	27-Feb-20 A	13-Jul-21	18-Oct-21	30-Apr-22	291	5%				
05-4320	Electrical and instrumentation works design (2.8.15)	135	30-Jan-21	13-Jun-21	26-Dec-20	09-May-21	-35	0%				30-Jan-21
EP_SP_66_12-WP5A-M37.05.02.08.7 Building services design (excluding fire services installation design) (2.8.18)												
05-4990	Electrical Services and Lighting	135	31-Dec-20	14-May-21	19-Aug-21	31-Dec-21	231	0%	31-Dec-20			
05-5000	MVAC	135	31-Dec-20	14-May-21	02-Mar-21	14-Jul-21	61	0%	31-Dec-20			
05-5010	Plumbing	135	31-Dec-20	14-May-21	21-May-21	02-Oct-21	141	0%	31-Dec-20			
05-5020	Drainage	135	31-Dec-20	14-May-21	21-May-21	02-Oct-21	141	0%	31-Dec-20			
05-5030	ELV	135	31-Dec-20	14-May-21	19-Aug-21	31-Dec-21	231	0%	31-Dec-20			
05-5030-1(M20)	Building Management System (BMS)	135	31-Dec-20	14-May-21	11-Dec-21	24-Apr-22	345	0%	31-Dec-20			
EP_SP_66_12-WP5A-M37.05.02.1 DDA Chimney												
EP_SP_66_12-WP5A-M37.05.02.1.1 Building services design (excluding fire services installation design)												
05-6060(5a)	Building Management System (BMS)	135	30-Mar-21	11-Aug-21	17-May-22	28-Sep-22	413	0%				30-Mar-21
EP_SP_66_12-WP5A-M37.05.02.09 DDA Air Quality Monitoring Stations (2.9)												
05-4490	Design of the Air Quality Monitoring Stations (2.9.03)	135	13-Feb-21	27-Jun-21	13-Feb-21	27-Jun-21	0	0%				13-Feb-21
EP_SP_66_12-WP5A-M37.05.02.10 DDA Roads and Utilities (2.10)												
EP_SP_66_12-WP5A-M37.05.02.10.1 Permanent road works layout on the Artificial Island (2.10.13)												
05-4470	Roads and hardstandings layout	135	31-Dec-20	14-May-21	19-Mar-23	31-Jul-23	808	0%	31-Dec-20			
05-4480	Road signage and markings	135	31-Dec-20	14-May-21	01-Aug-23	13-Dec-23	943	0%	31-Dec-20			
EP_SP_66_12-WP5A-M37.05.02.10.2 Sewerage design on the Artificial Island (2.10.14)												
05-4430	Foul Sewerage	135	31-Dec-20	14-May-21	21-May-21	02-Oct-21	141	0%	31-Dec-20			
EP_SP_66_12-WP5A-M37.05.02.10.3 Drainage system design on the Artificial Island (2.10.15)												
05-5310	Surface water Drainage System	135	31-Dec-20	14-May-21	21-May-21	02-Oct-21	141	0%	31-Dec-20			
EP_SP_66_12-WP5A-M37.05.02.10.4 Water supply system design on the Artificial Island (2.10.16)												

Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

	Remaining Work		Actual Milestone
	Actual Work		Critical Milestone
	Critical Remaining Work		
	Milestone		

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021			
									Dec	37	Jan	38	Feb	39
05-5250	Potable Water Distribution System	135	31-Dec-20	14-May-21	03-Apr-22	15-Aug-22	458	0%			31-Dec-20			
05-5260	Recycled Water System	135	31-Dec-20	14-May-21	03-Apr-22	15-Aug-22	458	0%			31-Dec-20			
05-5270	Irrigation System	135	31-Dec-20	14-May-21	21-May-21	02-Oct-21	141	0%			31-Dec-20			
05-5300-1(M24)	E&M system for seawater intake and brine discharge (2.10.04.07)	90	30-Jan-21	29-Apr-21	27-Aug-21	24-Nov-21	209	0%				30-Jan-21		
EP_SP_66_12-WP5A-M37.05.02.10.6 Design of telecommunication and other utilities (2.10.18)														
05-4590	Site Lighting Concept / Schematics	135	31-Dec-20	14-May-21	19-Mar-23	31-Jul-23	808	0%			31-Dec-20			
05-4600	Lightning Protection System concept / schematics	135	12-Jan-21	26-May-21	18-Apr-21	30-Aug-21	96	0%			12-Jan-21			
EP_SP_66_12-WP5A-M37.05.02.10.7 Utility ducts/Pipebridges design (2.10.26)														
05-5070	Pipebridge network - Foundation Plan	135	01-Mar-21	13-Jul-21	11-Feb-21	25-Jun-21	-18	0%				01-Mar-21		
05-5080	Pipebridge network - Structure Plan	135	01-Mar-21	13-Jul-21	11-Feb-21	25-Jun-21	-18	0%				01-Mar-21		
EP_SP_66_12-WP5A-M37.05.02.11 DDA Architectural, Finishes and Landscaping Works (2.11)														
EP_SP_66_12-WP5A-M37.05.02.11.1 External and internal finishes design for Incineration Plant Buildings (2.11.15)														
05-4670	External and internal finishes design for Incineration Plant Building (13 Packages)	137	30-Jan-21*	15-Jun-21	22-Sep-21	05-Feb-22	235	0%				30-Jan-21*		
05-4690	External and internal finishes design for Turbine Hall Building (7 Packages)	137	30-Jan-21*	15-Jun-21	21-Dec-21	06-May-22	325	0%				30-Jan-21*		
05-4700	External and internal finishes design for Air Compressor Building (7 Packages)	137	30-Jan-21*	15-Jun-21	04-Dec-21	19-Apr-22	308	0%				30-Jan-21*		
05-4710	External and internal finishes design for Chimney (10 Packages)	137	30-Jan-21*	15-Jun-21	21-Nov-21	06-Apr-22	295	0%				30-Jan-21*		
05-4720	External and internal finishes design for Reception Pavilion (10 Packages)	137	30-Jan-21*	15-Jun-21	21-Nov-21	06-Apr-22	295	0%				30-Jan-21*		
EP_SP_66_12-WP5A-M37.05.02.12 DDA Testing and Commissioning (2.12)														
05-4810-1(5a)	Factory Acceptance Testing plan (2.12.09.02-07) (8 Packages)	60	08-Sep-20 A	14-Sep-21	06-Oct-21	04-Dec-21	81	5%						
EP_SP_66_12-WP5A-M37.06 Procurement of Major Equipment														
EP_SP_66_12-WP5A-M37.06.1 Off-site Fabrication of Incineration Modules														
EP_SP_66_12-WP5A-M37.06.1.25 Material Procurement														
06-1000-1(1)	Mechanical Equipment Material Submission and Approval	35	09-Jul-18 A	03-Feb-21	24-Nov-20	28-Dec-20	-37	80.56%						
06-1000-2(1)	Pipe Material Submission and Approval	65	29-Oct-19 A	05-Mar-21	24-Nov-20	27-Jan-21	-37	92%						
06-1000-3(1)	Electrical and Instrumentation Material Submission and Approval	90	31-Dec-20	30-Mar-21	29-Nov-20	26-Feb-21	-32	0%			31-Dec-20			
06-1010-1(1)	Mechanical Equipment Procurement (incl. FAT)	94	29-Jun-18 A	04-Apr-21	28-Jan-21	01-May-21	27	74%						
06-1010-2(1)	Pipe Material Procurement (incl. FAT)	180	06-Mar-21	01-Sep-21	28-Jan-21	26-Jul-21	-37	0%					06-Mar-21	
EP_SP_66_12-WP5A-M37.06.1.26 Fabrication of Module														
06-1010-4(5a)	Preparation Works for Steel Support Frame	22	24-Feb-20 A	21-Jan-21	06-Jan-21	27-Jan-21	6	87.78%						
06-1020-1(1)	Erection of Steel Support Frame	563	15-Sep-20 A	16-Jul-22	18-Dec-20	04-Jul-22	-12	15.84%						
06-1020-2(1)	Mechanical Installation Works	584	06-Mar-21	10-Oct-22	28-Jan-21	03-Sep-22	-37	0%					06-Mar-21	
06-1020-3(1)	Piping and Instrumentation Installation Works	650	06-Mar-21	15-Dec-22	28-Jan-21	08-Nov-22	-37	0%					06-Mar-21	
EP_SP_66_12-WP5A-M37.06.2 Off-site Fabrication of Turbine Modules														
EP_SP_66_12-WP5A-M37.06.2.1 Material Procurement														
06-1050-3(1)	Electrical and Instrumentation Material Submission and Approval	90	06-Mar-21	03-Jun-21	03-Feb-21	03-May-21	-31	0%						06-Mar-21
06-1060-1(1)	Mechanical Equipment Procurement (Incl. FAT)	159	18-Jun-18 A	07-Jun-21	26-Nov-20	03-May-21	-35	54.57%						
EP_SP_66_12-WP5A-M37.06.2.2 Fabrication of Module														
06-1070-1(1)	Erection of Steel Support Frame	120	08-Feb-21	07-Jun-21	04-Jan-21	03-May-21	-35	0%					08-Feb-21	
EP_SP_66_12-WP5A-M37.06.3 Procurement for ACC Units														
06-1110	Material & Equipment Procurement	250	31-Dec-20	06-Sep-21	25-Nov-20	01-Aug-21	-36	0%			31-Dec-20			
EP_SP_66_12-WP5A-M37.06.7 Procurement for HV Transformers and Associated Equipment														
EP_SP_66_12-WP5A-M37.06.7.1 Procurement of Transformers & EDG														
06-1280(1)	Procurement of Transformers	338	19-Jul-19 A	08-Jul-22	06-Jul-21	08-Jun-22	-30	38.55%						
EP_SP_66_12-WP5A-M37.06.10 Procurement and Off-site Fabrication of Pipe Bridges (Incl. Pipings)														
06-1400	Material & Equipment Procurement	450	09-Aug-20 A	04-Jan-23	24-Sep-21	17-Dec-22	-18	0%						
EP_SP_66_12-WP5A-M37.08 Maritime Works														
EP_SP_66_12-WP5A-M37.08.1 Marine Construction														
EP_SP_66_12-WP5A-M37.08.1.1 Phase I - Construction of Perimeter Seawalls														
EP_SP_66_12-WP5A-M37.08.1.1.1 Seawall and Berth at DCM Area														
EP_SP_66_12-WP5A-M37.08.1.1.1.5 Seawall Structural Works														
08-1100	Rubble Mound Laying (100,000m3 approx. @550m3/d)	12	27-Jun-20 A	11-Jan-21	10-Apr-21	21-Apr-21	100	93.41%					11-Jan-21	
08-1105(6) (M22)	Prefabrication for Caisson (No.35 to No.43) Including Marine Access	30	28-Jan-20 A	29-Jan-21	23-Mar-21	21-Apr-21	82	91.1%					29-Jan-21	
08-1115(3)	Caisson infill, Solid ballast, toe protection, precast concrete blocks ..etc Laying	8	29-Oct-19 A	07-Jan-21	14-Apr-21	21-Apr-21	105	97%					07-Jan-21	
EP_SP_66_12-WP5A-M37.08.1.2 Phase II - Reclamation, Breakwater and Berth Construction														
EP_SP_66_12-WP5A-M37.08.1.2.1 Reclamation														
08-1200	Reclamation fill for Northern Side (from A2) from -9.0mPD to +2.5mPD (450,008m3 @ 4000m3/d)	1	16-Sep-20 A	31-Dec-20	22-Nov-20	22-Nov-20	-39	99.12%						
08-1200-1 (M35)	Reclamation fill for Eastern Side (from E6) from -9.0mPD to -7.5mPD (120,000m3 @ 4000m3/d)	30	01-Jan-21	30-Jan-21	23-Nov-20	22-Dec-20	-39	0%			01-Jan-21			
08-1200-2 (M35)	Reclamation fill for Eastern Side (from E6) from -7.5mPD to +2.5mPD (480,011m3 @ 4000m3/d)	120	31-Jan-21	30-May-21	23-Dec-20	21-Apr-21	-39	0%				31-Jan-21		
08-1200-3 (M35)	Reclamation fill for Marine Access from -9.0mPD to +2.5mPD (~300,000m3 @ 4000m3/d)	37	31-May-21	06-Jul-21	22-Apr-21	28-May-21	-39	0%						
08-1210	Reclamation fill from +2.5 to Formation Level (510,000m3 @4250m3/d)	120	08-May-21	04-Sep-21	30-Mar-21	27-Jul-21	-39	0%						
08-1220	Lay Surcharge (605,000m3 @ 7600m3/d)	80	23-Jul-21	10-Oct-21	14-Jun-21	01-Sep-21	-39	0%						
08-1230	Surcharge Period	260	23-Jul-21	08-Apr-22	14-Jun-21	28-Feb-22	-39	0%						
08-1240	Remove Surcharge	146	19-Jan-22	13-Jun-22	11-Dec-21	05-May-22	-39	0%						
EP_SP_66_12-WP5A-M37.08.1.2.1.1 Instrumentation														
08-1330 (M23)	Placing Settlement Plates for Settlement Markers on Top of Sand Blanket (~18hrs)	30	31-Dec-20	29-Jan-21	30-Dec-20	28-Jan-21	-1	0%			31-Dec-20			29-Jan-21
08-1340 (M23)	Placing Settlement Plates for Settlement Markers & Instrumentation on +2.5mPD (~42hrs)	120	09-Mar-21	06-Jul-21	29-Jan-21	28-May-21	-39	0%						09-Mar-21
08-1350 (M23)	Extension of instruments above +2.5mPD	65	03-May-21	06-Jul-21	18-May-21	21-Jul-21	15	0%						
08-1370 (M23)	Extension of instruments to finished levels	42	25-Jul-21	04-Sep-21	22-Jul-21	01-Sep-21	-3	0%						

Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

■ Remaining Work ◆ Actual Milestone
■ Actual Work ◆ Critical Milestone
■ Critical Remaining Work
◆ Milestone

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Activity ID	Activity Name	Remaining Duration	Current Start	Current Finish	Late Start	Late Finish	Total Float	Activity % Complete	2020		2021		
									Dec	Jan	Feb	Mar	
									37	38	39	40	
08-1375 (M23)	Extension of instruments to surcharge top levels	65	07-Aug-21	10-Oct-21	07-Oct-21	10-Dec-21	61	0%					
08-1380 (M23)	Lower down the instruments to finished ground levels	60	30-Apr-22	28-Jun-22	10-Jun-22	08-Aug-22	41	0%					
EP_SP_66_12-WP5A-M37.08.1.2.1.2 PVD Remedial Works													
08-1390 (M34)	GI for ground condition varification at Zone D for PVD (2 nr approx @0.5 nr/day) Inc Report	14	08-Apr-21	21-Apr-21	28-Feb-21	13-Mar-21	-39	0%					
08-1390 (M34)15	Install Sand Drains at Zone D (approx. 62 nr @ 4nr/day/2 set of equipment)	16	22-Apr-21	07-May-21	14-Mar-21	29-Mar-21	-39	0%					
08-1390 (M34)20	GI for ground condition varification at other Zone for PVD (10 nr approx @0.5 nr/day) Inc Report	28	08-May-21	04-Jun-21	16-Jul-21	12-Aug-21	69	0%					
08-1390 (M34)25	Install Sand Drains at other Zones (approx. 549 nr @ 8nr/day/4 set of equipment)	90	05-Jun-21	02-Sep-21	13-Aug-21	10-Nov-21	69	0%					
08-1390 (M34)30	Lay Surcharge at remedial works area	30	03-Sep-21	02-Oct-21	11-Nov-21	10-Dec-21	69	0%					
08-1390 (M34)40	Surcharge Period at remedial area	180	03-Oct-21	31-Mar-22	11-Dec-21	08-Jun-22	69	0%					
08-1390 (M34)50	Remove Surcharge at remedial area	30	01-Apr-22	30-Apr-22	09-Jun-22	08-Jul-22	69	0%					
EP_SP_66_12-WP5A-M37.08.1.2.2 Breakwater													
08-1250	Geotextile and Sand Blanket Laying	2	31-Jan-19 A	02-Jan-21	28-Sep-22	30-Sep-22	637	95%			02-Jan-21	Geotextile and Sand Blanket Laying, Geotextile and Sand Blanket Laying, 02-Jan-21	
08-1280	Rubble Mound Laying (100,000m3 approx, @550m3/d)	4	06-Sep-20 A	03-Jan-21	12-Oct-22	15-Oct-22	650	98%			03-Jan-21	Rubble Mound Laying (100,000m3 approx, @550m3/d), Rubble Mound Laying (100,000m3 approx, @550m3/d)	
08-1285(1)	Prefabrication for Caission	158	19-Jun-20 A	07-Jun-21	20-May-22	25-Oct-22	506	12%					
EP_SP_66_12-WP5A-M37.15 Works By CLP													
EP_SP_66_12-WP5A-M37.15.1 Installation of Transmission System													
15-0800	450 days Prior to Commencement of System Commissioning Test	0	20-Apr-23		15-Mar-23		-36	0%					
15-0900	Completion of Civil Provision for Transmission	0		27-Nov-22		14-Mar-23	107	0%					
15-1000	Construction of Transmission System	90	28-Nov-22*	25-Feb-23	14-Nov-23	11-Feb-24	351	0%					
15-1002	Cable Testing	30	26-Feb-23	27-Mar-23	12-Feb-24	12-Mar-24	351	0%					
EP_SP_66_12-WP5A-M37.15.2 Remaining Installation Works by CLP													
15-1005	Plant Installation inside CLP Equipment Room	60	01-Oct-23*	29-Nov-23	13-Jan-24	12-Mar-24	104	0%					
15-1010	Cable Termination Works	30	30-Nov-23*	29-Dec-23	13-Mar-24	11-Apr-24	104	0%					
15-1015	Testing and Commissioning	60	30-Dec-23	27-Feb-24	12-Apr-24	10-Jun-24	104	0%					
EP_SP_66_12-WP5A-M37.15.3 Metering & Energization													
15-1020	Incoming Power System Final Inspection and Metering works	30	20-Jul-24	18-Aug-24	11-Jun-24	10-Jul-24	-39	0%					
15-1030	Energization of Incoming Power Supply Main System	0		18-Aug-24		10-Jul-24	-39	0%					
15-1040	Energization of Incoming Power Supply Sub System	0		18-Aug-24		10-Jul-24	-39	0%					
15-1050	Export Power System Final Inspection and Metering works	30	19-Aug-24	17-Sep-24	11-Jul-24	09-Aug-24	-39	0%					
15-1060	Connection to Grid	0		17-Sep-24		09-Aug-24	-39	0%					

Programme for Design and Construction Works
 December 2020 Update (Rev WP-5A-M37)

- Remaining Work
- Actual Work
- Critical Remaining Work
- ◆ Milestone
- ◆ Actual Milestone
- ◆ Critical Milestone

Date	Revision	Checked	Approved
04/12/17	Rev. 0 - 1st Issue		
31-Oct-20	Rev 5A - Oct 2020 Update		
30-Nov-20	Rev 5A - Nov 2020 Update		
31-Dec-20	Rev 5A - Dec 2020 Update		

Appendix B Summary of Implementation Status of Environmental Mitigation

Appendix B

Table B.1 Implementation Schedule for Air Quality Measures for the IWMF at the artificial island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S3b.8.1	<p><u>Air Pollution Control (Construction Dust) Regulation & Good Site Practices</u></p> <ul style="list-style-type: none"> • Use of regular watering, with complete coverage, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather. • Use of frequent watering for particularly dusty construction areas and areas close to ASRs. • Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions. Where this is not practicable owing to frequent usage, watering shall be applied to aggregate fines. • Open stockpiles shall be avoided or covered. Where possible, prevent placing dusty material storage piles near ASRs. • Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations. • Establishment and use of vehicle wheel and body washing facilities at the exit points of the site. • Provision of wind shield and dust extraction units or similar dust mitigation measures at the loading 	Work site / During the construction period	Contractor		✓			Air Pollution Control (Construction Dust) Regulation	Implemented, N/A for dust control measures for transportation outside site boundary.

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>points, and use of water sprinklers at the loading area where dust generation is likely during the loading process of loose material, particularly in dry seasons/ periods.</p> <ul style="list-style-type: none"> • Imposition of speed controls for vehicles on unpaved site roads. Ten kilometers per hour is the recommended limit. • Where possible, routing of vehicles and positioning of construction plant should be at the maximum possible distance from ASRs • Instigation of an environmental monitoring and auditing program to monitor the construction process in order to enforce controls and modify method of work if dusty conditions arise. 								
S3b.6.3	<p><u>Odour Removal by Deodorizers</u></p> <ul style="list-style-type: none"> • Deodorizers with 95% odour removal efficiency would be installed for the air ventilated from the mechanical treatment plant before discharge to the atmosphere 	<p>Waste reception halls, the waste storage area, the mechanical treatment plant / During design & operation phase</p>	IWMF Operator	✓		✓		EIAO-TM	N/A
S3b.8.2	<p><u>Air Pollution Control and Stack Monitoring</u></p>	<p>IWMF stack emissions / During</p>	IWMF Operator	✓		✓		EIAO-TM, Supporting Document for	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> • Air pollution control and stack monitoring system will be installed for the IWMF to ensure that the emissions from the IWMF stack will meet the proposed target emission limits. • Voluntary Enhancement Measures in Flue Gas Cleaning and Emission Monitoring: <ol style="list-style-type: none"> 1. Two-stage bag filter system with reagent recirculation; 2. In addition to SCR, provide SNCR for removal of NO_x; tighten emission limit for half-hourly and daily NO_x to 160 mg/m³ and 80 mg/m₃ respectively; 3. Well-mixed feed waste: to minimize the fluctuation of pollutant loading on the flue gas treatment system; 4. Two more AQMSs would be set up at South Lantau and Shek Kwu Chau respectively; 5. Limit levels will be set under the IWMF DBO contract to require that waste feed shall cease if any of the air pollutant has exceeded 95% of the emission concentration limit as stipulated in the Special Process license; and 6. Each incineration chamber shall be fitted with auxiliary burners to ensure complete burn out of the combustion gases. 	design & operation phase					Application for Variation of Environmental Permit (EP-429/2012)		

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
-	<p><u>Treated Fly Ash and Air Pollution Control Residues:</u></p> <ul style="list-style-type: none"> • During testing and commissioning, the Contractor shall sample and test every container of treated fly ash and air pollution control residues for conformance to the Incineration Residue Pollution Control Limits and leachability criteria shown in Table 2 of the Environmental Permit. If a test result confirms that any one of the samples does not conform to the limits and the criteria, the Contractor shall be required to sample and test every container of treated fly ash and air pollution control residues for conformance to the Incineration Residue Pollution Control Limits and leachability criteria for the next six months. • During the first six months of operation, if the requirements in (a) could be fully conformed with, the Contractor shall sample and test every shipload of treated fly ash and air pollution control residues for conformance to the Incineration Residue Pollution Control Limits and leachability criteria shown in Table 2 of the Environmental Permit. The Contractor shall take two samples from each shipload for testing and the Contractor shall not dispose of any of that shipload of treated fly ash and air 	IWMF stack emissions / During design & operation phase	IWMF Operator	✓		✓		Supporting Document for Application for Variation of Environmental Permit (EP-429/2012)	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>pollution control residues until the test results confirm that the two samples conform to the limits and the criteria. If a test result confirms that any one of the two samples does not conform to the limits and the criteria, the Contractor shall be required to sample and test every shipload of treated fly ash and air pollution control residues for conformance to the Incineration Residue Pollution Control Limits and leachability criteria for the next six months. The Contractor shall make due allowance in the Design and the Operation for the time to sample and test treated fly ash and air pollution control residues before disposal.</p> <ul style="list-style-type: none"> • Provided that there is no non-conformance to the Incineration Residue Pollution Control Limits and leachability criteria shown in Table 2 of the Environmental Permit throughout a continuous sixmonth period in the Operation Period, the testing frequency shall be reduced to monthly interval. Two samples from one shipload of treated fly ash and air pollution control residues shall be collected and tested for conformance to the Incineration Residue Pollution Control Limits and leachability criteria. The Contractor shall not dispose of any of the treated fly ash and air pollution 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	control residues in the shipload which the samples are taken until the test results confirm that the samples conform to the limits and the criteria. If the test result confirm that any one of the samples does not conform to the limits and the criteria, the Contractor shall be required to sample and test every shipload of treated fly ash and air pollution control residues for conformance to the Incineration Residue Pollution Control Limits and leachability criteria shown in Table 2 of the Environmental Permit for the next six months.								
-	<p><u>Bottom Ash:</u></p> <ul style="list-style-type: none"> During testing and commissioning, the Contractor shall sample and test every container of bottom ash for conformance to the leachability criteria shown in Table 2 of the Environmental Permit. If a test result confirms that any one of the samples does not conform to the criteria, the Contractor shall be required to sample and test every container of bottom ash for conformance to the leachability criteria for the next six months. During the first six months of operation, if the requirements in (d) could be fully conformed with, the Contractor shall sample and test one shipload of bottom ash each month for 	IWMF stack emissions / During design & operation phase	IWMF Operator	✓		✓		Supporting Document for Application for Variation of Environmental Permit (EP-429/2012)	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>conformance to the leachability criteria shown in Table 2 of the Environmental Permit. The Contractor shall take two samples from the shipload for testing and the Contractor shall not dispose of any of that shipload of bottom ash until the test results confirm that the two samples conform to the criteria. If a test result confirms that any one of the two samples does not conform to the criteria, the Contractor shall be required to sample and test each shipload of bottom ash for conformance to the leachability criteria for the next six months. The Contractor shall make due allowance in the Design and the Operation for the time to sample and test bottom ash before disposal.</p> <ul style="list-style-type: none"> • Provided that there is no non-conformance to the leachability criteria shown in Table 2 of the Environmental Permit throughout a continuous six month period in the Operation Period, the Contractor shall be allowed to take two samples from any one shipload of bottom ash once every six months for conformance to the leachability criteria. The Contractor shall not dispose of any of the bottom ash in the shipload which the samples are taken until the test 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	results confirm that the samples conform to the criteria. If the test result confirm that any one of the samples does not conform to the criteria, the Contractor shall be required to sample and test one shipload of bottom ash each month for conformance to the leachability criteria shown in Table 2 of the Environmental Permit for the next six months as stipulated above.								

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table B.2 Implementation Schedule for Noise Impact Measures for the IWMF at the artificial island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S4b.8	Good site practices to limit noise emissions at source and use of quiet plant and working methods, whenever practicable.	Work Sites / Construction Period	EPD and its contractors		✓			EIAO-TM	Implemented
S4b.6 & S4b.8	<p>All the ventilation fans installed in the below will be provided with silencers or acoustics treatment.</p> <p>(i) Stack of the incinerator (ii) Ventilation systems within the IWMF Enclosure and discharge silencer or other acoustic treatment equipment should be installed in the air-cooled chillers</p> <p>Other than provision of silencer or other acoustic treatment equipment for the stack of the incinerator and ventilation system, the detailed design should incorporate the following good practice in order to minimize the nuisance on the neighboring NSRs.</p> <p>(i) The exhaust of the ventilation system and any opening of the building should be located facing away from any NSRs; and (ii) Louver or other acoustic treatment equipment could also be applied to the exhaust of the ventilation system.</p>	Within IWMF area / Construction Period	EPD and its contractors	✓		✓		EIAO-TM	N/A

-	<u>Voluntary Enhancement Measure</u> <ul style="list-style-type: none"> Provision of air-conditioner and double glazed windows to nearby NSR at Shek Kwu Chau (i.e. SARDA) as precautionary measures. 	IWMF site	Design team, contractor, IWMF operator	✓	✓			Supporting Document for Application for Variation of Environmental Permit (EP-429/2012)	Implemented
---	--	-----------	--	---	---	--	--	---	-------------

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table B.3 Implementation Schedule for Water Quality Measures for the Artificial Island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S5b.8.1.1	<p><u>Drainage and Construction Site Runoff</u></p> <p>The site practices outlined in ProPECC PN 1/94 “Construction Site Drainage” should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. These practices include the following items:</p> <ul style="list-style-type: none"> At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented <p>Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct storm water to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction.</p> <ul style="list-style-type: none"> Boundaries of earthworks should be surrounded by dykes or embankments for flood protection, as necessary. Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM-DSS. The design of efficient silt removal facilities 	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/sand traps should be 5 minutes under maximum flow conditions. The detailed design of the sand/silt traps shall be undertaken by the contractor prior to the commencement of construction.</p> <ul style="list-style-type: none"> • Water pumped out from foundation piles must be discharged into silt removal facilities. • Measures should be taken to minimize the ingress of site runoff and drainage into excavations. Drainage water pumped out from excavations should be discharged into storm drains via silt removal facilities. • During rainstorms, exposed slope/soil surfaces should be covered by a tarpaulin or other means, as far as practicable. Other measures that need to be implemented before, during and after rainstorms are summarized in ProPECC PN 1/94. • Exposed soil areas should be minimized to reduce potential for increased siltation and contamination of runoff. • Earthwork final surfaces should be well compacted and subsequent permanent work or surface protection should be immediately performed. 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. 								
S5b.8.1.2	<p><u>General Construction Activities</u></p> <p>Construction solid waste should be collected, handled and disposed of properly to avoid entering to the nearby watercourses and public drainage system. Rubbish and litter from construction sites should also be collected to prevent spreading of rubbish and litter from the site area.</p> <p>It is recommended to clean the construction sites on a regular basis.</p>	Work site / During the construction period	Contractor		✓		EIAO-TM; ProPECC PN 1/94; WPCO	Deficiency of Mitigation Measures but rectified by the Contractor.	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S5b.8.1.3	There is a need to apply to EPD for a discharge license for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements specified in the discharge license. All the run-off and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the TM-DSS. The beneficial uses of the treated effluent for other on-site activities such as dust suppression and general cleaning etc., can minimize water consumption and reduce the effluent discharge volume. If monitoring of the treated effluent quality from the works areas is required during the construction phase of the Project, the monitoring should be carried out in accordance with the relevant WPCO license which is under the ambit of regional office of EPD.	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO	Discharge License was issued on 22/08/2019.
S5b.8.1.4	<u>Accidental Spillage</u> Contractor must register as a chemical waste producer if chemical wastes would be produced from construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO; WDO	Deficiency of Mitigation Measures but rectified by the Contractor.
S5b.8.1.5	Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas which	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO; WDO	Implemented.

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	appropriately equipped to control these discharges.								
S5b.8.1.6	Oils and fuels should only be used and stored in designated areas which have pollution prevention facilities. All fuel tanks and storage areas should be sited on sealed areas in order to prevent spillage of fuels and solvents to the nearby watercourses. All waste oils and fuels should be collected in designated tanks prior to disposal.	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO; WDO	Deficiency of Mitigation Measures but rectified by the Contractor.
S5b.8.1.7	Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows: <ul style="list-style-type: none"> • Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport. • Chemical waste containers should be suitably labelled, to notify and warn the personnel who are handling the wastes, to avoid accidents. • Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area. 	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO; WDO	Implemented.
S5b.8.1.8	<u>Sewage Effluent</u> Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to	Work site / During the construction period	Contractor		✓			EIAO-TM; ProPECC PN 1/94; WPCO	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	handle sewage from the workforce. A licensed contractor would be responsible for appropriate disposal and maintenance of these facilities.								
S5b.8.1.9	<p><u>Reclamation and Construction of Breakwaters</u></p> <ul style="list-style-type: none"> The proposed dredging and reclamation should be commenced in phases. The breakwaters and seawalls should be constructed and the reclamation should be started within the enclosed breakwaters after the completion of the breakwater. Silt curtain should be applied around caissons / blockwork during the filling of the cell to prevent the loss of fine in the filling material. The maximum production rate for dredging for the anti-scouring protection layer shall not exceed the permitted maximum daily dredging rate and carried out within its respective distance from the nearest non-translocatable coral community by the dredging contractor as specified in S.2.18 of the Further Environmental Permit (no.:FEP-01/429/2012/A). It is recommended to employ closed grab with small capacity of 2 m³ to control the dredging rate. Any gap that may need to be provided for marine access will be located at the middle of the North Western seawall, away from the identified coral communities and will be shielded by silt curtains systems to control sediment plume dispersion. The silt curtain system at marine access opening should be closed as soon as the 	Work site / During the marine construction period	Contractor		✓			EIAO-TM; WPCO, Supporting Document for Application for Variation of Environmental Permit (EP-429/2012) Further Environmental Permit No. FEP-01/429/2012/A	Implemented.

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>barges passes through the marine access opening in order to minimize the period of curtain opening. Filling should only be carried out behind the silt curtain when the silt curtain is completely closed.</p> <ul style="list-style-type: none"> • To enhance the effectiveness of the silt curtain at the marine access, the northern breakwater would be built before the commencement of the reclamation to reduce the current velocity towards the marine access opening. • The silt curtain system at marine access opening should be regularly checked and maintained to ensure proper functioning. • Where public fill is proposed for filling below +2.5mPD, the fine content in the public fill will be controlled to 25% which is in line with the CEDD's General Specification; • The filling for reclamation should be carried out behind the seawall. The filling material should only consist of public fill, rock and sand. The filling composition and filling rates at each filling area should follow those delineated in Table 1 of the FEP-01/429/2012/. The filling above high watermark is not restricted; • No dredging should be carried out within 16m to the nearest non-translocatable coral community; • Daily site audit including full-time on-site monitoring by the ET is recommended during the dredging for anti-scouring protection layer 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>for checking the compliance with the permitted no. of grab;</p> <ul style="list-style-type: none"> • Closed grab dredger should be used to minimize the loss of sediment during the raising of the loaded grabs through the water column; • Frame-type silt curtains should be deployed around the dredging operations; • Floating-type silt curtains should be used to surround the circular cell during the sheetpiling work; • The descent speed of grabs should be controlled to minimize the seabed impact speed; • Barges should be loaded carefully to avoid splashing of material; • All barges used for the transport of dredged materials should be fitted with tight bottom seals in order to prevent leakage of material during loading and transport; • No concurrence works between laying of submarine cables and dredging/reclamation works within the same location is allowed. For works close to each other, the construction program should be arranged so that the dredging/reclamation works within area bounded by the breakwaters and the laying of cables would not operate within a distance of 80m from each other to avoid any accumulative impact on the environment (in case if such tight schedule is necessary). 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> All barges should be filled to a level which ensures that material does not spill over during loading and transport to the disposal site and that adequate freeboard is maintained to ensure that the decks are not washed by wave action. No DCM works should be carried out within 100m to the nearest non-translocatable coral colony / colonies. Silt curtains should be employed to enclose DCM field trial and any full scale DCM work to minimize the potential impacts on water aspect. A sand blanket is to be placed on top of the marine deposit using tremie pipes prior to the DCM ground treatment to avoid seabed sediment disturbance. 								
S5b.8.2.3	<p><u>Operational Phase Discharges</u></p> <p>A pipeline drainage system will serve the development area collecting surface runoff from paved areas, roof, etc. Sustainable drainage principle would be adopted in the drainage system design to minimize peak surface runoff, maximize permeable surface and maximize beneficial use of rainwater.</p>	Within IWMF site / During the operational phase	IWMF Operator	✓		✓		WPCO	N/A
S5b.8.2.4	Oil interceptors should be provided in the drainage system of any potentially contaminated areas (such as truck parking area and maintenance workshop) and regularly cleaned to prevent the release of oil products into the storm water drainage system in case of accidental spillages.	Within IWMF site / During the operational phase	IWMF Operator	✓		✓		WPCO; WDO	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	Accidental spillage should be cleaned up as soon as practicable and all waste oils and fuels should be collected and handled in compliance with the Waste Disposal Ordinance.								
S5b.8.2.5	<u>Refuse Entrapment</u> Collection and removal of floating refuse should be performed at regular intervals for keeping the water within the Project site boundary and the neighboring water free from rubbish.	Within the Project site / During the operational phase	IWMF Operator			✓		WPCO	N/A
S5b.8.2.6	<u>Transportation of bottom ash, fly ash and APC residues to WENT Landfill for disposal</u> Covered container should be used in the shipping of the incineration waste to limit the contact between the incineration waste and the marine water. A comprehensive emergency response plan for any accidental spillage should be submitted by the operation contractor to the EPD for agreement before the operation of the facilities. Salvage and cleanup action to recover the spilled incineration waste containers following the spillage should be carried out according to the emergency response plan to mitigate the environmental impact in case of spillage.	Transportation of Incineration Ash / During the operational phase	IWMF Operator			✓			N/A

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table B.4 Implementation Schedule for Waste Management Measures for the IWMF at the artificial island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
6b.5.1.2	<p><u>Good Site Practices</u></p> <p>Adverse environmental impacts in relation to waste management are not expected, provided that good site practices are strictly followed. Recommendations for good site practices during the construction activities would include:</p> <ul style="list-style-type: none"> • Obtain relevant waste disposal permits from appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354) and subsidiary Regulations and the Land (Miscellaneous Provisions) Ordinance (Cap. 28); • Provide staff training for proper waste management and chemical handling procedures; • Provide sufficient waste disposal points and regular waste collection; • Provide appropriate measures to minimize windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; and • Carry out regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors; • Separate chemical wastes for special handling and disposed of to licensed facility for treatment; and • Employ licensed waste collector to collect waste. 	Work Site/ During Construction Period	Contractor		✓			WDO; LDO; ETWB TCW No. 19/2005; EIAO-TM	Deficiency of Mitigation Measures but rectified by the Contractor.
6b.5.1.3	<u>Waste Reduction Measures</u>	Work Site/ During Design	Contractor	✓	✓				Deficiency of Mitigation Measures

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>Good management and control can prevent the generation of a significant amount of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices.</p> <p>Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> • Design foundation works that could minimize the amount of excavated material to be generated. • Provide training to workers on the importance of site cleanliness and appropriate waste management procedures, including waste reduction, reuse and recycling; • Sort out demolition debris and excavated materials from demolition works to recover reusable/recyclable portions (i.e. soil, broken concrete, metal etc.); • Segregate and store different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; • Encourage the collection of aluminum cans by providing separate labelled bins to enable this waste to be segregated from other general refuse generated by the work force; • Proper storage and site practices to minimize the potential for damage or contamination of construction materials; and • Plan and stock construction materials carefully to minimize amount of waste to be 	& Construction Period						but rectified by the Contractor. N/A for foundation and demolition items	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	generated and to avoid unnecessary generation of waste.								
6b.5.1.7	<p><u>Dredged Sediment – Application of Dumping Permit</u></p> <p>The project proponent should agree in advance with MFC of CEDD on the site allocation. The project proponent or contractor for the dredging works shall then apply for the site allocations of marine sediment disposal based on the prior agreement with MFC/CEDD. The project proponent or contractor should also be responsible for the application of all necessary permits from relevant authorities, including the dumping permit as required under DASO from EPD, for the disposal of dredged sediment prior to the commencement of the dredging works.</p>	Seawall and Reclamation site / Construction Period	EPD and its contractor	✓	✓			DASO ETWB TCW 34/2002	Implemented
6b.5.1.8	<p><u>Dredged Sediment – Sediment Quality Report</u></p> <p>The project proponent or contractor will need to satisfy the appropriate authorities that the quality of the marine sediment to be dredged has been identified according to the requirements of ETWB TCW 34/2002. This should be completed well before the dredging works and would include at least the submission of a formal Sediment Quality Report under Tier I of ETWB TCW No. 34/2002 to DEP for approval. Subject to advice from DEP, it is possible that further marine SI in accordance with ETWB TCW 34/2002 might be necessary for the application of dumping permit under DASO. In such case, a sediment sampling and testing</p>	Seawall and Reclamation site / Construction Period	EPD and its contractor	✓				DASO ETWB TCW 34/2002	Implemented

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	proposal shall be submitted to and approved by DEP before the additional marine SI works.								
6b.5.1.9	<p><u>Dredged Sediment – Sediment Transportation</u></p> <p>The barge transporting the sediments to the designated disposal sites should be equipped with tight fitting seals to prevent leakage and should not be filled to a level that would cause overflow of materials or laden water during loading or transportation. In addition, monitoring of the barge loading shall be conducted to ensure that loss of material does not take place during transportation. Transport barges or vessels shall be equipped with automatic self-monitoring devices as specified by the DEP.</p>	Seawall and Reclamation site / Construction Period	EPD and its contractor		✓			DASO ETWB TCW 34/2002	Implemented
6b.5.1.10	<p><u>Construction and Demolition Materials</u></p> <p>In order to minimize the impact resulting from collection and transportation of C&D materials for off-site disposal, the excavated material arising from site formation and foundation works should be reused on-site as backfilling material and for landscaping works as far as practicable. Other mitigation requirements are listed below:</p> <ul style="list-style-type: none"> • A Waste Management Plan (WMP), which becomes part of the Environmental Management Plan (EMP), should be prepared in accordance with ETWB TCW No.19/2005; • A recording system for the amount of wastes generated, recycled and disposed 	Work Site/ During Design & Construction Period	Contractor	✓	✓			ETWB TCW No. 19/2005	Implemented

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>(including the disposal sites) should be adopted for easy tracking; and</p> <ul style="list-style-type: none"> In order to monitor the disposal of C&D materials at public filling facilities and landfills and to control fly-tipping, a trip-ticket system should be adopted (refer to <i>ETWB TCW No. 31/2004</i>). 								
6b.5.1.11 – 6b.5.1.12	<p>The Contactor should prepare and implement an EMP in accordance with ETWB TCW No.19/2005, which describes the arrangements for avoidance, reuse, recovery, recycling, storage, collection, treatment and disposal of different categories of waste to be generated from construction activities. Such a management plan should incorporate site specific factors, such as the designation of areas for segregation and temporary storage of reusable and recyclable materials. The EMP should be submitted to the Engineer for approval. The Contractor should implement waste management practices in the EMP throughout the construction stage of the Project. The EMP should be reviewed regularly and updated by the Contractor, preferably on a monthly basis.</p> <p>All surplus C&D materials arising from or in connection with construction works should become the property of the Contractor when it is removed unless otherwise stated. The Contractor would be responsible for devising a system to work for on-site sorting of C&D materials and promptly removing all sorted and process materials arising from the</p>	Work Site/ During Design & Construction Period	Contractor	✓	✓			ETWB TCW No. 19/2005	Implemented

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	construction activities to minimize temporary stockpiling on-site. The system should be included in the EMP identifying the source of generation, estimated quantity, arrangement for on-site sorting, collection, temporary storage areas and frequency of collection by recycling Contractors or frequency of removal off-site.								
6b.5.1.13	<p><u>Chemical Wastes</u></p> <p>Should chemical wastes be produced at the construction site, the Contractor would be required to register with EPD as a Chemical Waste Producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately.</p> <p>Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste (such as explosive, flammable, oxidizing, irritant, toxic, harmful, or corrosive). The Contractor should employ a licensed collector to transport and dispose of the chemical wastes, to either the Chemical Waste Treatment Centre at Tsing Yi, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</p>	Work Site/ During Construction Period	Contractor		✓			Waste Disposal (Chemical Waste) (General) Regulation	Implemented.

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
6b.5.1.14	<p><u>General Refuse</u></p> <p>General refuse should be stored in enclosed bins or compaction units separate from C&D materials. A licensed waste collector should be employed by the Contractor to remove general refuse from the site, separately from C&D materials. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' light material.</p>	Work Site/ During Construction Period	Contractor		✓			Public Health and Municipal Services Ordinance	Deficiency of Mitigation Measures but rectified by the Contractor.
6b.5.1.16 – 6b.5.1.33	<p><u>Biogas Generation</u></p> <p>The Contractor shall review the data and analysis results, and the data from further Site Investigation, if any. Subject to the review findings, the following gas protection measures may be considered if necessary:</p> <ul style="list-style-type: none"> - gas monitoring after reclamation; - passive ventilation; - gas impermeable membrane; - ventilation with "at risk" rooms; - protection of utilities or below ground services; - precautions during construction works; - precautions prior to entry of belowground services 	Reclamation site (if dredging at the reclamation site is not required) / Design & Construction Period	Designer and/or contractor	✓	✓			EPD/TR8/97	N/A
6b.5.2.1	<p><u>Good Site Practices</u></p>	IWMF Site/During	IWMF Operator			✓		Waste Disposal Ordinance (Cap.354);	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>It is recommended that the following good operational practices should be adopted to minimise waste management impacts:</p> <ul style="list-style-type: none"> • Obtain the necessary waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354) and Waste Disposal (Chemical Waste) (General) Regulation; • Nomination of an approved person to be responsible for good site practice, arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site; • Use of a waste haulier licensed to collect specific category of waste; • A trip-ticket system should be included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of solid wastes at landfills, and to control fly tipping. Reference should be made to ETWB TCW No. 31/2004. • Training of site personnel in proper waste management and chemical waste handling procedures; • Separation of chemical wastes for special handling and appropriate treatment at a licensed facility; • Routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors; 	Operation Period					Waste Disposal (Chemical Waste) (General) Regulation; ETWB TCW No. 1/2004		

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> Provision of sufficient waste disposal points and regular collection for disposal; Adoption of appropriate measures to minimize windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers; and Implementation of a recording system for the amount of wastes generated, and disposed of (including recycled the disposal sites). 								
6b.5.2.2	<p><u>Waste Reduction Measures</u></p> <p>Good management and control can prevent the generation of significant amounts of waste. It is recommended that the following good operational practices should be adopted to ensure waste reduction:</p> <ul style="list-style-type: none"> Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; Encourage collection of aluminum cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separate labelled bins should be provided to help segregate this waste from other general refuse generated by the work force; and Any unused chemicals or those with remaining functional capacity should be reused as far as practicable. 	IWMF Site/ During Operation Period	IWMF Operator			✓		Implemented	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
6b.5.2.3	<p><u>Storage, Handling, Treatment, Collection and Disposal of Incineration By-Products</u></p> <p>The following measures are recommended for the storage, handling and collection of the incineration by-products:</p> <ul style="list-style-type: none"> Ash should be stored in storage silos; Ash should be handled and conveyed in closed systems fully segregated from the ambient environment; Ash should be wetted with water to control fugitive dust, where necessary; All fly ash and APC residues should be treated, e.g. by cement solidification or chemical stabilization, for compliance with the proposed Incineration Residue Pollution Control Limits and leachability criteria prior to disposal; The ash should be transported in covered trucks or containers to the designated landfill site. <p>The Contractor should provide EPD with chemical analysis results of the bottom ash, and treated fly ash and APC residues to confirm that the ash/residue can comply with the proposed Incineration Residue Pollution Control Limits before disposal.</p>	IWMF Site/ During Operation Period	IWMF Operator			✓		Incineration Residue Pollution Control Limits	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
6b.6.3.1	<p><u>Fuel Oil Tank Construction and Test</u></p> <ul style="list-style-type: none"> The fuel tank to be installed should be of specified durability. Double skin tanks are preferred. Underground fuel storage tank should be placed within a concrete pit. The concrete pit shall be accessible to allow regular tank integrity tests to be carried out at regular intervals. Tank integrity tests should be conducted by an independent qualified surveyor or structural engineer. Any potential problems identified in the test should be rectified as soon as possible. 	Fuel Oil Storage Tank/ During Design, Construction and Operation Periods	IWMF Contractor	✓	✓	✓		N/A	
6b.6.3.1	<p><u>Fuel Oil Pipeline Construction and Test</u></p> <ul style="list-style-type: none"> Installation of aboveground fuel oil pipelines is preferable; if underground pipelines are unavoidable, concrete lined trenches should be constructed to contain the pipelines. Double skin pipelines are preferred. Distance between the fuel oil refuelling points and the fuel oil storage tank shall be minimized. 	Fuel Oil Pipelines/ During Design, Construction and Operation Periods	IWMF Contractor	✓	✓	✓		N/A	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> Integrity tests for the pipelines should be conducted by an independent qualified surveyor or structural engineer at regular intervals. Any potential problems identified in the test should be rectified as soon as possible. 								
6b.6.3.1	<p><u>Fuel Oil Leakage Detection</u></p> <ul style="list-style-type: none"> Installation of leak detection device at storage tank and pipelines. Installation and use of pressure gauges (e.g. at the two ends of a filling line) in fuel filling, which allows unexpected pressure drop or difference and sign of leakage to be detected. 	Fuel Oil Storage Tank and Pipelines/ During Design, Construction and Operation Periods	IWMF Contractor	✓	✓	✓		N/A	
6b.6.3.1	<p><u>Fuel Oil Storage Tank Refuelling</u></p> <ul style="list-style-type: none"> Storage tank refuelling (from road tanker) should only be conducted by authorized staff of the oil company using the company's standard procedures. 	Fuel Oil Refuelling Point/ During Operation Period	IWMF Operator			✓		N/A	
6b.6.3.1	<p><u>Fuel Oil Spillage Response</u></p> <p>An Oil Spill Response Plan should be prepared by the operator to document the appropriate response procedures for oil spillage incidents in detail. General procedures to be taken in case of fuel oil spillage are presented below.</p> <ul style="list-style-type: none"> Training 	IWMF Site/ During Operation Period	IWMF Operator			✓		N/A	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>- Training on oil spill response actions should be given to relevant staff. The training shall cover the followings:</p> <ul style="list-style-type: none"> ➤Tools & resources to combat oil spillage and fire, e.g. locations of oil spill handling equipment and fire fighting equipment; ➤General methods to deal with oil spillage and fire incidents; ➤Procedures for emergency drills in the event of oil spills and fire; and ➤Regular drills shall be carried out. <ul style="list-style-type: none"> • Communication <ul style="list-style-type: none"> -Establish communication channel with the Fire Services Department (FSD) and EPD to report any oil spillage incident so that necessary assistance from relevant department can be quickly sought. • Response Procedures <ul style="list-style-type: none"> -Any fuel oil spillage within the IWMF site should be immediately reported to the Plant Manager with necessary details including location, source, possible cause and extent of the spillage. -Plant Manager should immediately attend to the spillage and initiate any appropriate action to confine and clean up the spillage. The response 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>procedures shall include the following:</p> <ul style="list-style-type: none"> ➤ Identify and isolate the source of spillage as soon as possible. ➤ Contain the oil spillage and avoid infiltration into soil/ groundwater and discharge to storm water channels. ➤ Remove the oil spillage. ➤ Clean up the contaminated area. ➤ If the oil spillage occurs during storage tank refuelling, the refueling operation should immediately be stopped. ➤ Recovered contaminated fuel oil and the associated material to remove the spilled oil should be considered as chemical waste. The handling and disposal procedures for chemical wastes are discussed in the following paragraphs. 								
6b.6.3.2	<p><u>Chemicals and Chemical Wastes Handling & Storage</u></p> <ul style="list-style-type: none"> • Chemicals and chemical wastes should only be stored in suitable containers in purpose-built areas. • The storage of chemical wastes should comply with the requirements of the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. • The storage areas for chemicals and chemical wastes shall have an 	Chemicals and Chemical Wastes Storage Area / During Operation Period	IWMF Operator			✓		N/A	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>impermeable floor or surface. The impermeable floor/ surface shall possess the following properties:</p> <ul style="list-style-type: none"> - Not liable to chemically react with the materials and their containers to be stored. - Able to withstand normal loading and physical damage caused by container handling - The integrity and condition of the impermeable floor or surface should be inspected at regular intervals to ensure that it is satisfactorily maintained ➤ For liquid chemicals and chemical wastes storage, the storage area should be banded to contain at least 110% of the storage capacity of the largest containers or 20% of the total quantity of the chemicals/chemical wastes stored, whichever is the greater. ➤ Storage containers shall be checked at regular intervals for their structural integrity and to ensure that the caps or fill points are tightly closed. ➤ Chemical handling shall be conducted by trained workers under supervision. 								
6b.6.3.2	<u>Chemicals and Chemical Wastes Spillage Response</u>	IWMF Site/ During	IWMF Operator			✓			N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>A Chemicals and/ or Chemical Wastes Spillage Response Plan shall be prepared by the operator to document in detail the appropriate response procedures for chemicals or chemical wastes spillage incidents. General procedures to be undertaken in case of chemicals/ chemical waste spillages are presented below.</p> <ul style="list-style-type: none"> • Training <ul style="list-style-type: none"> - Training on spill response actions should be given to relevant staff. The training shall cover the followings: <ul style="list-style-type: none"> ➢ Tools & resources to handle spillage, e.g. locations of spill handling equipment; ➢ General methods to deal with spillage; and ➢ Procedures for emergency drills in the event of spills. • Communication <ul style="list-style-type: none"> - Establish communication channel with FSD and EPD to report the spillage incident so that necessary assistance from relevant department can be quickly sought. • Response Procedures 	Operation Period							

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> - Any spillage within the IWMF site should be reported to the Plant Manager. - Plant Manager shall attend to the spillage and initiate any appropriate actions needed to confine and clean up the spillage. The response procedures shall include the followings: <ul style="list-style-type: none"> ➢ Identify and isolate the source of spillage as soon as possible; ➢ Contain the spillage and avoid infiltration into soil/ groundwater and discharge to storm water channels (in case the spillage occurs at locations out of the designated storage areas); ➢ Remove the spillage; the removal method/ procedures documented in the Material Safety Data Sheet (MSDS) of the chemicals spilled should be observed; ➢ Clean up the contaminated area (in case the spillage occurs at locations out of the designated storage areas); and 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> ➤ The waste arising from the cleanup operation should be considered as chemical wastes. 								
6b.6.3.3	<p><u>Preventive Measures for Incineration By-products Handling</u></p> <p>The recommended measures listed below can minimize the potential contamination to the surrounding environment due to the incineration by-products:</p> <ul style="list-style-type: none"> Ash should be stored in storage silos; Ash should be handled and conveyed in closed systems fully segregated from the ambient environment; Ash should be wetted with water to control fugitive dust, where necessary; All fly ash and APC residues should be treated, e.g. by cement solidification or chemical stabilization, for compliance with the proposed Incineration Residue Pollution Control Limits and leachability criteria prior to disposal; The ash should be transported in covered trucks or containers to the designated landfill site. 	Storage, Handling & Collection of Incineration Ash at IWMF/ During Operation Period	IWMF Operator			✓			N/A
6b.6.3.4 - 6b.6.3.6	<u>Incident Record</u>	IWMF Site/ During	IWMF Operator			✓		Guidance Manual for Use of Risk-based Remediation	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>After any spillage, an incident report should be prepared by the Plant Manager. The incident report should contain details of the incident including the cause of the incident, the material spilled and estimated spillage amount, and also the response actions undertaken. The incident record should be kept carefully and able to be retrieved when necessary.</p> <p>The incident report should provide sufficient details for the evaluation of any environmental impacts due to the spillage and assessment of the effectiveness of measures taken.</p> <p>In case any spillage or accidents results in significant land contamination, EPD should be informed immediately and the IWMF operator should be responsible for the cleanup of the affected area. The responses procedures described in Section 6b.6.3.1 and Section 6b.6.3.2 of EIA report should be followed accordingly together with the land contamination assessment and remediation guidelines stipulated in the <i>Guidance Manual for Use of Risk-based Remediation Goals for Contaminated Land Management and the Guidance Note for Contaminated Land and Remediation</i>.</p>	Operation Period					Goals for Contaminated Land Management and the Guidance Note for Contaminated Land and Remediation.		

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table B.5 Implementation Schedule for Ecological Quality Measures for the IWMF at the artificial island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
7b.8.2.1	<p><u>Measures to avoid direct loss of intertidal habitat</u></p> <ul style="list-style-type: none"> The site boundary has been proposed to avoid direct contact with the intertidal natural rocky shore of Shek Kwu Chau. It avoids direct loss of intertidal communities and the existing natural rocky shore habitat, where Reef Egret and White-bellied Sea Eagle have been recorded within and in the vicinity of this habitat. 	IWMF site	Design team	✓				EIAO-TM	N/A
7b.8.2.2	<p><u>Measures to minimise loss of coastal subtidal habitat</u></p> <ul style="list-style-type: none"> Extensive coral colonies were recorded at the coastal hard bottom habitat at Shek Kwu Chau. To avoid and minimise the extensive direct impact on the coral colonies, the proposed reclamation area has been moved further offshore to minimise loss of subtidal habitat near shore. 	IWMF site	Design team	✓				EIAO-TM	N/A
7b.8.2.3	<p><u>Zero Discharge Scheme</u></p> <ul style="list-style-type: none"> The design scheme of the Project has avoided discharge of wastewater into the marine environment. <p>A zero discharge scheme would be adopted during the operation of the Project. An on-site wastewater treatment plant would be provided to treat the wastewater generated from the IWMF (mainly human sewage). The treated effluent would be re-used in the incineration</p>	IWMF site	Design team, IWMF operator	✓		✓		WPCO	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	plant and mechanical treatment plant, or for onsite washdown and landscape.								
7b.8.2.4	<p><u>Measures to avoid loss of plant species of conservation importance</u></p> <ul style="list-style-type: none"> Landing portal construction works would not cause direct loss to the recorded individual of protected plant species, <i>Aquilaria sinensis</i>, at the coastal shrubland habitat at Cheung Sha. As a precautionary measure, the plant should be tagged with eye-catching tape and fenced off prior to works, in order to avoid any damage by workers. 	Cheung Sha landing portal	Design team, Contractor	✓	✓		✓	EIAO-TM	N/A
7b.8.3.1-7b.8.3.15	<p><u>Measures to minimise water quality impact</u></p> <ul style="list-style-type: none"> Measures for water quality as recommended in Section 5b of the EIA Report should be implemented. 	Work site	Design team, contractor, IWMF operator	✓	✓	✓	✓	EIAO-TM; ProPECC PN 1/94; WPCO	Implemented
7b.8.3.16 - 7b.8.3.30	<p><u>Measures to minimise disturbance on Finless Porpoise</u></p> <p><i>Minimisation of Habitat Loss for Finless Porpoise</i></p> <ul style="list-style-type: none"> Substantial revision has been made on the layout plan and form of the breakwater, in order to minimise the potential loss of important habitat for Finless Porpoise. The revision has greatly reduced the size of the embayment area, as well as the Project footprint. As a result, the size of habitat loss for Finless Porpoise has 	IWMF site, work site, marine traffic route	Design team, contractor, IWMF operator	✓	✓	✓	✓	EIAO-TM, Supporting Document for Application for Variation of the Environmental Permit (EP-429/2012)	Implemented for avoidance of construction works that may produce underwater acoustic disturbance, Vessel Travel Route implementation, training of staff, MMEZ and marine mammal watching works during deployment of silt curtain; N/A for others

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>reduced from the original ~50 ha, down to ~31 ha.</p> <p><i>Avoidance of peak season for finless porpoise occurrence</i></p> <ul style="list-style-type: none"> • To minimise potential acoustic disturbance from construction activities on Finless Porpoise, construction works that may produce underwater acoustic disturbance should be scheduled outside the months with peak Finless Porpoise occurrence (December to May), including: <ul style="list-style-type: none"> - sheet piling works for construction of cofferdam surrounding the reclamation area (Phase 1); - sheet piling works for construction of the shorter section of breakwater (Phase 1); - sheet piling works for construction of the remaining section of breakwater (Phase 3); - bored piling works for berth area (Phase 3); and - submarine cable installation works between Shek Kwu Chau and Cheung Sha. <p>Such works should be restricted within June to November. This approach would not only avoid the peak season for Finless Porpoise occurrence, the magnitude of impacts arise</p>								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>from acoustic disturbance would also be minimised.</p> <ul style="list-style-type: none"> Submarine cable installation works are also recommended to be scheduled within June to November, when sightings of Finless Porpoise is scarce in the area of the proposed alignment of the submarine cable. Since the DCM ground treatment and the installation of precast seawalls and breakwaters should generate no underwater acoustic disturbance to Finless Porpoise, no specific mitigation measures are required. <p><i>Opt for quieter construction methods and plants</i></p> <ul style="list-style-type: none"> Considering the sensitivity of marine mammals to underwater acoustic disturbance, instead of the previously proposed conventional breakwater and reclamation peripheral structure, which requires noisy piling works, the current circular cells structure for breakwater and reclamation peripheral structure is proposed. A quieter sheet piling method using vibratory hammer or hydraulic impact hammer, should be adopted for the installation of circular cells for cellular cofferdam and northern breakwater during 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>Phase 1, and southern breakwater Phase 3;</p> <ul style="list-style-type: none"> Non-percussive bore piling method would be adopted for the installation of tubular piles for the berth construction during Phase 3. <p><i>Monitored exclusion zones</i></p> <ul style="list-style-type: none"> During the installation/re-installation/relocation process of floating type silt curtains, in order to avoid the accidental entrance and entrapment of marine mammals within the silt curtains, a monitored exclusion zone of 250 m radius from silt curtain should be implemented. The exclusion zone should be closely monitored by an experienced marine mammal observer at least 30 minutes before the start of installation/re-installation/relocation process. If a marine mammal is noted within the exclusion zone, all marine works should stop immediately and remain idle for 30 minutes, or until the exclusion zone is free from marine mammals. The experienced marine mammal observer should be well trained to detect marine mammals. Binoculars should be used to search the exclusion zone from an elevated platform with unobstructed visibility. The observer should also be independent 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>from the project proponent and has the power to call-off construction activities.</p> <ul style="list-style-type: none"> In addition, as marine mammals cannot be effectively monitored within the proposed monitored exclusion zone at night, or during adverse weather conditions (i.e. Beaufort 5 or above, visibility of 300 meters or below), marine works should be avoided under weather conditions with low visibility. <p><i>Marine mammal watching plan</i></p> <ul style="list-style-type: none"> Upon the completion of the installation/re-installation/relocation of floating type silt curtain, all marine works would be conducted within a fully enclosed environment within the silt curtain, hence exclusion zone monitoring would no longer be required. Subsequently, a marine mammal watching plan should be implemented. <p>The plan should include regular inspection of silt curtains, and visual inspection of the waters surrounded by the curtains. Special attention should be paid to Phase 2 (reclamation) where the floating type still curtain would be opened occasionally for vessel access, leaving a temporary 50 m opening. An action plan should be devised to cope with any unpredicted incidents such as the case when</p>								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>marine mammals are found within the waters surrounded by the silt curtains.</p> <p><i>Small openings at silt curtains</i></p> <ul style="list-style-type: none"> The openings for vessel access at the silt curtains should be as small as possible to minimise the risk of accidental entrance. <p><i>Adoption of regular travel route</i></p> <ul style="list-style-type: none"> During construction and operation, captains of all vessels should adopt regular travel route, in order to minimize the chance of vessel collision with marine mammals, which may otherwise result in damage to health or mortality. The regular travel route should avoid areas with high sighting density of Finless Porpoise as much as possible. <p><i>Vessel speed limit</i></p> <ul style="list-style-type: none"> The frequent vessel traffic in the vicinity of works area may increase the chance of mammal mammals being killed or seriously injured by vessel collision. A speed limit of ten knots should be strictly enforced within areas with high density of Finless Porpoise. Passive acoustic monitoring and land-based theodolite monitoring surveys should be 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>adopted to verify the predicted impacts and effectiveness of the proposed mitigation measures.</p> <p><i>Training of Staff</i></p> <ul style="list-style-type: none"> Staff, including captains of vessels, should be aware of the guidelines for safe vessel operations in the presence of cetaceans during construction and operation phases. Adequate trainings should be provided 								
7b.8.3.31 - 7b.8.3.34	<p><u>Measures to minimise impact on corals</u></p> <p><i>Coral translocation</i></p> <ul style="list-style-type: none"> Coral communities within and in proximity to the proposed dredging sites would be disturbed by the Project due to the dredging operations. In order to minimise direct loss of coral communities, translocation of corals that are attached to movable rocks with diameter less than 50 cm are recommended. In order to avoid disturbance to corals during the spawning period, the spawning season of corals (June to August) should be avoided; and that translocation should be carried out during the winter season (November-March). 	IWMF site	Design team, contractor, IWMF operator	✓	✓	✓	✓	EIAO-TM	<p>Implemented, tagged coral found missing after hitting by typhoons</p> <p>Re-tagging of 10 coral colonies at indirect impact site and control site were conducted in November and December 2018 respectively.</p>

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> The REA survey results suggest that the 198 directly affected coral colonies were attached to movable rocks (less than 50 cm in diameter). It is technically feasible to translocate them to avoid direct loss. Prior to coral translocation, a more detailed baseline survey, including a coral mapping survey, is recommended to further confirm the exact number and location of coral colonies within the potentially affected area. A more detailed coral translocation plan, including selection of suitable recipient site, plan for coral translocation, and event / action plan for coral monitoring should be submitted upon approval of this Project, prior to commencement of construction works. Advice from relevant governmental departments (i.e. AFCD) and professionals would be sought after, in order to identify a desirable location for the relocation of coral communities. Post-translocation monitoring on the translocated corals should also be considered. <p><i>Coral monitoring programme</i></p> <ul style="list-style-type: none"> A coral monitoring programme is recommended to assess any adverse and unacceptable impacts to the coral 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>communities at the coasts of Shek Kwu Chau during construction of the Project.</p> <p><i>Phasing of Works</i></p> <ul style="list-style-type: none"> To minimize environmental impacts, the proposed phasing of construction works has been carefully designed to reduce the amount of concurrent works, hence minimize SS elevation and the associated impacts on corals. 								
7b.8.3.35 - 7b.8.3.41	<p><u>Specific measures to minimize disturbance on breeding White-bellied Sea Eagle</u></p> <p><i>Avoidance of noisy works during the breeding season of White-bellied Sea Eagle</i></p> <ul style="list-style-type: none"> To minimize potential noise disturbance from construction activities on WBSE, noisy construction works should be scheduled outside their breeding season (December to May) to minimise potential degradation in breeding ground quality and breeding activities, including: <ul style="list-style-type: none"> sheet piling works for construction of cofferdam surrounding the reclamation area (Phase 1); sheet piling works for construction of the shorter section of breakwater (Phase 1); 	IWMF site, marine traffic route	Design Team, Contractor, IWMF operator	✓	✓	✓	✓	EIAO-TM	Implemented

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> - sheet piling works for construction of the remaining section of breakwater (Phase 3); and - bored piling works for berth area (Phase 3). <p><i>Opt for quieter construction methods and plants</i></p> <ul style="list-style-type: none"> • To minimise potential construction noise disturbance on WBSE, quieter construction methods and plants should be adopted. The recommended noise mitigation measures in the Noise chapter (Section 4b.8 of the EIA Report) should be implemented to minimise potential noise disturbance to acceptable levels. <p><i>Restriction on vessel access near the nest of White-bellied Sea Eagle</i></p> <ul style="list-style-type: none"> • During construction and operation, in order to minimize disturbance on the existing WBSE nest, a pre-defined practical route to restrict vessel access near the nest should be adopted to keep vessels and boats as far away from the nest as possible. <p><i>White-bellied Sea Eagle monitoring programme</i></p> <ul style="list-style-type: none"> • A WBSE monitoring programme is recommended to assess any adverse and unacceptable impacts to the breeding 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>activities of WBSE during construction and operation of the Project. Monitoring surveys for WBSE would include pre-construction phase (twice per month for duration of three months during their breeding season -between December and May, immediately before the commencement of works), construction phase, and operation phase (two years after the completion of construction works).</p> <ul style="list-style-type: none"> Surveys should be conducted twice per month during their breeding season (from December to May); and once per month outside breeding season (June to November). More details on monitoring for WBSE are presented in the EM&A Manual. <p><i>Education of staff</i></p> <ul style="list-style-type: none"> Staff, including captains of all vessels during construction and operation phases, should be aware of the ecological importance of WBSE. Awareness should be raised among staff to minimise any intentional or unintentional disturbance to the nest. <p><i>Minimisation of Glare Disturbance</i></p> <ul style="list-style-type: none"> To minimise glare disturbance on WBSE, which may cause disorientation of birds 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	by interfering with their magnetic compass, and disruption in behavioural patterns such as reproduction, fat storage and foraging pattern, any un-necessary outdoor lighting should be avoided, and in-ward and downward pointing of lights should be adopted.								
-	<u>Construction of Seawall/Breakwaters</u> <ul style="list-style-type: none"> To widen the open channel between the Artificial Island and Shek Kwu Chau. To design the precast concrete seawall with environmental friendly features. 	IWMF site	Design team, contractor, IWMF operator	✓	✓			Supporting Document for Application for Variation of Environmental Permit (EP-429/2012)	N/A
7b.8.3.42	<u>Opt for Quieter Construction Methods and Plants</u> <ul style="list-style-type: none"> Quieter construction methods and plants should be used to minimise disturbance to the nearby terrestrial habitat and the associated wildlife. 	Work site	Design team, contractor, IWMF operator	✓	✓	✓	✓	EIAO-TM	Implemented
7b.8.3.43	<u>Measures to minimize impacts from artificial lighting</u> <ul style="list-style-type: none"> Unnecessary lighting should be avoided, and shielding of lights should be provided to minimize disturbance from light pollution on fauna groups. 	IWMF site	Design team, contractor, IWMF operator	✓	✓	✓		EIAO-TM	Implemented
7b.8.3.44 - 7b.8.3.45	<u>Measures to minimize accidental spillage</u> <ul style="list-style-type: none"> Regular maintenance of vessels, vehicles and equipment that may cause leakage and spillage should only be undertaken within 	Work site	Contractor, IWMF operator		✓	✓	✓	EIAO-TM	Deficiency of Mitigation Measures but rectified by the Contractor.

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>pre-designated areas, which are appropriately equipped to control the associated discharges.</p> <ul style="list-style-type: none"> Oils, fuels and chemicals should be contained in suitable containers, and only be used and stored in designated areas which have pollution prevention facilities. All fuel tanks and storage areas should be sited on sealed areas in order to prevent spillage of fuels and solvents to the nearby watercourses. All waste oils and fuels should be collected in designated tanks prior to disposal. 								
7b.8.3.46	<p><u>Measures to minimise sewage effluent</u></p> <ul style="list-style-type: none"> Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. 	Work site	Contractor		✓			EIAO-TM	N/A
7b.8.3.47	<p><u>Measures to minimise drainage and construction runoff</u></p> <ul style="list-style-type: none"> Potential ecological impacts resulted from potential degradation of water quality due to unmitigated surface runoff could be minimised via the detailed mitigation measures in Section 5b.8 of the EIA Report. The following presents some of the mitigation measures: 	Work site	Contractor		✓		✓	EIAO-TM	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> - On-site drainage system with implemented sedimentation control facilities. - Channels, earth bunds or sand bag barriers should be provided on site to direct storm water to silt removal facilities. - Provision of embankment at boundaries of earthworks for flood protection. - Water pumped out from foundation piles must be discharged into silt removal facilities. - During rainstorms, exposed slope/soil surfaces should be covered by tarpaulin or other means, as far as practicable. - Exposed soil surface should be minimized to reduce siltation and runoff. - Earthwork final surfaces should be well compacted. Subsequent permanent surface protection should be immediately performed. - Open stockpiles of construction materials, and construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. 								
7b.8.3.48	<p><u>Measures to minimise impacts from general construction activities</u></p> <ul style="list-style-type: none"> • To avoid the entering of construction solid waste into the nearby habitats, construction solid waste should be collected, handled 	Work site	Contractor		✓			EIAO-TM	Implemented

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	and disposed of properly to avoid entering to the nearby habitats. It is recommended to clean the construction sites on a regular basis.								
7b.8.3.49	<p><u>Pest Control</u> Good waste management practices should be adopted at the IWMF in order to minimise the risk of introduction of pest to the island:</p> <ul style="list-style-type: none"> - Transportation of wastes in enclosed containers - Waste storage area should be well maintained and cleaned - Waste should only be disposed of at designated areas - Timely removal of the newly arrived waste - Removal of items that are capable of retaining water - Rapid clean up of any waste spillages - Maintenance of a tidy and clean site environment - Regular application of pest control - Education of staff the importance of site cleanliness 	IWMF site	IWMF operator			✓			N/A
7b.8.3.50	<p><u>Control of Marine Habitat Quality during Operation Phase</u></p> <ul style="list-style-type: none"> • Depending on the seabed condition of the approach channel for marine vessels during operation phase of the IWMF, maintenance dredging may be required to 	IWMF site	IWMF operator			✓		EIAO-TM; WPCO	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>ensure safe access. In order to avoid degradation in water quality due to elevation in SS and dispersion of sediment plume due to dredging works, it is recommended that any future maintenance dredging works should not be carried out within 100 m from the shore, similar to that of the dredging for anti-scouring protection layer during construction phase.</p> <p>All maintenance dredging works should be carried out with the implementation of silt curtain to control the dispersion of SS. The production rate should comply with the permit dredging rate and number of grab per hour.</p>								
7b.8.4.1 – 7b.8.4.8	<p><u>Compensation of loss of important habitat of Finless Porpoise</u></p> <p><i>Designation of Marine Park</i></p> <ul style="list-style-type: none"> The Project Proponent has made a firm commitment to seek to designate a marine park of approximately 700 ha in the waters between Soko Islands and Shek Kwu Chau, in accordance with the statutory process stipulated in the Marine Parks Ordinance, as a compensation measure for the habitat loss arising from the construction of the IWMF at the artificial island near SKC. The Project Proponent shall seek to complete the designation by 2018 to tie in 	Waters between Shek Kwu Chau and Soko Islands	Project Proponent	✓		✓		EIAO-TM	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<p>with the operation of the IWMF at the artificial island near SKC.</p> <ul style="list-style-type: none"> A further study should be carried out to review relevant previous studies and collate available information on the ecological characters of the proposed area for marine park designation; and review available survey data for Finless Porpoise, water quality, fisheries, marine traffic and planned development projects in the vicinity. Based on the findings, ecological profiles of the proposed area for marine park designation should be established, and the extent and location of the proposed marine park be determined. The adequacy of enhancement measures should also be reviewed. In addition, a management plan for the proposed marine park should be proposed, covering information on the responsible departments for operation and management (O&M) of the marine park, as well as the O&M duties of each of the departments involved. Consultation with relevant government departments and stakeholders should be conducted under the study. The study should be submitted to Director of Environmental Protection (DEP) for approval before the commencement of construction works. 								

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	<ul style="list-style-type: none"> The Project Proponent should provide assistance to AFCD during the process of the marine park designation. . 								
7b.8.5.1 – 7b.8.5.4	<p><u>Additional Enhancement or Precautionary Measures Deployment of Artificial Reefs</u></p> <ul style="list-style-type: none"> Deployment of artificial reefs (ARs) is an enhancement measure for the marine habitats. ARs are proposed to be deployed within the proposed marine park under this Project. The exact location, dimension and type of ARs to be deployed are to be further investigated along with the further study of the proposed marine park under this Project. The proposed ARs would be deployed at the same time as the complete designation of marine park. <p><i>Release of Fish Fry at Artificial Reefs and Marine Park</i></p> <ul style="list-style-type: none"> Release of fish fry at the proposed ARs, as well as the proposed marine park under this study, should enhance the fish resources in the nearby waters, and subsequently food sources for Finless Porpoise. The proposed ARs with various micro-habitats would have the potential to provide shelter and nursery ground for the released fish fry. 	Within the proposed marine park under this study	Project Proponent	✓		✓		EIAO-TM	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
	The frequency and quantity of fry to be released should be agreed by AFCD.								

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table B.6 Implementation Schedule for Fisheries Measures for the IWMF at the artificial island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
8b.8.1.2	<p><u>Measure to minimize loss of and disturbance on fisheries resources</u></p> <ul style="list-style-type: none"> Alteration to the phasing of works, construction method, and layout plan of the IWMF at the artificial island near SKC has been made. The total fishing ground to be permanently lost due to the project has been significantly reduced from ~50 ha to ~31 ha. By adopting the current circular cells instead of the conventional seawall construction method, SS elevation would be greatly reduced, minimizing adverse impact on the health of fisheries resources. 	IWMF site	Design team, contractor	✓	✓		✓	EIAO-TM	N/A
8b.8.1.3	<p><u>Measure to minimize impingement and entrainment</u></p> <ul style="list-style-type: none"> Provision of a screen at the water intake point for desalination plant would be essential to minimize the risk of impingement and entrainment of fisheries resources (including fish, larvae and egg) through the intake point. 	IWMF site	Design team, contractor, IW MF operator	✓	✓	✓		EIAO-TM	N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
8b.8.1.4-8b.8.1.6	<p><u>Measures to control water quality</u></p> <ul style="list-style-type: none"> No wastewater effluent, anti-fouling agent, heavy metals and other contaminants would be released during operation phase of the Project. Mitigation measures recommended in the water quality impact assessment during construction and operation would serve to protect fisheries resources from indirect impacts resulted from the Project 	Work site, IWMF site	Design team, contractor, IWMF operator	✓	✓	✓	✓	EIAO-TM	Implemented
8b.8.1.7 – 8b.8.1.8	<p><u>Additional Enhancement / Precautionary Measures</u></p> <ul style="list-style-type: none"> Artificial Reefs (ARs) are proposed to be deployed within the proposed marine park under this Project as an enhancement measure for the marine habitats. This enhancement feature would bring positive impacts to the previously identified important spawning and nursery ground for fisheries resources. <p><i>Release of Fish Fry at Artificial Reefs</i></p> <ul style="list-style-type: none"> Release of fish fry has been proposed under this Project. The proposed deployment of ARs within the proposed marine park would provide shelter and nursery ground for the released fish fry. The frequency and quantity of fry to be released should be agreed by AFCD. 	Within the proposed marine park in the waters between Soko Islands and Shek Kwu Chau	Project Proponent	✓		✓		EIAO-TM	N/A

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table B.7 Implementation Schedule for Landscape and Visual Measures for the IWMF at the artificial island near SKC

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S10b.10 MLVC- 01	Grass-hydroseeded bare soil surface and stock pile area	Work site / During construction phase	Contractor		✓				N/A
S10b.10 MLVC-02	<p><u>Landscape Design</u></p> <p>1) Early planting using fast grow trees and tall shrubs at strategic locations within site as buffer to block view corridors to the site from the VSRs, and to locally screen haul roads, excavation works and site preparation works.</p> <p>2) Use of tree species of dense tree crown to serve as visual barrier.</p> <p>3) Hard and soft landscape treatment (e.g. trees and shrubs) of open areas within development to provide a background for the outdoor containers from open view, shade and shelter, and a green appearance from surrounding viewpoints.</p> <p>4) Planting strip along the periphery of the project site.</p> <p>5) Selected tree species suitable for the coastal condition.</p>	Work site / During design & construction phases	Contractor	✓	✓				N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S10b.10 MLVC-03	<p><u>Adoption of Natural Features of the Existing Shoreline</u></p> <p>1) Use of boulders in different sizes and with the similar textures of the existing rocky shores for the construction of breakwater and artificial shoreline in order to blend into the existing natural shoreline.</p> <p>2) Use of cellular cofferdam together with the natural boulders to form a curvature shoreline for the reclamation area to echo with the natural shoreline of SKC.</p>	Work site / During construction phase	Contractor		✓				N/A
S10b.10 MLVC-04	<p><u>Greening Design (Rooftop & Vertical Greening)</u></p> <p>1) Implementation of rooftop and vertical greening (vertical building envelope) along the periphery of each building block to increase the amenity value of the work, moderate temperature extremes and enhance building energy performance. The greening appearance of the building shall enhance its visual harmony with the natural surroundings as well as reduce the apparent visual mass of the structure.</p> <p>2) Sufficient space between concrete enclosure and stack to minimize heat transfer.</p> <p>3) Introduction of landscape decks at the stack to further enhance the overall natural and green concept unique for this site.</p>	Work site / During design & construction phases	Contractor	✓	✓				N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S10b.10 MVC-01	<p><u>Visual Mitigation and Aesthetic Design</u></p> <ol style="list-style-type: none"> 1) Use of natural materials with recessive color to minimize the bulkiness of the building. 2) Adoption of innovative aesthetic design to the chimney to minimize or visually mitigate the massing of the chimney so as to reduce its visual impact to the surroundings. 3) Color of the chimney in a gradual changing manner to match with the color of the sky. 4) Provision of observation deck for public enjoyment at the top of the chimney to diminish the feeling of chimney. 5) Provision of sky gardens between the two stacks to allow additional greening for enhancing the aesthetic quality. Maintenance access (elevator and staircase) from the ground floor to the sky gardens will be provided to allow maintenance of the sky gardens. 6) Integration of the visitor’s walkway with different material façade design of incinerator plant to enhance the aesthetic quality. 	Structures in IWMF / During design & construction phases	Contractor	✓	✓			N/A	
S10b.10 MVC-02	Control of the security floodlight for construction areas at night to avoid excessive glare to the surrounding receiver.	Work site / During construction phase	Contractor		✓			Implemented	

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S10b.10 MVC-03	Optimization of the construction sequence and construction programme to minimize the duration of impact.	Work site / During design & construction phases	Contractor	✓	✓				Implemented
S10b.10 MVC-04	Storage of the backfilling materials for site formation & construction materials / wastes on site at a maximum height of 2m, covered with an impermeable material of visually unobtrusive material (in earth tone).	Work site / During construction phase	Contractor		✓				N/A
S10b.10 MVC-05	Reduction of the number of construction traffic at the site to practical minimum.	Work site / During construction phase	Contractor		✓				Implemented
S10b.10 MLVO-01	<u>Planting Maintenance</u> Provision of proper planting maintenance and replacement of defective plant species on the new planting areas to enhance aesthetic and landscape quality.	Project site / During Operation phase	Contractor			✓			N/A
S10b.10 MVO-01	<u>Environmental Education Centre</u> Development of an Environmental Education Center, in which regular exhibitions and lectures to promote environmental awareness and waste reduction concept would be provided, as a part of the IWMF for the general public to alleviate negative public perceptions of the development.	Project site / During Operation phase	Contractor			✓			N/A
S10b.10 MVO-02	<u>Control of Light</u> Control the numbers of lights and their intensity to a level that is good enough to meet the safety requirements at night but not excessive.	Project site / During Operation phase	Contractor			✓			N/A

EIA Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines	Implementation Status and Remarks
				Des	C	O	Dec		
S10b.10 MVO-03	<u>Control of Operation Time</u> Minimization of the frequency of waste transportation to practical minimum (e.g. limit the reception of MSW from 8 am to 8 pm)	Project site / During Operation phase	Contractor			✓			N/A

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Appendix C Impact Monitoring Schedule of the Reporting Month

Impact Monitoring Schedule for IWMF

Dec-20						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
		<p align="center">Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 11:20 - 14:51 Flood Tide: 14:51 - 21:00 <u>Monitoring Time:</u> # \$ Mid-ebb: 11:20 - 14:50 & Mid-flood: 15:30 - 19:00 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>		<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 13:00 - 16:00 Flood Tide: 06:00 - 13:00 <u>Monitoring Time:</u> # \$ Mid-ebb: 12:45 - 16:15 * Mid-flood: 08:00 - 11:30</p>	
6	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 15:00 - 19:00 Flood Tide: 09:00 - 15:00 <u>Monitoring Time:</u> Mid-ebb: 15:15 - 18:45 Mid-flood: 10:15 - 13:45 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3 Ecology monitoring for Marine Mammals by Vessel-based Line-Transsect Survey</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 04:00 - 10:36 Flood Tide: 10:36 - 18:00 <u>Monitoring Time:</u> * Mid-ebb: 08:00 - 11:30 Mid-flood: 13:30 - 17:00</p>	10		<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 07:46 - 12:53 Flood Tide: 12:53 - 19:27 <u>Monitoring Time:</u> Mid-ebb: 08:34 - 12:04 & Mid-flood: 14:25 - 17:55</p>
13	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 10:09 - 14:14 Flood Tide: 14:14 - 20:00 <u>Monitoring Time:</u> Mid-ebb: 10:26 - 13:56 & Mid-flood: 15:22 - 18:52 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3 Ecology monitoring for WBSE</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 12:00 - 15:30 Flood Tide: 04:45 - 12:00 <u>Monitoring Time:</u> Mid-ebb: 12:00 - 15:30 * Mid-flood: 08:00 - 11:30</p>	<p align="center">Impact Ecology monitoring for Marine Mammals by Vessel-based Line-Transsect Survey</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 13:00 - 17:00 Flood Tide: 06:26 - 13:00 <u>Monitoring Time:</u> Mid-ebb: 13:15 - 16:45 * Mid-flood: 08:00 - 11:30</p>	19
20	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 15:00 - 19:00 Flood Tide: 07:58 - 15:00 <u>Monitoring Time:</u> Mid-ebb: 15:15 - 18:45 & Mid-flood: 09:44 - 13:14</p>	<p align="center">Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 02:00 - 10:00 Flood Tide: 10:00 - 17:00 <u>Monitoring Time:</u> * Mid-ebb: 08:00 - 11:30 Mid-flood: 12:30 - 16:00 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Ecology monitoring for WBSE 8th Quarterly Coral Monitoring at Indirect Impact Site and Control Site</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 05:00 - 10:43 Flood Tide: 10:43 - 18:43 <u>Monitoring Time:</u> * # Mid-ebb: 08:00 - 11:30 Mid-flood: 12:58 - 16:28</p>	26
27	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 09:00 - 13:00 Flood Tide: 13:00 - 19:54 <u>Monitoring Time:</u> Mid-ebb: 09:15 - 12:45 Mid-flood: 14:42 - 18:12 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3</p>	<p align="center">Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 <u>Tidal Period:</u> Ebb Tide: 10:00 - 14:00 Flood Tide: 14:00 - 20:46 <u>Monitoring Time:</u> Mid-ebb: 10:15 - 13:45 Mid-flood: 15:30 - 19:00</p>	<p align="center">Impact Ecology monitoring for WBSE</p>		

Remarks:
1. Daytime Noise Monitoring (07:00-1900), Evening Time Noise Monitoring (1900-2300), Night Time Noise Monitoring (2300-0700)
2. Water Quality Monitoring for S1,S2 and S3 will only conduct during DCM works, refer to Detailed DCM Plan

Note:
* - as per Marine Department Notice No 107 of 2018, all vessels employed for the works should stay in the works area outside the hours of works (0700 to 2300). Due to safety concern, Water Quality Monitoring would start at 0800.
- Prioritized routing: Mid-Ebb: C1→S3→CR2→CR1→H1→Remaining stations and Mid-Flood: C2→CR1→S3→CR2→H1→Remaining stations
\$ - Since predicted tide is shorter than 3.5 hours, method of 90% tidal period as monitoring time is approached.
& - Due to safety concern for sampling event in night-time, method of 90% tidal period as monitoring time is approached and end at 1900.

Appendix D Water Quality Monitoring Data

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	3.8	13:09	9.44	8.11	30.32	23.83	3.33	7	-	-	-
B1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	3.8	13:09	9.13	8.17	30.17	23.76	2.87	8	-	-	-
B1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	13:10	9.64	8.52	29.98	23.64	3.33	6	-	-	-
B1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	13:10	9.12	8.48	29.92	23.63	2.91	7	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	4	12:51	9.01	8.44	29.72	23.91	3.41	6	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	4	12:51	8.64	8.20	30.19	23.94	3.22	7	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:52	9.28	8.54	30.32	23.59	3.35	6	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:52	9.00	8.29	29.95	23.69	3.32	5	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	4.5	12:31	9.63	8.24	30.01	23.90	3.60	5	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	4.5	12:31	8.87	8.44	29.53	23.81	3.07	5	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:32	9.64	8.24	30.10	23.89	2.18	6	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:32	9.25	8.47	30.45	23.63	2.35	7	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	3.6	12:23	9.40	8.38	30.11	23.49	3.46	8	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	3.6	12:23	9.32	8.42	29.46	23.66	3.60	8	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:24	9.46	8.17	29.82	23.65	3.00	8	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:24	9.20	8.54	30.28	23.75	3.05	7	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	9.3	11:05	9.54	8.56	30.29	23.31	2.94	6	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	9.3	11:05	9.19	8.56	29.53	23.52	2.75	5	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Ebb	Middle	5.15	11:06	8.75	8.14	29.64	23.42	2.78	8	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Ebb	Middle	5.15	11:06	9.07	8.43	29.72	23.42	2.56	8	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:07	9.05	8.47	30.26	23.41	2.49	10	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:07	9.21	8.54	30.33	23.35	2.36	11	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	11.2	12:23	8.69	8.41	30.13	23.50	2.86	6	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	11.2	12:23	8.51	8.41	30.45	23.49	2.87	7	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Ebb	Middle	6.1	12:24	9.65	8.14	30.25	23.86	2.68	11	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Ebb	Middle	6.1	12:24	9.59	8.32	30.42	23.53	2.78	10	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:25	8.98	8.17	30.07	23.79	3.38	10	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:25	8.91	8.32	29.94	23.58	3.28	11	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	12.6	12:00	9.65	8.46	30.22	23.42	3.92	10	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	12.6	12:00	9.22	8.20	29.65	23.39	3.62	9	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR1	20201202	Cloudy	Moderate	Mid-Ebb	Middle	6.8	12:01	9.38	8.12	30.47	23.79	3.12	9	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Ebb	Middle	6.8	12:01	9.27	8.19	29.48	23.58	3.55	9	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:02	8.91	8.36	30.34	23.41	3.26	7	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:02	8.85	8.39	30.50	23.70	3.23	8	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	10.7	11:47	9.53	8.12	29.85	23.65	3.01	10	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	10.7	11:47	9.34	8.24	29.55	23.56	2.83	11	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Ebb	Middle	5.85	11:48	9.21	8.18	30.41	23.68	2.91	10	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Ebb	Middle	5.85	11:48	9.44	8.31	30.47	23.26	3.16	9	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:49	9.66	8.37	29.68	23.73	3.17	7	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:49	9.45	8.41	30.13	23.46	3.30	6	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	7.2	12:02	9.16	8.32	30.20	23.72	3.10	10	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	7.2	12:02	9.54	8.49	30.29	23.70	3.15	10	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Ebb	Middle	4.1	12:03	9.43	8.54	29.69	23.65	2.59	6	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Ebb	Middle	4.1	12:03	9.34	8.44	29.58	23.50	2.50	5	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:04	9.36	8.48	29.56	23.56	2.80	5	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	12:04	9.19	8.28	29.81	23.61	2.55	4	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	7.6	11:32	9.19	8.51	29.50	23.33	3.04	7	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	7.6	11:32	8.85	8.13	30.42	23.32	2.96	8	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Ebb	Middle	4.3	11:33	8.71	8.34	29.87	23.61	2.97	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Ebb	Middle	4.3	11:33	8.29	8.38	30.32	23.61	2.77	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:34	9.06	8.51	30.43	23.39	2.79	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:34	8.85	8.17	30.28	23.46	2.75	6	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	8.2	11:40	8.30	8.35	29.76	23.31	3.74	5	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Ebb	Bottom	8.2	11:40	8.75	8.38	29.69	23.64	3.78	6	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Ebb	Middle	4.6	11:41	9.15	8.45	30.45	23.56	2.76	7	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Ebb	Middle	4.6	11:41	8.69	8.44	29.78	23.67	3.02	6	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:42	8.88	8.13	29.52	23.26	3.09	7	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Ebb	Surface	1	11:42	9.26	8.48	29.85	23.51	2.77	6	-	-	-
B1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	3.5	15:32	8.20	8.39	30.27	23.77	3.17	5	-	-	-
B1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	3.5	15:32	8.61	8.37	30.19	23.45	3.39	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:33	8.75	8.32	30.61	23.75	2.72	6	-	-	-
B1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:33	8.29	8.52	30.68	23.65	3.20	7	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Flood	Bottom	3.7	15:47	9.85	8.07	30.31	23.74	2.99	7	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Flood	Bottom	3.7	15:47	9.36	8.48	30.58	23.55	2.99	6	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:48	9.13	8.31	30.65	23.48	3.30	8	-	-	-
B2	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:48	9.80	8.40	30.17	23.51	3.29	7	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Flood	Bottom	4	16:08	8.77	8.37	30.11	23.79	2.93	5	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Flood	Bottom	4	16:08	9.72	8.07	29.88	23.80	3.13	6	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:09	9.22	8.58	29.96	23.51	2.59	5	-	-	-
B3	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:09	9.17	8.20	30.26	23.71	3.06	6	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Flood	Bottom	4.1	16:16	9.59	8.34	30.52	23.49	3.84	7	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Flood	Bottom	4.1	16:16	9.72	8.21	29.61	23.68	3.46	7	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:17	9.14	8.18	29.72	23.52	2.87	6	-	-	-
B4	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:17	8.95	8.61	29.94	23.63	2.59	7	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Flood	Bottom	9.9	16:26	8.21	8.40	29.61	23.43	3.74	5	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Flood	Bottom	9.9	16:26	8.14	8.42	29.95	23.48	3.46	6	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Flood	Middle	5.45	16:27	8.61	8.38	30.21	23.53	3.09	6	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Flood	Middle	5.45	16:27	9.85	8.52	30.33	23.49	3.00	6	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:28	9.72	8.11	30.56	23.82	2.87	6	-	-	-
C1A	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:28	9.51	8.38	30.02	23.54	2.50	7	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Flood	Bottom	10.2	15:30	9.20	8.41	30.19	23.47	3.84	8	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Flood	Bottom	10.2	15:30	9.75	8.46	29.96	23.65	3.93	7	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Flood	Middle	5.6	15:31	8.53	8.10	30.37	23.65	3.03	8	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Flood	Middle	5.6	15:31	8.77	8.37	30.30	23.65	2.59	7	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:32	8.17	8.27	29.98	23.82	3.33	8	-	-	-
C2A	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:32	9.30	8.15	30.38	23.45	2.87	8	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	11.3	15:51	9.79	8.59	29.92	23.67	3.65	7	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	11.3	15:51	9.25	8.57	29.86	23.45	3.48	6	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Flood	Middle	6.15	15:52	8.70	8.28	30.60	23.52	3.58	7	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Flood	Middle	6.15	15:52	8.85	8.20	30.64	23.71	3.39	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:53	9.85	8.55	30.27	23.67	2.47	10	-	-	-
CR1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	15:53	9.29	8.53	30.20	23.68	2.42	9	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Flood	Bottom	10.3	16:05	8.94	8.27	30.21	23.79	3.08	7	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Flood	Bottom	10.3	16:05	9.20	8.10	30.15	23.50	3.36	6	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Flood	Middle	5.65	16:06	9.40	8.10	29.60	23.52	3.56	7	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Flood	Middle	5.65	16:06	9.28	8.19	29.67	23.50	3.49	7	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:07	8.87	8.51	30.04	23.83	3.33	8	-	-	-
CR2	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:07	9.23	8.34	30.57	23.49	3.14	7	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Flood	Bottom	6.6	16:38	9.67	8.41	29.90	23.78	3.25	7	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Flood	Bottom	6.6	16:38	9.60	8.18	30.62	23.68	3.79	8	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Flood	Middle	3.8	16:39	8.28	8.03	30.14	23.55	3.42	5	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Flood	Middle	3.8	16:39	9.40	8.38	30.10	23.80	3.32	6	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:40	8.24	8.37	29.78	23.52	2.59	5	-	-	-
F1A	20201202	Cloudy	Moderate	Mid-Flood	Surface	1	16:40	9.83	8.38	30.14	23.79	2.99	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	7.2	16:51	9.55	8.05	29.96	23.54	2.99	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	7.2	16:51	9.39	8.55	29.83	23.71	2.88	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Flood	Middle	4.1	16:52	8.37	8.44	29.64	23.51	2.60	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Flood	Middle	4.1	16:52	9.43	8.26	29.63	23.82	2.60	7	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1.0	16:53	8.52	8.21	30.24	23.79	3.24	6	-	-	-
H1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1.0	16:53	9.79	8.31	30.56	23.81	3.10	7	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	7.3	17:00	9.62	8.43	29.86	23.45	3.50	5	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Flood	Bottom	7.3	17:00	9.26	8.12	29.74	23.50	3.24	6	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Flood	Middle	4.2	17:01	9.88	8.31	30.40	23.55	3.51	6	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Flood	Middle	4.2	17:01	9.07	8.18	29.95	23.81	3.45	7	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1.0	17:02	9.32	8.11	29.57	23.50	2.49	8	-	-	-
M1	20201202	Cloudy	Moderate	Mid-Flood	Surface	1.0	17:02	9.86	8.19	29.60	23.75	2.95	9	-	-	-
B1	20201204	Sunny	Moderate	Mid-Flood	Bottom	4.4	9:26	9.65	8.54	30.99	19.91	3.68	8	-	-	-
B1	20201204	Sunny	Moderate	Mid-Flood	Bottom	4.4	9:26	8.76	8.60	30.44	20.11	3.41	15	-	-	-
B1	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:27	9.82	8.40	30.30	20.01	2.87	13	-	-	-
B1	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:27	9.72	8.47	30.62	20.11	2.77	12	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B2	20201204	Sunny	Moderate	Mid-Flood	Bottom	3.8	9:45	9.66	8.55	30.86	20.09	3.46	14	-	-	-
B2	20201204	Sunny	Moderate	Mid-Flood	Bottom	3.8	9:45	8.84	8.41	30.73	20.02	3.12	15	-	-	-
B2	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:46	8.33	8.60	30.71	20.24	3.07	14	-	-	-
B2	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:46	8.36	8.41	30.59	20.32	3.29	15	-	-	-
B3	20201204	Sunny	Moderate	Mid-Flood	Bottom	3.8	9:51	9.38	8.36	30.76	20.08	2.71	15	-	-	-
B3	20201204	Sunny	Moderate	Mid-Flood	Bottom	3.8	9:51	9.46	8.41	30.47	20.17	2.98	16	-	-	-
B3	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:52	8.44	8.63	30.31	20.26	2.47	17	-	-	-
B3	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:52	8.96	8.38	30.77	20.21	2.87	16	-	-	-
B4	20201204	Sunny	Moderate	Mid-Flood	Bottom	4.1	9:39	8.55	8.37	30.91	19.98	3.01	15	-	-	-
B4	20201204	Sunny	Moderate	Mid-Flood	Bottom	4.1	9:39	8.52	8.46	30.48	20.02	3.59	16	-	-	-
B4	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:40	9.23	8.39	30.38	19.99	2.67	15	-	-	-
B4	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	9:40	8.75	8.37	30.26	20.08	2.70	14	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Flood	Bottom	9.3	8:55	8.48	8.61	30.92	20.11	3.30	14	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Flood	Bottom	9.3	8:55	8.92	8.63	30.58	19.95	3.89	15	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Flood	Middle	5.2	8:56	9.26	8.55	30.79	19.85	3.29	14	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Flood	Middle	5.2	8:56	8.66	8.57	30.50	20.04	3.24	14	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	8:57	8.42	8.47	30.49	19.89	2.61	14	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	8:57	9.47	8.49	30.59	20.08	2.34	13	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Flood	Bottom	10.9	8:00	9.02	8.67	30.70	19.90	3.40	9	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Flood	Bottom	10.9	8:00	9.19	8.58	30.48	19.66	3.31	8	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Flood	Middle	6.0	8:01	8.50	8.53	30.61	19.70	3.02	9	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Flood	Middle	6.0	8:01	8.55	8.53	30.66	19.72	3.12	9	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	8:02	8.92	8.61	30.96	19.74	2.52	10	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Flood	Surface	1.0	8:02	9.81	8.48	30.99	19.85	2.64	9	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Flood	Bottom	11.9	8:21	8.53	8.58	30.68	19.69	2.78	8	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Flood	Bottom	11.9	8:21	8.52	8.61	30.59	19.87	3.06	8	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Flood	Middle	6.5	8:22	8.50	8.62	30.98	19.78	3.51	10	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Flood	Middle	6.5	8:22	9.21	8.59	30.44	19.95	3.30	11	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Flood	Surface	1	8:23	8.72	8.61	30.58	19.94	3.00	11	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Flood	Surface	1	8:23	8.97	8.40	30.55	19.73	2.88	10	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR2	20201204	Sunny	Moderate	Mid-Flood	Bottom	9.9	8:35	8.99	8.38	30.58	19.83	2.89	12	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Flood	Bottom	9.9	8:35	9.60	8.66	30.35	20.09	3.18	12	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Flood	Middle	5.45	8:36	9.17	8.54	30.95	19.81	3.58	13	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Flood	Middle	5.45	8:36	9.15	8.36	30.57	19.77	3.21	13	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Flood	Surface	1	8:37	8.57	8.57	30.82	19.79	3.12	13	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Flood	Surface	1	8:37	9.82	8.57	30.47	19.84	2.88	14	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Flood	Bottom	6.7	9:14	8.45	8.55	30.94	20.12	3.18	11	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Flood	Bottom	6.7	9:14	8.82	8.35	30.33	20.06	2.99	12	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Flood	Middle	3.85	9:15	8.52	8.57	30.26	20.15	3.51	11	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Flood	Middle	3.85	9:15	8.43	8.66	30.73	20.10	3.16	11	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Flood	Surface	1	9:16	9.05	8.41	30.51	20.05	2.74	6	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Flood	Surface	1	9:16	8.54	8.52	30.89	20.12	2.65	6	-	-	-
H1	20201204	Sunny	Moderate	Mid-Flood	Bottom	7.5	10:12	9.61	8.57	30.80	20.05	3.84	8	-	-	-
H1	20201204	Sunny	Moderate	Mid-Flood	Bottom	7.5	10:12	8.71	8.37	30.85	20.04	3.43	7	-	-	-
H1	20201204	Sunny	Moderate	Mid-Flood	Middle	4.25	10:13	9.55	8.45	30.93	20.00	2.60	7	-	-	-
H1	20201204	Sunny	Moderate	Mid-Flood	Middle	4.25	10:13	9.50	8.61	30.27	20.07	2.88	6	-	-	-
H1	20201204	Sunny	Moderate	Mid-Flood	Surface	1	10:14	9.22	8.57	30.47	20.09	3.01	6	-	-	-
H1	20201204	Sunny	Moderate	Mid-Flood	Surface	1	10:14	8.72	8.54	30.62	20.28	3.36	7	-	-	-
M1	20201204	Sunny	Moderate	Mid-Flood	Bottom	6.7	8:51	8.52	8.50	30.38	19.93	3.52	5	-	-	-
M1	20201204	Sunny	Moderate	Mid-Flood	Bottom	6.7	8:51	9.42	8.38	30.52	19.97	3.65	6	-	-	-
M1	20201204	Sunny	Moderate	Mid-Flood	Middle	3.85	8:52	9.08	8.37	30.39	19.85	2.97	6	-	-	-
M1	20201204	Sunny	Moderate	Mid-Flood	Middle	3.85	8:52	8.53	8.45	30.97	20.16	3.15	5	-	-	-
M1	20201204	Sunny	Moderate	Mid-Flood	Surface	1	8:53	9.63	8.69	30.78	19.96	2.95	7	-	-	-
M1	20201204	Sunny	Moderate	Mid-Flood	Surface	1	8:53	9.55	8.49	30.96	20.11	2.82	8	-	-	-
B1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	4.2	13:05	9.42	8.34	30.59	20.84	2.75	6	-	-	-
B1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	4.2	13:05	9.69	8.50	30.23	20.62	2.80	7	-	-	-
B1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:06	9.07	8.31	30.70	20.59	3.20	7	-	-	-
B1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:06	9.49	8.31	30.35	20.82	3.24	6	-	-	-
B2	20201204	Sunny	Moderate	Mid-Ebb	Bottom	4.3	13:55	8.60	8.47	30.53	21.06	3.59	9	-	-	-
B2	20201204	Sunny	Moderate	Mid-Ebb	Bottom	4.3	13:55	8.70	8.54	30.94	20.90	3.78	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B2	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:56	8.85	8.45	30.86	20.86	3.18	7	-	-	-
B2	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:56	8.49	8.65	30.27	20.87	3.16	6	-	-	-
B3	20201204	Sunny	Moderate	Mid-Ebb	Bottom	4.5	14:24	9.60	8.45	30.49	20.96	3.45	8	-	-	-
B3	20201204	Sunny	Moderate	Mid-Ebb	Bottom	4.5	14:24	9.72	8.58	30.40	20.79	3.81	9	-	-	-
B3	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:25	8.98	8.62	30.51	20.92	2.93	9	-	-	-
B3	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:25	9.10	8.65	30.85	21.08	2.60	8	-	-	-
B4	20201204	Sunny	Moderate	Mid-Ebb	Bottom	3.7	14:33	9.78	8.62	30.43	21.10	3.01	8	-	-	-
B4	20201204	Sunny	Moderate	Mid-Ebb	Bottom	3.7	14:33	9.52	8.51	30.75	20.77	2.96	7	-	-	-
B4	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:34	8.64	8.32	30.36	20.76	2.62	6	-	-	-
B4	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:34	8.81	8.43	30.32	20.94	2.49	7	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Ebb	Bottom	8.6	12:45	8.69	8.49	30.78	20.52	3.81	7	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Ebb	Bottom	8.6	12:45	8.46	8.44	30.66	20.67	3.54	6	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.8	12:46	9.48	8.31	30.62	20.57	2.42	8	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.8	12:46	9.39	8.45	30.93	20.54	2.60	7	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	12:47	9.61	8.61	30.90	20.83	2.55	8	-	-	-
C1A	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	12:47	9.07	8.63	30.67	20.47	2.97	9	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Ebb	Bottom	10.7	14:09	9.57	8.65	30.81	20.82	3.33	5	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Ebb	Bottom	10.7	14:09	8.69	8.41	30.75	20.78	2.98	6	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Ebb	Middle	5.85	14:10	9.18	8.58	30.51	20.83	2.93	7	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Ebb	Middle	5.85	14:10	9.22	8.41	30.93	20.70	2.93	8	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:11	9.26	8.37	30.53	20.75	2.63	7	-	-	-
C2A	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:11	9.04	8.39	30.49	20.88	2.94	8	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	12.5	12:48	9.15	8.54	30.66	20.71	2.90	6	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	12.5	12:48	9.35	8.44	30.60	20.74	2.99	7	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Ebb	Middle	6.75	12:49	8.84	8.38	30.87	20.77	3.53	7	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Ebb	Middle	6.75	12:49	8.82	8.35	30.44	20.69	3.34	6	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	12:50	9.86	8.67	30.93	20.83	2.68	7	-	-	-
CR1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	12:50	9.59	8.53	30.68	20.58	2.98	7	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Ebb	Bottom	10.3	13:03	9.29	8.38	30.73	20.89	3.25	7	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Ebb	Bottom	10.3	13:03	8.86	8.64	30.22	20.79	3.74	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR2	20201204	Sunny	Moderate	Mid-Ebb	Middle	5.65	13:04	9.52	8.35	30.78	20.57	2.65	8	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Ebb	Middle	5.65	13:04	8.75	8.60	30.42	20.92	3.11	7	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:05	9.72	8.38	30.52	20.68	2.43	8	-	-	-
CR2	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:05	8.88	8.66	30.22	20.76	2.83	7	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Ebb	Bottom	7.6	14:56	9.53	8.45	30.72	20.74	2.91	7	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Ebb	Bottom	7.6	14:56	9.75	8.40	30.43	20.97	3.30	7	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.3	14:57	8.73	8.65	30.81	20.88	2.62	6	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.3	14:57	9.31	8.47	30.68	20.98	2.99	6	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:58	9.02	8.46	30.68	20.61	2.59	7	-	-	-
F1A	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	14:58	9.52	8.32	30.71	21.00	2.48	6	-	-	-
H1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	7.4	13:49	9.52	8.41	30.77	20.79	3.69	9	-	-	-
H1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	7.4	13:49	9.50	8.47	30.47	20.68	3.91	10	-	-	-
H1	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.2	13:50	9.18	8.31	30.33	20.79	2.44	10	-	-	-
H1	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.2	13:50	8.65	8.32	30.35	20.88	2.62	9	-	-	-
H1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:51	9.23	8.52	30.83	20.68	2.37	10	-	-	-
H1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	13:51	9.18	8.32	30.86	20.80	2.34	11	-	-	-
M1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	8.9	15:17	9.02	8.48	30.70	20.63	3.92	8	-	-	-
M1	20201204	Sunny	Moderate	Mid-Ebb	Bottom	8.9	15:17	9.21	8.56	30.73	20.75	3.47	8	-	-	-
M1	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.95	15:18	8.64	8.43	30.45	20.78	2.89	7	-	-	-
M1	20201204	Sunny	Moderate	Mid-Ebb	Middle	4.95	15:18	8.99	8.50	30.35	20.46	3.32	8	-	-	-
M1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	15:19	9.65	8.39	30.83	20.57	2.55	6	-	-	-
M1	20201204	Sunny	Moderate	Mid-Ebb	Surface	1	15:19	9.36	8.31	30.85	20.80	2.29	7	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	4.2	11:57	8.16	8.51	30.49	20.99	3.57	6	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	4.2	11:57	8.92	8.71	30.23	20.81	3.67	7	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:58	8.84	8.51	30.15	20.92	2.55	7	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:58	9.24	8.45	30.45	20.87	2.25	8	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Flood	Bottom	3.5	12:15	8.34	8.66	29.98	21.02	3.74	8	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Flood	Bottom	3.5	12:15	8.71	8.76	30.09	20.95	3.57	8	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	12:16	9.32	8.55	30.09	20.74	3.04	8	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	12:16	8.78	8.69	29.80	20.94	2.88	9	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B3	20201207	Cloudy	Moderate	Mid-Flood	Bottom	4.3	11:33	9.23	8.51	29.66	20.62	2.84	9	-	-	-
B3	20201207	Cloudy	Moderate	Mid-Flood	Bottom	4.3	11:33	9.25	8.66	30.19	20.61	2.78	10	-	-	-
B3	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:34	8.59	8.56	30.01	20.78	2.37	13	-	-	-
B3	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:34	8.20	8.41	29.90	20.91	2.62	14	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Flood	Bottom	4.6	11:25	8.58	8.50	29.94	20.66	3.54	11	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Flood	Bottom	4.6	11:25	8.94	8.65	29.90	20.64	3.62	12	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:26	9.22	8.54	30.09	20.76	3.28	12	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:26	9.04	8.61	30.21	20.93	3.10	11	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Flood	Bottom	9.5	11:11	9.16	8.53	30.30	20.88	3.69	11	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Flood	Bottom	9.5	11:11	8.42	8.38	30.14	20.69	3.57	10	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Flood	Middle	5.25	11:12	8.51	8.67	29.81	20.72	3.49	11	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Flood	Middle	5.25	11:12	8.45	8.65	29.96	20.67	3.00	11	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:13	8.59	8.73	29.99	20.83	2.67	11	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:13	9.06	8.47	29.83	20.74	3.14	12	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Flood	Bottom	10.5	10:15	9.03	8.41	30.49	20.46	3.26	11	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Flood	Bottom	10.5	10:15	8.32	8.74	30.30	20.42	3.43	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Flood	Middle	5.75	10:16	9.09	8.66	29.85	20.37	3.27	11	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Flood	Middle	5.75	10:16	8.68	8.73	29.68	20.46	3.53	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:17	8.38	8.55	29.81	20.57	3.46	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:17	8.93	8.50	30.26	20.37	3.27	10	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	11.6	10:38	8.79	8.44	30.28	20.41	2.94	9	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	11.6	10:38	8.80	8.58	29.69	20.59	3.14	10	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Flood	Middle	6.3	10:39	9.10	8.72	30.45	20.56	2.96	9	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Flood	Middle	6.3	10:39	8.93	8.45	30.34	20.40	3.40	10	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:40	8.34	8.45	29.93	20.43	2.61	8	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:40	8.24	8.68	30.48	20.36	2.58	7	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Flood	Bottom	10.4	10:51	8.44	8.56	29.79	20.60	2.76	6	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Flood	Bottom	10.4	10:51	9.30	8.61	30.05	20.46	2.99	7	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Flood	Middle	5.7	10:52	9.31	8.38	29.89	20.57	2.75	7	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Flood	Middle	5.7	10:52	9.28	8.73	29.73	20.49	3.19	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR2	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:53	8.79	8.63	29.92	20.55	2.15	7	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:53	8.84	8.58	29.76	20.66	2.38	8	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Flood	Bottom	7	10:58	8.55	8.40	30.42	20.60	2.77	7	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Flood	Bottom	7	10:58	8.72	8.53	30.33	20.56	2.59	8	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Flood	Middle	4	10:59	8.47	8.54	29.98	20.67	3.33	8	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Flood	Middle	4	10:59	8.14	8.63	30.15	20.58	2.86	7	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:00	8.50	8.75	30.38	20.60	3.21	9	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:00	9.04	8.40	30.23	20.69	3.44	10	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	6.8	11:34	8.78	8.52	30.37	20.56	2.87	9	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	6.8	11:34	8.82	8.63	30.08	20.58	2.77	10	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Flood	Middle	3.9	11:35	8.91	8.46	30.11	20.93	3.24	9	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Flood	Middle	3.9	11:35	8.95	8.55	30.20	20.88	3.33	10	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:36	8.82	8.76	30.21	20.57	2.69	8	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	11:36	8.28	8.69	29.74	20.91	2.95	8	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	7	10:35	8.61	8.61	29.76	20.36	3.56	11	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Flood	Bottom	7	10:35	8.96	8.46	30.01	20.45	3.51	12	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Flood	Middle	4	10:36	8.54	8.40	30.44	20.37	2.57	8	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Flood	Middle	4	10:36	8.93	8.63	30.20	20.51	2.68	8	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:37	9.02	8.74	29.82	20.55	3.04	8	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Flood	Surface	1	10:37	9.33	8.48	29.85	20.36	2.56	8	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	3.9	15:15	8.31	8.41	30.34	21.82	2.87	9	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	3.9	15:15	8.95	8.42	30.39	21.59	3.03	10	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:16	9.13	8.44	30.85	21.27	3.18	10	-	-	-
B1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:16	9.52	8.46	30.60	21.12	3.43	10	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	15:35	8.44	8.58	30.39	21.90	2.92	13	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	15:35	9.07	8.55	30.12	21.45	3.44	12	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:36	8.83	8.44	30.58	21.34	2.78	8	-	-	-
B2	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:36	8.76	8.49	30.44	21.93	2.74	7	-	-	-
B3	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	15:55	8.84	8.52	30.58	21.50	3.09	8	-	-	-
B3	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	15:55	8.60	8.60	30.83	21.88	2.99	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B3	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:56	8.58	8.50	30.27	21.75	3.04	7	-	-	-
B3	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:56	8.75	8.42	30.90	21.99	2.82	8	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	16:03	8.92	8.38	30.36	21.33	2.68	7	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	16:03	8.43	8.27	30.29	21.36	3.13	7	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:04	8.84	8.43	30.98	21.70	2.67	8	-	-	-
B4	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:04	9.06	8.46	30.23	21.37	2.88	7	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	9.7	15:15	8.34	8.29	30.53	21.56	3.16	8	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	9.7	15:15	9.25	8.52	30.10	21.35	3.46	7	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Ebb	Middle	5.35	15:16	9.28	8.38	30.50	21.33	2.40	9	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Ebb	Middle	5.35	15:16	9.07	8.40	30.93	21.74	2.61	9	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:17	9.28	8.56	30.59	21.63	2.59	9	-	-	-
C1A	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:17	8.87	8.27	30.54	21.78	2.87	9	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	10.9	16:33	9.33	8.35	30.77	21.82	3.87	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	10.9	16:33	8.46	8.33	30.37	21.38	3.52	11	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Ebb	Middle	5.95	16:34	9.19	8.40	30.88	21.25	3.19	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Ebb	Middle	5.95	16:34	8.32	8.54	30.79	21.46	3.31	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:35	8.71	8.35	30.92	21.24	3.08	10	-	-	-
C2A	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:35	9.62	8.48	30.27	21.38	2.69	9	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	11.9	16:12	9.27	8.29	30.38	21.33	3.50	13	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	11.9	16:12	8.43	8.34	30.08	21.75	3.11	13	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Ebb	Middle	6.45	16:13	8.65	8.29	30.31	21.74	3.12	12	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Ebb	Middle	6.45	16:13	9.15	8.38	30.53	21.28	2.88	12	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:14	8.59	8.32	30.58	21.46	3.22	11	-	-	-
CR1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:14	9.24	8.42	30.93	21.58	3.23	12	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	11.1	15:58	9.31	8.26	30.92	21.93	3.30	12	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	11.1	15:58	8.46	8.45	30.78	21.68	3.32	11	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Ebb	Middle	6.05	15:59	8.55	8.52	30.53	21.93	2.54	10	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Ebb	Middle	6.05	15:59	8.61	8.32	30.14	21.87	2.76	9	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:00	8.75	8.38	30.87	21.71	2.89	8	-	-	-
CR2	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:00	8.93	8.46	30.75	21.36	2.93	9	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
F1A	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	7.5	16:27	8.29	8.28	30.42	21.23	3.21	9	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	7.5	16:27	8.85	8.61	30.27	21.33	2.91	9	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Ebb	Middle	4.25	16:28	8.44	8.30	30.67	21.15	3.68	11	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Ebb	Middle	4.25	16:28	8.41	8.57	30.73	21.51	3.28	10	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:29	8.39	8.36	30.99	21.23	2.87	11	-	-	-
F1A	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:29	9.57	8.37	30.42	21.53	3.18	10	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	7.6	15:43	8.69	8.30	30.68	21.20	3.56	10	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	7.6	15:43	9.36	8.48	30.81	21.36	3.76	9	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Ebb	Middle	4.3	15:44	9.53	8.53	30.69	21.23	2.87	10	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Ebb	Middle	4.3	15:44	8.40	8.39	30.73	21.47	2.67	9	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:45	8.61	8.28	30.38	21.66	2.77	11	-	-	-
H1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	15:45	8.74	8.36	30.45	21.29	2.84	10	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	8	16:49	9.11	8.56	30.25	21.68	3.26	9	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Ebb	Bottom	8	16:49	8.97	8.38	30.95	21.48	3.34	10	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Ebb	Middle	4.5	16:50	8.29	8.35	30.53	21.13	3.04	11	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Ebb	Middle	4.5	16:50	8.98	8.33	30.60	21.27	3.26	12	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:51	8.47	8.34	30.64	21.48	2.89	13	-	-	-
M1	20201207	Cloudy	Moderate	Mid-Ebb	Surface	1	16:51	9.60	8.60	30.73	21.39	2.79	13	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	10:27	8.48	8.45	30.07	20.79	3.51	7	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	10:27	8.22	8.37	30.49	21.00	3.25	8	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	10:28	9.51	8.67	30.24	20.86	2.49	8	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	10:28	9.11	8.66	30.23	21.05	2.75	9	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	10:08	9.47	8.36	30.22	20.92	3.36	8	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	10:08	8.44	8.43	30.63	21.22	3.61	8	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	10:09	8.40	8.66	30.60	20.86	1.89	8	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	10:09	8.59	8.54	30.13	20.90	2.06	9	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	3.6	9:48	9.29	8.65	30.57	21.06	3.43	7	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	3.6	9:48	9.33	8.54	30.24	21.04	3.51	8	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:49	8.89	8.61	30.59	21.19	3.08	8	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:49	9.18	8.72	30.47	20.74	3.05	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B4	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	3.8	9:39	8.67	8.72	30.52	20.89	2.76	8	-	-	-
B4	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	3.8	9:39	8.64	8.52	30.42	20.94	2.70	9	-	-	-
B4	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:40	9.44	8.71	30.46	21.18	2.35	6	-	-	-
B4	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:40	8.24	8.43	30.15	20.68	2.41	7	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	9.5	8:21	8.46	8.46	30.07	20.52	2.67	7	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	9.5	8:21	9.44	8.62	30.25	20.80	2.51	6	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Ebb	Middle	5.25	8:22	9.06	8.71	30.66	20.75	2.65	8	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Ebb	Middle	5.25	8:22	8.54	8.37	30.11	20.86	2.76	9	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	8:23	8.33	8.62	30.20	20.76	2.66	9	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	8:23	8.49	8.51	30.30	20.64	2.98	9	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	11.4	9:37	8.37	8.45	30.62	20.77	3.09	6	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	11.4	9:37	8.28	8.73	30.13	20.82	2.79	7	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Ebb	Middle	6.2	9:38	8.40	8.49	30.49	21.09	3.11	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Ebb	Middle	6.2	9:38	8.44	8.65	30.36	20.81	3.10	7	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:39	9.03	8.70	30.03	21.01	2.90	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:39	9.35	8.66	30.14	21.12	3.01	7	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	12.4	9:15	8.76	8.45	30.64	20.76	3.40	8	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	12.4	9:15	9.45	8.72	30.67	20.91	3.63	9	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Ebb	Middle	6.7	9:16	9.31	8.43	30.66	21.00	3.48	9	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Ebb	Middle	6.7	9:16	8.93	8.43	30.45	20.80	3.08	8	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:17	9.01	8.61	30.40	20.66	2.44	9	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:17	8.28	8.49	30.46	20.61	2.35	9	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	11.1	9:02	8.27	8.71	30.18	20.66	2.95	8	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	11.1	9:02	9.44	8.39	30.63	20.89	3.48	9	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Ebb	Middle	6.05	9:03	8.60	8.51	30.54	20.79	2.48	7	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Ebb	Middle	6.05	9:03	9.13	8.55	30.13	20.91	2.53	6	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:04	8.57	8.70	30.19	20.78	3.03	7	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:04	8.26	8.49	30.08	20.74	2.78	6	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	6.9	9:16	9.50	8.67	30.05	20.76	2.83	8	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	6.9	9:16	8.47	8.57	30.59	20.99	3.04	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
F1A	20201209	Cloudy	Moderate	Mid-Ebb	Middle	3.95	9:17	8.84	8.49	30.49	20.94	2.83	8	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Ebb	Middle	3.95	9:17	9.46	8.64	30.16	20.58	3.01	7	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:18	8.21	8.44	30.67	20.63	2.57	5	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	9:18	8.37	8.56	30.62	20.85	3.05	5	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	7	8:44	8.70	8.72	30.24	20.46	3.11	9	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	7	8:44	9.16	8.37	30.61	20.51	2.97	10	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Ebb	Middle	4	8:45	9.18	8.49	30.23	20.60	2.72	7	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Ebb	Middle	4	8:45	9.52	8.49	30.52	20.75	2.44	8	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	8:46	9.43	8.65	30.15	20.73	1.89	6	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	8:46	9.39	8.69	30.23	20.77	2.06	7	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	8.6	8:52	8.82	8.64	30.66	20.57	3.32	5	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Ebb	Bottom	8.6	8:52	9.05	8.55	30.59	20.50	3.48	6	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Ebb	Middle	4.8	8:53	8.99	8.48	30.38	20.81	2.33	7	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Ebb	Middle	4.8	8:53	9.40	8.49	30.10	20.52	2.56	6	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	8:54	8.60	8.40	30.53	20.94	2.85	6	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Ebb	Surface	1	8:54	8.79	8.72	30.37	20.58	3.11	7	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	4.2	13:30	8.86	8.46	30.17	21.38	2.67	6	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	4.2	13:30	8.50	8.67	30.02	21.34	2.66	5	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:31	9.07	8.58	30.29	21.28	2.07	7	-	-	-
B1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:31	9.12	8.40	30.45	21.04	2.23	7	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Flood	Bottom	4	13:45	9.07	8.78	30.59	21.07	3.14	6	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Flood	Bottom	4	13:45	8.56	8.71	30.31	21.15	2.83	7	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:46	8.69	8.69	30.62	21.30	2.32	6	-	-	-
B2	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:46	8.62	8.38	30.35	21.32	2.57	6	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Flood	Bottom	4.3	14:06	8.64	8.56	30.31	21.37	2.76	6	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Flood	Bottom	4.3	14:06	9.15	8.42	30.62	21.38	2.78	5	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:07	8.80	8.52	30.42	21.40	2.72	6	-	-	-
B3	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:07	8.45	8.73	29.98	21.47	2.89	7	-	-	-
B4	20201209	Cloudy	Moderate	Mid-Flood	Bottom	3.6	14:14	8.98	8.58	29.94	21.13	3.54	7	-	-	-
B4	20201209	Cloudy	Moderate	Mid-Flood	Bottom	3.6	14:14	8.90	8.56	30.29	21.21	3.17	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B4	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:15	8.67	8.71	30.05	21.35	2.56	7	-	-	-
B4	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:15	8.76	8.36	30.50	21.39	2.61	7	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Flood	Bottom	9.7	14:24	9.08	8.47	30.22	21.51	2.93	8	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Flood	Bottom	9.7	14:24	9.15	8.70	30.58	21.26	2.49	7	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Flood	Middle	5.35	14:25	8.51	8.78	30.15	21.21	2.95	7	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Flood	Middle	5.35	14:25	8.99	8.38	30.31	21.57	3.22	8	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:26	8.88	8.62	30.35	21.41	2.85	6	-	-	-
C1A	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:26	8.71	8.51	30.04	21.57	3.02	6	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Flood	Bottom	10.8	13:30	9.25	8.71	30.42	21.03	3.29	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Flood	Bottom	10.8	13:30	9.16	8.32	30.28	21.21	3.48	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Flood	Middle	5.9	13:31	9.16	8.38	30.04	21.02	2.84	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Flood	Middle	5.9	13:31	8.58	8.51	30.13	21.38	2.90	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:32	9.08	8.29	30.10	21.00	2.81	8	-	-	-
C2A	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:32	8.84	8.54	30.32	21.01	2.40	7	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	11.1	13:52	8.91	8.49	30.54	21.42	2.59	9	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	11.1	13:52	9.14	8.39	30.64	21.41	2.66	8	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Flood	Middle	6.05	13:53	8.51	8.57	30.48	21.34	2.73	9	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Flood	Middle	6.05	13:53	8.99	8.31	30.15	21.22	2.47	8	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:54	8.61	8.59	30.01	21.29	2.81	6	-	-	-
CR1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	13:54	9.04	8.44	30.54	21.40	2.60	5	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Flood	Bottom	10.5	14:05	9.06	8.34	30.05	21.31	3.26	8	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Flood	Bottom	10.5	14:05	9.28	8.34	30.58	21.31	3.64	7	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Flood	Middle	5.75	14:06	9.26	8.58	30.31	21.26	2.48	10	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Flood	Middle	5.75	14:06	9.01	8.42	30.61	21.27	2.85	9	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:07	8.58	8.39	30.14	21.28	2.81	11	-	-	-
CR2	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:07	8.59	8.49	30.13	21.55	2.69	10	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Flood	Bottom	6.8	14:36	8.99	8.26	30.41	21.24	2.94	7	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Flood	Bottom	6.8	14:36	9.05	8.35	30.03	21.61	3.17	6	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Flood	Middle	3.9	14:37	8.42	8.65	30.41	21.54	2.43	6	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Flood	Middle	3.9	14:37	8.88	8.51	30.56	21.61	2.49	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
F1A	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:38	8.58	8.49	30.55	21.59	2.56	6	-	-	-
F1A	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:38	8.41	8.31	30.15	21.37	2.83	5	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	7.1	14:48	9.06	8.59	30.47	21.10	3.58	8	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	7.1	14:48	8.73	8.69	30.46	21.30	3.45	7	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Flood	Middle	4.05	14:49	8.53	8.57	30.48	21.41	3.01	8	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Flood	Middle	4.05	14:49	8.91	8.67	29.91	21.32	2.57	7	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:50	8.85	8.72	29.95	21.08	2.42	6	-	-	-
H1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	14:50	9.06	8.31	29.97	21.48	2.08	7	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	7.1	14:59	9.10	8.79	30.43	21.48	2.80	10	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Flood	Bottom	7.1	14:59	9.06	8.52	30.20	21.13	2.65	9	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Flood	Middle	4.05	15:00	9.10	8.26	30.46	21.29	2.77	9	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Flood	Middle	4.05	15:00	8.52	8.29	30.18	21.16	3.21	8	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	15:01	9.25	8.55	30.26	21.26	3.03	9	-	-	-
M1	20201209	Cloudy	Moderate	Mid-Flood	Surface	1	15:01	9.07	8.45	29.93	21.40	2.76	8	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	3.5	10:33	9.16	8.51	30.82	20.69	3.26	3	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	3.5	10:33	8.84	8.48	30.73	20.75	3.23	4	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	10:34	9.26	8.69	30.88	20.76	3.09	3	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	10:34	8.58	8.68	30.84	20.62	3.17	4	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	4.4	10:13	9.18	8.66	31.07	20.74	2.89	4	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	4.4	10:13	9.36	8.40	30.88	20.73	2.73	5	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	10:14	8.61	8.65	30.97	20.74	2.56	5	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	10:14	9.19	8.67	31.13	20.62	2.97	4	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	4.1	9:54	8.26	8.64	30.57	20.81	3.01	5	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	4.1	9:54	9.05	8.50	30.80	20.56	3.18	4	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:55	9.58	8.41	30.91	20.61	2.41	5	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:55	8.61	8.38	31.01	20.75	2.85	4	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	3.2	9:46	9.40	8.36	30.60	20.80	2.53	3	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	3.2	9:46	8.95	8.61	30.66	20.69	2.60	4	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:47	8.99	8.56	30.74	20.70	2.73	2	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:47	8.69	8.47	31.08	20.72	2.90	3	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C1A	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	9.4	8:34	9.71	8.69	31.24	20.71	3.48	9	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	9.4	8:34	9.26	8.40	31.19	20.46	3.84	10	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Ebb	Middle	5.2	8:35	9.64	8.50	30.93	20.61	2.98	7	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Ebb	Middle	5.2	8:35	8.73	8.59	31.00	20.71	2.70	8	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	8:36	9.47	8.51	30.94	20.62	2.75	7	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	8:36	9.01	8.62	30.94	20.75	2.82	8	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	10.4	9:51	9.24	8.62	30.82	20.71	3.02	3	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	10.4	9:51	9.32	8.58	30.76	20.78	2.91	3	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Ebb	Middle	5.7	9:52	9.33	8.59	31.08	20.56	2.91	3	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Ebb	Middle	5.7	9:52	8.44	8.65	30.96	20.70	2.68	4	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:53	8.56	8.47	30.78	20.56	2.60	4	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:53	8.36	8.54	30.63	20.58	2.86	4	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	11.3	9:29	9.09	8.66	31.27	20.67	3.13	4	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	11.3	9:29	9.69	8.51	30.84	20.66	2.79	5	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Ebb	Middle	6.15	9:30	8.75	8.38	30.79	20.88	3.17	4	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Ebb	Middle	6.15	9:30	9.45	8.68	30.89	20.88	2.78	3	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:31	8.77	8.47	31.03	20.78	2.50	4	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:31	9.18	8.47	31.08	20.74	2.98	4	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	10.8	9:16	8.70	8.42	30.99	20.85	3.69	7	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	10.8	9:16	9.32	8.36	31.17	20.62	3.26	6	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Ebb	Middle	5.9	9:17	8.85	8.68	31.13	20.86	3.46	5	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Ebb	Middle	5.9	9:17	9.14	8.58	31.17	20.66	2.93	5	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:18	9.12	8.64	30.63	20.68	2.59	4	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:18	8.41	8.66	30.85	20.68	2.93	5	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	7.8	9:21	8.48	8.56	30.77	20.87	3.26	4	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	7.8	9:21	8.98	8.67	30.90	20.79	3.42	3	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Ebb	Middle	4.4	9:22	9.65	8.52	31.15	20.85	2.36	5	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Ebb	Middle	4.4	9:22	8.08	8.68	30.60	20.93	2.74	5	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:23	9.39	8.38	30.66	20.79	2.58	6	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:23	8.80	8.65	31.21	20.83	3.08	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
H1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	7.6	8:58	9.00	8.65	30.79	20.59	3.00	4	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	7.6	8:58	8.53	8.66	30.71	20.83	3.30	5	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Ebb	Middle	4.3	8:59	8.80	8.36	31.24	20.75	3.25	4	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Ebb	Middle	4.3	8:59	8.90	8.60	31.09	20.60	2.84	5	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:00	8.67	8.57	30.86	20.60	2.70	3	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:00	9.16	8.63	31.25	20.77	3.16	3	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	8	8:58	8.40	8.51	30.72	20.67	3.15	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Ebb	Bottom	8	8:58	8.71	8.57	31.09	20.83	2.88	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Ebb	Middle	4.5	8:59	8.14	8.53	30.87	20.66	3.13	4	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Ebb	Middle	4.5	8:59	8.90	8.49	30.92	20.65	3.29	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:00	8.55	8.54	30.96	20.79	2.68	3	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Ebb	Surface	1	9:00	9.33	8.44	30.75	20.66	2.70	3	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.9	14:25	9.03	8.54	31.26	20.53	2.77	6	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.9	14:25	9.43	8.41	30.88	20.59	2.64	5	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:26	8.37	8.49	30.84	20.27	2.83	3	-	-	-
B1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:26	9.75	8.54	30.87	20.25	2.41	3	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.4	14:38	9.45	8.43	30.76	20.39	3.11	4	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.4	14:38	8.27	8.66	31.29	20.39	3.58	3	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:39	9.18	8.65	31.07	20.69	3.06	4	-	-	-
B2	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:39	8.54	8.40	31.11	20.57	3.13	3	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.4	14:59	9.18	8.51	31.11	20.35	2.90	3	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.4	14:59	8.51	8.62	31.27	20.40	2.83	4	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:00	9.61	8.70	30.72	20.45	2.79	6	-	-	-
B3	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:00	8.81	8.69	31.33	20.52	3.14	5	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.8	15:07	9.61	8.37	30.70	20.44	2.93	3	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Flood	Bottom	3.8	15:07	8.48	8.67	30.93	20.36	2.75	4	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:08	9.64	8.48	30.69	20.38	2.47	3	-	-	-
B4	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:08	8.62	8.52	30.96	20.47	2.41	3	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Flood	Bottom	9.9	15:18	8.53	8.47	31.23	20.65	3.26	4	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Flood	Bottom	9.9	15:18	9.85	8.48	30.72	20.66	2.96	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C1A	20201212	Cloudy	Moderate	Mid-Flood	Middle	5.45	15:19	9.42	8.58	30.74	20.64	3.50	3	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Flood	Middle	5.45	15:19	9.31	8.58	30.64	20.46	3.13	4	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:20	9.00	8.57	30.82	20.52	2.72	3	-	-	-
C1A	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:20	8.75	8.74	30.79	20.36	2.42	4	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Flood	Bottom	10.9	14:25	9.51	8.38	30.89	20.30	3.74	3	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Flood	Bottom	10.9	14:25	8.19	8.52	30.81	20.45	3.66	3	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Flood	Middle	5.95	14:26	8.26	8.73	31.05	20.34	2.91	3	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Flood	Middle	5.95	14:26	8.57	8.64	31.05	20.58	3.01	4	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:27	9.12	8.38	31.18	20.33	3.30	4	-	-	-
C2A	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:27	9.48	8.49	31.16	20.30	3.12	5	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	11.2	14:46	9.62	8.40	31.28	20.56	3.26	5	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	11.2	14:46	9.88	8.38	31.09	20.53	2.98	6	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Flood	Middle	6.1	14:47	9.36	8.39	31.12	20.50	2.89	4	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Flood	Middle	6.1	14:47	8.74	8.57	31.31	20.45	2.83	3	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:48	9.75	8.73	31.33	20.66	3.20	2	-	-	-
CR1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	14:48	8.86	8.68	31.06	20.56	3.16	3	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Flood	Bottom	10	14:58	8.64	8.73	30.86	20.40	3.25	4	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Flood	Bottom	10	14:58	9.63	8.48	30.93	20.50	3.08	5	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Flood	Middle	5.5	14:59	8.16	8.53	30.94	20.46	3.53	5	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Flood	Middle	5.5	14:59	8.32	8.41	30.73	20.36	3.67	4	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:00	9.87	8.56	31.11	20.43	2.98	2	-	-	-
CR2	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:00	8.38	8.60	31.29	20.51	3.15	3	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Flood	Bottom	7.4	15:29	9.69	8.38	31.30	20.65	3.56	5	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Flood	Bottom	7.4	15:29	8.18	8.69	30.91	20.58	3.16	5	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Flood	Middle	4.2	15:30	9.84	8.48	30.77	20.46	3.25	4	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Flood	Middle	4.2	15:30	8.99	8.63	31.33	20.50	3.17	4	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:31	9.77	8.63	31.27	20.29	2.89	4	-	-	-
F1A	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:31	8.43	8.63	31.08	20.49	2.95	4	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	7.6	15:43	9.23	8.57	30.88	20.28	3.37	5	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	7.6	15:43	8.76	8.68	30.94	20.42	3.13	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
H1	20201212	Cloudy	Moderate	Mid-Flood	Middle	4.3	15:44	8.17	8.70	31.01	20.63	2.63	4	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Flood	Middle	4.3	15:44	9.04	8.58	31.08	20.54	2.26	4	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:45	9.88	8.55	31.03	20.31	3.16	3	-	-	-
H1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:45	8.24	8.74	31.04	20.53	3.20	4	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	7.7	15:53	9.37	8.65	31.28	20.37	2.78	4	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Flood	Bottom	7.7	15:53	9.65	8.57	30.78	20.50	2.63	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Flood	Middle	4.35	15:54	8.68	8.65	31.09	20.53	2.54	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Flood	Middle	4.35	15:54	8.48	8.69	31.30	20.60	2.57	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:55	9.61	8.43	31.30	20.58	2.80	5	-	-	-
M1	20201212	Cloudy	Moderate	Mid-Flood	Surface	1	15:55	8.36	8.66	30.71	20.52	2.88	6	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	12:18	9.03	8.70	30.42	20.96	3.01	6	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	12:18	9.91	8.53	30.89	20.92	3.26	7	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	12:19	9.29	8.48	30.91	21.15	2.46	6	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	12:19	8.86	8.62	30.86	21.14	2.77	7	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	4.5	12:00	8.39	8.66	30.65	21.24	3.27	7	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	4.5	12:00	9.63	8.61	30.66	21.02	2.97	7	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	12:01	8.69	8.50	30.98	21.17	2.93	6	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	12:01	9.10	8.67	31.00	21.17	2.85	6	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	4.3	11:38	9.78	8.70	30.51	21.05	2.97	6	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	4.3	11:38	8.58	8.51	30.70	20.98	3.28	5	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:39	8.76	8.46	30.79	21.15	2.75	6	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:39	9.71	8.43	30.73	21.12	2.75	5	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	3.1	11:28	8.27	8.63	31.07	21.13	3.31	5	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	3.1	11:28	8.71	8.44	30.83	20.96	3.32	6	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:29	8.90	8.68	31.00	20.86	1.95	6	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:29	9.59	8.57	30.51	20.88	2.08	5	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	9.8	10:26	8.90	8.63	30.82	20.99	2.59	12	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	9.8	10:26	8.34	8.67	30.90	20.87	3.00	11	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Ebb	Middle	5.4	10:27	9.34	8.55	30.77	20.94	3.13	10	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Ebb	Middle	5.4	10:27	9.50	8.63	31.03	20.87	3.14	11	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C1A	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	10:28	9.55	8.48	30.91	20.88	2.82	9	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	10:28	8.96	8.45	30.75	20.73	2.48	10	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	10.9	11:41	8.73	8.61	30.45	20.91	2.96	9	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	10.9	11:41	8.19	8.70	30.90	20.85	3.25	9	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Ebb	Middle	5.95	11:42	8.78	8.45	30.80	20.91	2.94	9	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Ebb	Middle	5.95	11:42	8.98	8.54	30.91	21.19	2.79	8	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:43	8.50	8.59	30.81	21.02	2.77	7	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:43	9.04	8.54	30.80	21.17	2.68	8	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	11.5	11:20	9.55	8.49	30.55	21.15	2.56	7	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	11.5	11:20	8.60	8.50	30.80	20.91	2.88	8	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Ebb	Middle	6.25	11:21	8.37	8.68	30.93	20.81	2.48	7	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Ebb	Middle	6.25	11:21	9.67	8.71	30.79	20.84	2.96	8	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:22	9.92	8.59	31.04	20.92	2.90	8	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:22	9.03	8.62	30.86	20.84	2.93	9	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	10.1	11:06	9.64	8.48	30.67	21.10	3.44	7	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	10.1	11:06	9.08	8.49	31.08	20.84	3.17	6	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Ebb	Middle	5.55	11:07	9.31	8.59	30.61	20.87	2.54	7	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Ebb	Middle	5.55	11:07	9.04	8.71	30.66	20.82	2.60	6	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:08	8.92	8.57	30.44	20.82	2.84	7	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:08	9.95	8.44	31.02	21.10	3.01	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	7.4	11:06	9.33	8.55	30.43	21.09	3.51	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	7.4	11:06	9.92	8.47	31.08	20.93	3.07	6	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Ebb	Middle	4.2	11:07	9.54	8.48	30.68	20.92	2.97	6	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Ebb	Middle	4.2	11:07	9.56	8.64	30.64	21.06	2.84	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:08	8.23	8.50	31.06	20.93	2.66	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	11:08	8.39	8.52	30.99	21.07	2.48	8	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	7.7	10:51	9.17	8.58	30.65	20.79	3.30	9	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	7.7	10:51	8.19	8.44	30.81	20.90	3.42	10	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Ebb	Middle	4.35	10:52	9.34	8.59	30.39	21.02	2.40	10	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Ebb	Middle	4.35	10:52	9.87	8.53	30.67	20.89	2.62	10	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
H1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	10:53	9.06	8.63	30.65	20.88	2.38	11	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	10:53	8.39	8.63	30.74	20.94	2.24	10	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	7.8	10:45	9.55	8.65	30.58	20.90	3.62	6	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Ebb	Bottom	7.8	10:45	9.38	8.60	30.78	20.97	3.48	7	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Ebb	Middle	4.4	10:46	8.98	8.67	30.70	20.75	2.95	8	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Ebb	Middle	4.4	10:46	8.71	8.55	31.04	20.98	2.90	9	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	10:47	8.56	8.51	30.89	20.92	1.93	8	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Ebb	Surface	1	10:47	9.88	8.71	30.65	20.81	1.98	9	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	3.6	15:22	8.24	8.34	30.56	20.66	3.58	6	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	3.6	15:22	8.52	8.47	30.66	20.57	3.44	5	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:23	8.33	8.35	30.50	20.75	1.98	3	-	-	-
B1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:23	9.56	8.31	30.32	20.75	2.00	2	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Flood	Bottom	3.7	15:37	8.64	8.49	30.34	20.48	3.38	3	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Flood	Bottom	3.7	15:37	9.35	8.52	30.86	20.62	2.92	2	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:38	9.04	8.27	30.73	20.68	2.82	4	-	-	-
B2	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:38	9.38	8.30	30.20	20.58	3.05	5	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Flood	Bottom	3.6	15:57	9.16	8.30	30.90	20.57	3.58	4	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Flood	Bottom	3.6	15:57	9.49	8.45	30.26	20.57	3.44	3	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:58	8.96	8.58	30.71	20.54	2.04	4	-	-	-
B3	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:58	9.20	8.26	30.27	20.67	2.08	5	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Flood	Bottom	4	16:05	9.35	8.40	30.28	20.64	2.53	4	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Flood	Bottom	4	16:05	8.37	8.57	30.96	20.60	2.69	3	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:06	9.09	8.32	30.96	20.63	2.85	7	-	-	-
B4	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:06	8.76	8.56	30.24	20.59	2.46	6	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Flood	Bottom	9.7	15:22	8.56	8.43	30.46	20.66	3.04	5	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Flood	Bottom	9.7	15:22	8.77	8.34	30.44	20.69	2.59	5	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Flood	Middle	5.35	15:23	8.78	8.50	30.45	20.55	2.98	4	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Flood	Middle	5.35	15:23	8.98	8.41	30.74	20.69	3.21	5	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:24	9.25	8.56	30.76	20.54	2.45	5	-	-	-
C1A	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:24	8.97	8.38	30.30	20.68	2.20	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C2A	20201214	Cloudy	Moderate	Mid-Flood	Bottom	10.2	15:22	8.79	8.49	30.72	20.64	3.44	9	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Flood	Bottom	10.2	15:22	9.13	8.26	30.91	20.72	3.42	8	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Flood	Middle	5.6	15:23	8.25	8.50	30.50	20.71	2.58	7	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Flood	Middle	5.6	15:23	9.26	8.38	30.65	20.54	2.58	8	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:24	8.52	8.53	30.66	20.54	2.69	6	-	-	-
C2A	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:24	8.37	8.53	30.71	20.62	2.89	7	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	11.4	15:42	8.36	8.26	30.55	20.52	3.38	5	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	11.4	15:42	9.54	8.33	30.36	20.56	2.96	5	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Flood	Middle	6.2	15:43	8.91	8.47	30.76	20.63	2.82	4	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Flood	Middle	6.2	15:43	9.46	8.35	30.28	20.57	2.93	4	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:44	9.14	8.48	30.86	20.49	2.73	4	-	-	-
CR1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:44	8.50	8.53	30.42	20.68	2.72	3	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Flood	Bottom	9.9	15:55	8.95	8.32	30.55	20.58	2.63	6	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Flood	Bottom	9.9	15:55	8.49	8.38	30.91	20.55	3.14	5	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Flood	Middle	5.45	15:56	8.97	8.54	30.26	20.48	3.14	5	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Flood	Middle	5.45	15:56	9.49	8.54	30.92	20.44	2.82	4	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:57	8.61	8.28	30.23	20.50	2.55	4	-	-	-
CR2	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	15:57	9.44	8.41	30.62	20.44	2.85	5	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Flood	Bottom	7.8	16:28	9.43	8.33	30.43	20.48	3.58	5	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Flood	Bottom	7.8	16:28	9.28	8.32	30.65	20.46	3.29	6	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Flood	Middle	4.4	16:29	8.55	8.38	30.73	20.40	2.89	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Flood	Middle	4.4	16:29	9.31	8.27	30.53	20.52	3.25	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:30	8.79	8.32	31.00	20.50	2.94	7	-	-	-
F1A	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:30	8.80	8.58	31.00	20.45	2.55	7	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	6.5	16:36	8.80	8.50	30.81	20.48	2.80	9	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	6.5	16:36	9.37	8.57	30.98	20.62	3.27	10	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Flood	Middle	3.75	16:37	9.54	8.28	30.78	20.55	2.99	9	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Flood	Middle	3.75	16:37	9.21	8.59	30.71	20.61	3.29	8	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:38	8.38	8.49	31.00	20.56	3.01	5	-	-	-
H1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:38	8.79	8.36	30.85	20.58	3.10	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
M1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	7.4	16:50	9.00	8.43	30.75	20.22	3.22	7	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Flood	Bottom	7.4	16:50	8.78	8.44	30.70	20.43	2.97	8	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Flood	Middle	4.2	16:51	8.73	8.27	30.46	20.28	2.21	9	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Flood	Middle	4.2	16:51	8.84	8.37	30.43	20.57	2.32	10	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:52	9.16	8.27	30.20	20.51	2.23	9	-	-	-
M1	20201214	Cloudy	Moderate	Mid-Flood	Surface	1	16:52	8.71	8.32	30.27	20.21	2.32	10	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	3.6	10:10	8.32	8.34	30.48	19.27	2.94	8	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	3.6	10:10	9.22	8.44	30.01	19.27	3.02	8	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	10:11	8.68	8.47	30.38	19.36	3.10	8	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	10:11	8.98	8.30	30.80	19.15	3.51	8	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Flood	Bottom	3.6	10:30	8.88	8.46	30.43	19.31	3.44	7	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Flood	Bottom	3.6	10:30	9.63	8.52	30.19	19.36	3.05	8	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	10:31	9.81	8.31	30.08	19.18	2.96	4	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	10:31	9.40	8.38	30.61	19.26	3.10	5	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Flood	Bottom	4.3	9:43	8.56	8.38	30.02	19.14	3.13	4	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Flood	Bottom	4.3	9:43	8.40	8.45	30.69	19.07	3.46	5	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:44	8.89	8.31	30.14	19.33	3.45	8	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:44	8.86	8.41	30.12	19.29	3.48	9	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Flood	Bottom	4	9:35	8.32	8.44	30.08	19.14	2.71	7	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Flood	Bottom	4	9:35	9.63	8.56	30.74	19.43	3.08	7	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:36	9.37	8.47	30.32	19.30	2.83	8	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:36	9.70	8.46	30.03	19.06	3.26	7	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Flood	Bottom	9	8:57	8.57	8.46	30.81	18.87	3.00	9	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Flood	Bottom	9	8:57	9.41	8.35	30.76	18.97	3.01	8	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Flood	Middle	5	8:58	9.93	8.41	30.56	18.93	3.19	7	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Flood	Middle	5	8:58	8.73	8.46	30.82	18.86	3.32	6	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:59	8.48	8.46	30.68	18.87	2.86	5	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:59	9.49	8.42	30.52	19.08	3.17	5	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Flood	Bottom	10	8:00	9.11	8.48	29.97	18.90	4.14	4	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Flood	Bottom	10	8:00	8.92	8.35	30.49	18.81	4.08	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C2A	20201216	Cloudy	Moderate	Mid-Flood	Middle	5.5	8:01	8.60	8.31	30.86	18.97	3.68	6	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Flood	Middle	5.5	8:01	9.80	8.50	30.39	18.80	3.55	5	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:02	9.70	8.35	30.66	19.03	3.01	6	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:02	9.47	8.42	30.30	18.95	3.48	7	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	12.1	8:23	8.62	8.43	30.74	18.96	3.25	7	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	12.1	8:23	9.27	8.45	30.82	18.95	3.78	6	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Flood	Middle	6.55	8:24	8.81	8.46	30.79	18.84	3.66	6	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Flood	Middle	6.55	8:24	8.84	8.49	30.89	18.90	3.15	6	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:25	8.45	8.31	30.54	19.04	3.17	5	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:25	9.16	8.31	29.98	18.84	2.69	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Flood	Bottom	10.9	8:36	8.98	8.33	30.50	18.88	3.55	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Flood	Bottom	10.9	8:36	8.97	8.35	30.63	18.99	3.35	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Flood	Middle	5.95	8:37	9.69	8.43	30.03	18.84	3.78	7	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Flood	Middle	5.95	8:37	9.21	8.41	30.46	18.91	3.76	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:38	9.27	8.54	30.32	18.87	3.24	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:38	9.93	8.34	30.71	18.93	2.93	7	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Flood	Bottom	7.1	9:11	9.93	8.46	30.00	19.10	3.87	6	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Flood	Bottom	7.1	9:11	8.65	8.45	29.99	19.25	3.71	5	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Flood	Middle	4.05	9:12	8.60	8.48	30.90	18.87	2.74	7	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Flood	Middle	4.05	9:12	9.59	8.38	30.93	18.96	3.25	6	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:13	8.85	8.36	30.41	18.87	3.36	7	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:13	8.86	8.40	30.67	19.25	3.05	7	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	7.5	9:22	9.04	8.30	30.74	19.15	3.09	6	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	7.5	9:22	9.36	8.35	30.90	19.28	3.54	7	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Flood	Middle	4.25	9:23	9.36	8.38	30.54	18.97	3.06	8	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Flood	Middle	4.25	9:23	8.60	8.30	30.52	19.09	3.18	7	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:24	9.23	8.41	30.23	19.04	3.42	9	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	9:24	9.89	8.31	30.49	18.99	3.22	9	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	7.4	8:51	9.45	8.37	30.50	19.09	3.01	8	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Flood	Bottom	7.4	8:51	9.79	8.48	30.09	19.03	2.85	9	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
M1	20201216	Cloudy	Moderate	Mid-Flood	Middle	4.2	8:52	8.90	8.55	30.83	18.90	2.96	9	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Flood	Middle	4.2	8:52	9.28	8.52	30.17	18.94	2.64	8	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:53	9.72	8.50	30.39	19.05	2.41	8	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Flood	Surface	1	8:53	9.34	8.52	30.22	19.05	2.41	7	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	12:35	9.77	8.40	30.49	19.42	3.84	9	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	12:35	8.75	8.65	31.02	19.50	3.27	9	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:36	9.95	8.49	30.40	19.52	2.87	9	-	-	-
B1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:36	9.41	8.64	30.86	19.49	3.38	9	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	4.8	12:57	9.78	8.75	30.73	19.44	3.40	7	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	4.8	12:57	8.64	8.36	30.71	19.66	3.52	8	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:58	9.69	8.64	30.31	19.52	2.90	7	-	-	-
B2	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:58	9.76	8.45	30.49	19.59	3.20	6	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	4.3	13:18	8.85	8.55	30.63	19.44	2.75	6	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	4.3	13:18	9.10	8.67	30.29	19.64	2.86	5	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:19	8.99	8.38	30.45	19.36	2.69	8	-	-	-
B3	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:19	9.68	8.57	30.56	19.39	3.17	7	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	3.8	13:26	9.25	8.70	30.57	19.44	2.85	6	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	3.8	13:26	9.50	8.70	30.29	19.53	3.16	6	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:27	10.13	8.64	30.51	19.44	2.28	7	-	-	-
B4	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:27	10.32	8.76	31.03	19.51	2.38	8	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	8.6	12:30	8.81	8.45	30.38	19.24	2.95	9	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	8.6	12:30	10.17	8.74	30.91	19.57	3.40	10	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.8	12:31	8.86	8.68	30.90	19.33	2.68	6	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.8	12:31	9.61	8.75	30.94	19.47	2.75	7	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:32	8.71	8.53	30.55	19.29	3.37	7	-	-	-
C1A	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:32	9.25	8.39	30.78	19.47	3.48	6	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	13:42	8.60	8.69	30.91	19.71	3.62	8	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	13:42	9.11	8.71	30.29	19.46	3.97	8	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Ebb	Middle	5.8	13:43	9.75	8.61	30.81	19.59	2.93	9	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Ebb	Middle	5.8	13:43	10.32	8.54	30.99	19.64	2.62	10	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C2A	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:44	9.38	8.41	30.91	19.65	3.27	9	-	-	-
C2A	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:44	8.76	8.42	30.44	19.64	2.99	10	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	12.3	13:19	9.85	8.60	30.98	19.50	3.22	10	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	12.3	13:19	8.92	8.52	30.50	19.42	3.80	10	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Ebb	Middle	6.65	13:20	9.00	8.73	30.64	19.46	2.79	8	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Ebb	Middle	6.65	13:20	9.75	8.50	30.67	19.48	2.90	7	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:21	9.60	8.57	30.26	19.58	2.47	6	-	-	-
CR1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:21	9.54	8.61	30.48	19.67	2.83	7	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	11.1	13:07	10.23	8.70	30.86	19.51	3.15	5	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	11.1	13:07	9.95	8.68	30.35	19.66	3.10	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Ebb	Middle	6.05	13:08	9.41	8.71	30.87	19.65	3.19	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Ebb	Middle	6.05	13:08	9.37	8.70	30.52	19.54	3.53	6	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:09	9.91	8.65	30.96	19.41	2.57	8	-	-	-
CR2	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:09	9.19	8.56	30.51	19.46	2.97	8	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	8.1	13:49	9.86	8.36	30.75	19.53	3.54	6	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	8.1	13:49	9.33	8.55	30.20	19.47	3.12	7	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.55	13:50	8.78	8.40	31.01	19.61	3.24	7	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.55	13:50	9.29	8.62	30.73	19.44	2.78	7	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:51	9.43	8.41	30.16	19.75	2.93	8	-	-	-
F1A	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	13:51	9.53	8.56	31.09	19.51	3.29	7	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	7.8	12:51	9.46	8.36	30.60	19.40	3.88	7	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	7.8	12:51	10.34	8.63	30.64	19.46	3.38	8	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.4	12:52	9.38	8.62	30.67	19.36	3.27	7	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.4	12:52	8.68	8.59	30.88	19.58	2.88	6	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:53	8.65	8.74	30.22	19.51	2.50	6	-	-	-
H1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	12:53	8.52	8.57	30.58	19.36	2.90	7	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	8.1	14:10	9.99	8.53	30.64	19.74	3.30	6	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Ebb	Bottom	8.1	14:10	9.04	8.62	30.77	19.65	3.90	7	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.55	14:11	9.42	8.55	30.85	19.65	3.16	9	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Ebb	Middle	4.55	14:11	8.77	8.69	30.69	19.58	3.36	9	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
M1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	14:12	9.57	8.58	30.93	19.64	3.24	12	-	-	-
M1	20201216	Cloudy	Moderate	Mid-Ebb	Surface	1	14:12	10.10	8.61	30.29	19.50	3.36	13	-	-	-
B1	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.4	10:10	8.61	8.63	30.37	19.55	2.73	4	-	-	-
B1	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.4	10:10	8.89	8.46	30.43	19.56	2.91	4	-	-	-
B1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	10:11	8.55	8.31	30.69	19.68	2.80	11	-	-	-
B1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	10:11	9.32	8.44	30.44	19.78	2.93	5	-	-	-
B2	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.1	10:28	9.26	8.34	31.24	19.55	3.24	6	-	-	-
B2	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.1	10:28	8.88	8.59	30.95	19.54	3.82	10	-	-	-
B2	20201218	Sunny	Moderate	Mid-Flood	Surface	1	10:29	9.09	8.56	30.84	19.73	2.86	12	-	-	-
B2	20201218	Sunny	Moderate	Mid-Flood	Surface	1	10:29	9.29	8.62	30.49	19.72	3.08	11	-	-	-
B3	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.3	9:48	8.68	8.55	30.42	19.68	3.10	11	-	-	-
B3	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.3	9:48	9.23	8.40	31.21	19.66	3.20	10	-	-	-
B3	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:49	8.96	8.47	30.39	19.57	2.92	9	-	-	-
B3	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:49	9.09	8.40	30.84	19.79	2.68	10	-	-	-
B4	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.3	9:40	9.31	8.61	31.00	19.79	3.41	11	-	-	-
B4	20201218	Sunny	Moderate	Mid-Flood	Bottom	4.3	9:40	9.35	8.57	30.31	19.79	3.63	10	-	-	-
B4	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:41	9.26	8.52	31.16	19.65	2.98	9	-	-	-
B4	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:41	9.23	8.43	30.65	19.75	2.81	9	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Flood	Bottom	9.2	8:54	9.23	8.49	31.18	19.62	3.43	10	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Flood	Bottom	9.2	8:54	8.83	8.51	30.70	19.70	3.04	9	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Flood	Middle	5.1	8:55	8.74	8.34	30.68	19.50	2.99	8	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Flood	Middle	5.1	8:55	9.02	8.52	30.42	19.65	2.83	7	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:56	8.85	8.33	30.54	19.51	3.43	7	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:56	8.99	8.43	30.91	19.47	3.11	6	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Flood	Bottom	10.5	8:00	9.10	8.48	30.48	19.41	3.60	4	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Flood	Bottom	10.5	8:00	8.87	8.43	30.39	19.65	3.93	5	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Flood	Middle	5.75	8:01	9.00	8.54	31.09	19.54	2.45	6	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Flood	Middle	5.75	8:01	9.01	8.59	30.42	19.39	2.54	5	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:02	8.54	8.53	30.17	19.57	2.42	6	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:02	9.34	8.47	30.93	19.61	2.40	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR1	20201218	Sunny	Moderate	Mid-Flood	Bottom	12	8:19	8.79	8.33	30.33	19.59	3.33	5	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Flood	Bottom	12	8:19	8.99	8.55	30.42	19.59	3.33	6	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Flood	Middle	6.5	8:20	9.10	8.55	30.44	19.66	3.00	5	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Flood	Middle	6.5	8:20	8.78	8.58	30.86	19.58	3.13	6	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:21	9.04	8.57	30.43	19.47	3.10	6	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:21	8.54	8.60	30.92	19.66	3.24	7	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Flood	Bottom	10.7	8:34	9.05	8.33	30.64	19.67	3.71	6	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Flood	Bottom	10.7	8:34	9.06	8.50	30.30	19.58	3.77	6	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Flood	Middle	5.85	8:35	9.09	8.63	30.32	19.57	3.26	8	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Flood	Middle	5.85	8:35	8.58	8.55	30.20	19.58	3.44	7	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:36	8.77	8.60	30.78	19.43	3.05	7	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:36	8.92	8.47	31.00	19.48	2.87	8	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Flood	Bottom	7.5	9:16	8.68	8.35	30.21	19.49	3.30	6	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Flood	Bottom	7.5	9:16	8.69	8.45	30.39	19.61	3.05	6	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Flood	Middle	4.25	9:17	9.09	8.37	30.43	19.57	2.63	6	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Flood	Middle	4.25	9:17	8.79	8.55	30.85	19.68	2.38	5	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:18	9.10	8.44	30.45	19.61	3.16	5	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:18	8.94	8.41	30.74	19.46	3.08	4	-	-	-
H1	20201218	Sunny	Moderate	Mid-Flood	Bottom	7.5	9:21	8.54	8.53	30.72	19.52	3.45	5	-	-	-
H1	20201218	Sunny	Moderate	Mid-Flood	Bottom	7.5	9:21	8.80	8.58	30.43	19.50	3.72	4	-	-	-
H1	20201218	Sunny	Moderate	Mid-Flood	Middle	4.25	9:22	8.92	8.38	30.80	19.56	2.66	5	-	-	-
H1	20201218	Sunny	Moderate	Mid-Flood	Middle	4.25	9:22	9.23	8.43	30.99	19.52	2.49	4	-	-	-
H1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:23	9.09	8.44	30.91	19.59	2.70	5	-	-	-
H1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	9:23	9.08	8.36	30.70	19.51	2.41	5	-	-	-
M1	20201218	Sunny	Moderate	Mid-Flood	Bottom	6.4	8:55	8.75	8.56	30.83	19.69	2.79	6	-	-	-
M1	20201218	Sunny	Moderate	Mid-Flood	Bottom	6.4	8:55	9.33	8.51	30.61	19.50	2.67	5	-	-	-
M1	20201218	Sunny	Moderate	Mid-Flood	Middle	3.7	8:56	8.60	8.59	31.07	19.67	2.88	4	-	-	-
M1	20201218	Sunny	Moderate	Mid-Flood	Middle	3.7	8:56	8.81	8.44	30.46	19.45	3.12	5	-	-	-
M1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:57	8.70	8.44	30.67	19.53	2.71	4	-	-	-
M1	20201218	Sunny	Moderate	Mid-Flood	Surface	1	8:57	8.92	8.41	30.22	19.60	2.43	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	3.5	13:17	9.31	8.51	31.01	19.90	2.75	8	-	-	-
B1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	3.5	13:17	9.15	8.30	31.13	20.16	2.68	8	-	-	-
B1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:18	8.91	8.58	30.91	19.94	3.23	6	-	-	-
B1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:18	9.47	8.61	30.78	20.02	3.28	7	-	-	-
B2	20201218	Sunny	Moderate	Mid-Ebb	Bottom	4.7	13:28	9.17	8.31	30.82	20.24	3.64	9	-	-	-
B2	20201218	Sunny	Moderate	Mid-Ebb	Bottom	4.7	13:28	9.42	8.30	30.91	20.18	3.62	8	-	-	-
B2	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:29	8.68	8.51	30.89	20.16	2.29	8	-	-	-
B2	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:29	9.04	8.40	30.65	20.06	2.70	7	-	-	-
B3	20201218	Sunny	Moderate	Mid-Ebb	Bottom	4.1	13:49	8.66	8.33	31.13	20.19	3.63	8	-	-	-
B3	20201218	Sunny	Moderate	Mid-Ebb	Bottom	4.1	13:49	8.56	8.45	31.23	20.31	3.37	8	-	-	-
B3	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:50	9.37	8.36	30.59	20.08	3.27	10	-	-	-
B3	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:50	8.64	8.58	31.12	20.22	3.29	10	-	-	-
B4	20201218	Sunny	Moderate	Mid-Ebb	Bottom	3.7	13:56	9.31	8.55	31.16	20.02	3.48	7	-	-	-
B4	20201218	Sunny	Moderate	Mid-Ebb	Bottom	3.7	13:56	8.62	8.36	30.68	20.19	3.58	8	-	-	-
B4	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:57	9.30	8.32	30.60	20.44	2.32	8	-	-	-
B4	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:57	8.60	8.47	30.68	20.44	2.67	9	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Ebb	Bottom	9.4	13:15	9.28	8.38	31.09	19.99	2.86	7	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Ebb	Bottom	9.4	13:15	9.08	8.54	30.67	20.17	3.03	8	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Ebb	Middle	5.2	13:16	9.33	8.32	31.07	19.89	2.88	8	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Ebb	Middle	5.2	13:16	9.06	8.41	30.66	20.05	2.90	7	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:17	8.90	8.44	31.31	19.99	2.45	7	-	-	-
C1A	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:17	8.70	8.57	30.64	19.90	2.72	7	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Ebb	Bottom	11.1	14:23	8.78	8.45	30.75	20.26	3.65	8	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Ebb	Bottom	11.1	14:23	9.38	8.53	30.88	20.10	3.40	8	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Ebb	Middle	6.05	14:24	9.36	8.55	31.02	20.18	3.54	7	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Ebb	Middle	6.05	14:24	9.33	8.55	31.35	20.32	3.13	8	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:25	9.12	8.42	31.25	20.27	2.96	7	-	-	-
C2A	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:25	9.33	8.60	30.91	20.24	3.39	6	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	12.4	14:02	9.49	8.47	30.59	20.16	3.74	7	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	12.4	14:02	8.65	8.55	31.02	20.11	3.91	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR1	20201218	Sunny	Moderate	Mid-Ebb	Middle	6.7	14:03	8.68	8.43	30.88	20.05	3.38	7	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Ebb	Middle	6.7	14:03	8.56	8.45	31.16	20.24	3.57	7	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:04	8.81	8.30	31.26	20.29	3.11	7	-	-	-
CR1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:04	9.29	8.33	30.70	20.43	2.67	6	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Ebb	Bottom	10.2	13:50	8.83	8.51	30.95	20.04	2.58	9	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Ebb	Bottom	10.2	13:50	9.00	8.38	31.06	19.99	2.81	8	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Ebb	Middle	5.6	13:51	8.91	8.47	30.70	20.12	3.38	8	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Ebb	Middle	5.6	13:51	8.78	8.49	30.83	20.01	3.49	9	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:52	8.56	8.32	30.77	20.23	3.14	8	-	-	-
CR2	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:52	9.09	8.40	31.12	20.34	2.95	7	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Ebb	Bottom	8.1	14:20	9.05	8.54	30.83	20.46	3.27	8	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Ebb	Bottom	8.1	14:20	8.56	8.58	31.34	20.45	3.02	7	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Ebb	Middle	4.55	14:21	9.16	8.31	30.82	20.30	2.76	4	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Ebb	Middle	4.55	14:21	8.58	8.60	30.70	20.27	3.00	5	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:22	8.59	8.43	30.69	20.19	2.60	4	-	-	-
F1A	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:22	9.28	8.52	30.60	20.37	2.78	4	-	-	-
H1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	7.5	13:36	8.76	8.49	30.67	20.07	3.31	5	-	-	-
H1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	7.5	13:36	9.26	8.56	30.67	20.21	3.75	6	-	-	-
H1	20201218	Sunny	Moderate	Mid-Ebb	Middle	4.25	13:37	8.78	8.51	30.89	20.06	2.68	6	-	-	-
H1	20201218	Sunny	Moderate	Mid-Ebb	Middle	4.25	13:37	9.11	8.40	30.61	20.18	3.00	5	-	-	-
H1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:38	9.35	8.38	31.01	20.03	2.53	6	-	-	-
H1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	13:38	9.19	8.33	31.13	20.24	2.66	7	-	-	-
M1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	8.1	14:42	8.89	8.48	31.27	20.22	3.38	5	-	-	-
M1	20201218	Sunny	Moderate	Mid-Ebb	Bottom	8.1	14:42	8.65	8.34	30.90	20.37	2.99	6	-	-	-
M1	20201218	Sunny	Moderate	Mid-Ebb	Middle	4.55	14:43	9.36	8.46	30.93	20.42	2.57	6	-	-	-
M1	20201218	Sunny	Moderate	Mid-Ebb	Middle	4.55	14:43	9.32	8.55	30.92	20.13	2.36	5	-	-	-
M1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:44	8.73	8.36	30.78	20.08	2.63	5	-	-	-
M1	20201218	Sunny	Moderate	Mid-Ebb	Surface	1	14:44	9.26	8.51	31.04	20.23	2.86	5	-	-	-
B1	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.4	11:52	8.34	8.57	30.73	18.91	2.91	5	-	-	-
B1	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.4	11:52	8.74	8.62	30.60	18.90	3.55	6	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:53	8.76	8.53	30.75	19.05	1.99	11	-	-	-
B1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:53	8.83	8.56	31.17	18.90	2.95	5	-	-	-
B2	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.2	11:36	9.18	8.44	30.39	18.79	3.61	5	-	-	-
B2	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.2	11:36	8.62	8.33	30.64	18.94	3.63	6	-	-	-
B2	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:37	8.56	8.37	30.39	19.05	2.27	6	-	-	-
B2	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:37	8.61	8.33	30.49	19.08	2.69	6	-	-	-
B3	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.3	11:19	8.71	8.29	30.55	18.69	3.04	6	-	-	-
B3	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.3	11:19	8.49	8.47	31.13	18.80	3.16	6	-	-	-
B3	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:20	9.26	8.31	30.96	18.74	2.16	7	-	-	-
B3	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:20	8.46	8.57	30.82	18.75	2.61	6	-	-	-
B4	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.2	11:11	8.52	8.62	30.82	18.95	2.51	6	-	-	-
B4	20201220	Sunny	Moderate	Mid-Flood	Bottom	4.2	11:11	9.00	8.43	30.37	18.95	2.96	7	-	-	-
B4	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:12	9.30	8.61	31.02	18.71	2.63	9	-	-	-
B4	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:12	8.33	8.31	31.16	18.98	2.81	10	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Flood	Bottom	10.8	10:46	8.91	8.34	31.06	18.61	3.30	9	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Flood	Bottom	10.8	10:46	8.56	8.21	30.91	18.86	3.34	8	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Flood	Middle	5.9	10:47	8.86	8.34	30.49	18.67	2.35	9	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Flood	Middle	5.9	10:47	8.99	8.28	30.36	18.78	2.89	8	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:48	8.24	8.33	31.09	18.66	3.09	6	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:48	9.12	8.31	31.23	18.90	2.67	7	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Flood	Bottom	10	9:50	9.16	8.61	30.46	18.44	3.04	12	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Flood	Bottom	10	9:50	8.43	8.24	30.92	18.41	2.48	8	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Flood	Middle	5.5	9:51	8.31	8.21	31.24	18.60	3.04	11	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Flood	Middle	5.5	9:51	8.55	8.21	30.57	18.73	2.20	11	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Flood	Surface	1	9:52	9.20	8.57	30.89	18.48	2.67	11	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Flood	Surface	1	9:52	8.46	8.26	31.15	18.54	2.93	11	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Flood	Bottom	11.5	10:14	8.81	8.29	30.92	18.76	2.66	14	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Flood	Bottom	11.5	10:14	8.59	8.43	31.08	18.57	2.64	13	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Flood	Middle	6.25	10:15	9.04	8.29	30.90	18.73	2.64	13	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Flood	Middle	6.25	10:15	8.47	8.36	31.05	18.65	3.03	14	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:16	9.19	8.27	31.01	18.62	2.71	11	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:16	8.80	8.42	30.86	18.76	2.48	11	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Flood	Bottom	10	10:27	8.52	8.49	31.05	18.82	2.74	11	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Flood	Bottom	10	10:27	8.31	8.40	30.73	18.61	2.87	12	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Flood	Middle	5.5	10:28	8.50	8.61	30.83	18.75	3.32	13	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Flood	Middle	5.5	10:28	8.70	8.53	31.21	18.55	2.81	13	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:29	9.04	8.42	30.44	18.55	2.08	13	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:29	8.57	8.37	30.68	18.69	2.52	13	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Flood	Bottom	7.8	10:50	8.86	8.21	31.15	18.84	3.28	11	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Flood	Bottom	7.8	10:50	8.67	8.41	30.47	18.86	3.58	11	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Flood	Middle	4.4	10:51	8.22	8.63	31.23	18.84	3.26	11	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Flood	Middle	4.4	10:51	9.00	8.54	30.81	18.68	2.57	12	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:52	8.85	8.31	30.99	18.67	2.47	8	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:52	8.21	8.33	30.54	18.85	2.79	7	-	-	-
H1	20201220	Sunny	Moderate	Mid-Flood	Bottom	6.8	11:10	8.82	8.52	30.57	18.97	2.52	8	-	-	-
H1	20201220	Sunny	Moderate	Mid-Flood	Bottom	6.8	11:10	8.30	8.51	30.43	18.98	3.04	8	-	-	-
H1	20201220	Sunny	Moderate	Mid-Flood	Middle	3.9	11:11	8.55	8.52	30.73	18.94	3.24	8	-	-	-
H1	20201220	Sunny	Moderate	Mid-Flood	Middle	3.9	11:11	8.81	8.22	30.79	18.67	2.32	8	-	-	-
H1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:12	8.49	8.56	30.57	18.76	2.17	7	-	-	-
H1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	11:12	8.71	8.40	30.65	18.84	2.23	8	-	-	-
M1	20201220	Sunny	Moderate	Mid-Flood	Bottom	7	10:24	9.14	8.53	30.76	18.57	2.98	9	-	-	-
M1	20201220	Sunny	Moderate	Mid-Flood	Bottom	7	10:24	9.24	8.26	30.59	18.59	2.82	9	-	-	-
M1	20201220	Sunny	Moderate	Mid-Flood	Middle	4	10:25	8.24	8.25	31.22	18.65	3.18	9	-	-	-
M1	20201220	Sunny	Moderate	Mid-Flood	Middle	4	10:25	9.20	8.25	30.77	18.56	2.60	9	-	-	-
M1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:26	8.77	8.41	30.72	18.75	2.74	11	-	-	-
M1	20201220	Sunny	Moderate	Mid-Flood	Surface	1	10:26	8.54	8.56	31.01	18.79	2.41	11	-	-	-
B1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	4	15:21	9.16	8.45	31.03	19.78	3.58	8	-	-	-
B1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	4	15:21	8.81	8.50	30.29	20.09	2.94	9	-	-	-
B1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:22	8.61	8.35	31.12	19.83	2.29	7	-	-	-
B1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:22	8.65	8.29	30.68	19.86	2.09	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B2	20201220	Sunny	Moderate	Mid-Ebb	Bottom	4.5	15:34	8.92	8.30	30.61	19.78	3.10	9	-	-	-
B2	20201220	Sunny	Moderate	Mid-Ebb	Bottom	4.5	15:34	9.08	8.49	30.90	20.03	3.00	10	-	-	-
B2	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:35	8.95	8.44	31.09	19.85	2.35	9	-	-	-
B2	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:35	9.14	8.44	30.70	19.93	3.03	9	-	-	-
B3	20201220	Sunny	Moderate	Mid-Ebb	Bottom	3.7	15:53	9.07	8.37	30.94	19.97	3.53	9	-	-	-
B3	20201220	Sunny	Moderate	Mid-Ebb	Bottom	3.7	15:53	8.17	8.32	30.44	19.86	3.11	8	-	-	-
B3	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:54	8.83	8.54	31.00	20.05	3.01	8	-	-	-
B3	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:54	8.35	8.46	31.25	20.05	2.53	9	-	-	-
B4	20201220	Sunny	Moderate	Mid-Ebb	Bottom	3.9	16:01	8.15	8.46	30.80	19.97	3.66	8	-	-	-
B4	20201220	Sunny	Moderate	Mid-Ebb	Bottom	3.9	16:01	8.66	8.43	30.60	19.94	2.58	9	-	-	-
B4	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	16:02	8.72	8.36	30.35	20.09	2.42	9	-	-	-
B4	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	16:02	9.12	8.31	30.43	19.84	2.10	8	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Ebb	Bottom	8.7	15:00	8.68	8.31	30.47	19.86	3.05	12	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Ebb	Bottom	8.7	15:00	9.03	8.38	30.44	19.91	2.90	13	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.85	15:01	8.71	8.42	30.94	20.04	2.63	9	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.85	15:01	8.85	8.45	30.48	20.05	2.78	10	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:02	8.55	8.49	30.96	20.02	2.89	9	-	-	-
C1A	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:02	9.01	8.35	30.28	19.87	2.62	10	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Ebb	Bottom	10.8	15:49	8.97	8.48	30.71	20.01	2.91	10	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Ebb	Bottom	10.8	15:49	9.12	8.31	30.40	20.01	2.66	11	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Ebb	Middle	5.9	15:50	9.04	8.48	30.88	19.78	3.20	12	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Ebb	Middle	5.9	15:50	9.25	8.42	30.97	19.90	2.84	13	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:51	8.62	8.31	31.15	19.73	2.66	12	-	-	-
C2A	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:51	8.47	8.36	30.74	19.93	2.96	13	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	12.3	15:00	9.24	8.45	30.46	19.87	2.63	12	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	12.3	15:00	8.39	8.50	30.35	19.87	3.51	12	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Ebb	Middle	6.65	15:01	8.76	8.38	30.74	20.06	2.72	11	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Ebb	Middle	6.65	15:01	8.57	8.51	30.46	20.01	2.63	10	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:02	8.71	8.32	30.38	20.05	3.09	10	-	-	-
CR1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:02	8.62	8.38	30.27	19.85	2.15	10	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR2	20201220	Sunny	Moderate	Mid-Ebb	Bottom	10.3	15:13	8.79	8.47	31.23	19.92	3.02	10	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Ebb	Bottom	10.3	15:13	8.22	8.45	31.22	20.03	3.09	9	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Ebb	Middle	5.65	15:14	8.18	8.46	31.14	19.80	2.90	9	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Ebb	Middle	5.65	15:14	8.90	8.50	31.32	20.11	3.05	10	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:15	8.65	8.43	30.71	20.03	2.15	10	-	-	-
CR2	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:15	8.35	8.38	31.14	19.88	2.31	11	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Ebb	Bottom	7.3	16:50	8.82	8.33	30.87	20.20	2.67	11	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Ebb	Bottom	7.3	16:50	8.17	8.39	30.20	19.89	2.92	10	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.15	16:51	8.59	8.43	30.49	20.17	2.45	10	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.15	16:51	8.27	8.56	30.97	20.17	3.06	10	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	16:52	8.09	8.46	30.19	20.10	2.88	8	-	-	-
F1A	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	16:52	8.24	8.46	30.41	19.95	2.04	7	-	-	-
H1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	7.4	15:26	8.70	8.41	30.33	20.01	3.02	7	-	-	-
H1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	7.4	15:26	8.65	8.46	31.09	19.80	2.58	8	-	-	-
H1	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.2	15:27	8.76	8.31	30.98	20.13	2.33	7	-	-	-
H1	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.2	15:27	9.27	8.32	30.66	19.99	2.22	8	-	-	-
H1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:28	8.36	8.39	31.01	20.06	2.56	7	-	-	-
H1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	15:28	8.64	8.59	31.10	20.06	2.80	8	-	-	-
M1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	7.9	16:26	9.02	8.42	30.59	20.06	3.51	8	-	-	-
M1	20201220	Sunny	Moderate	Mid-Ebb	Bottom	7.9	16:26	8.95	8.55	31.16	20.21	3.06	8	-	-	-
M1	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.45	16:27	8.54	8.47	31.13	19.90	2.47	8	-	-	-
M1	20201220	Sunny	Moderate	Mid-Ebb	Middle	4.45	16:27	8.99	8.54	30.35	20.14	2.38	9	-	-	-
M1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	16:28	8.34	8.56	30.27	19.88	2.34	9	-	-	-
M1	20201220	Sunny	Moderate	Mid-Ebb	Surface	1	16:28	8.24	8.56	31.21	20.01	2.71	9	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	3.9	10:29	9.15	8.34	30.63	18.76	3.42	6	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	3.9	10:29	9.12	8.62	30.75	18.70	3.02	6	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	10:30	9.22	8.37	30.72	18.89	2.24	6	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	10:30	10.15	8.38	30.98	18.73	2.32	5	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	4.5	10:08	9.13	8.37	30.51	18.66	3.52	6	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	4.5	10:08	8.98	8.39	30.94	18.67	3.46	5	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B2	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	10:09	9.54	8.45	30.56	18.83	3.11	6	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	10:09	9.92	8.45	30.92	18.83	3.16	5	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	9:48	9.27	8.31	30.88	18.65	3.47	10	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	9:48	10.18	8.57	30.99	18.83	3.48	11	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:49	9.46	8.38	30.58	18.75	2.43	7	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:49	9.43	8.42	30.88	18.83	2.85	8	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	3.2	9:42	9.62	8.45	30.76	18.74	2.94	5	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	3.2	9:42	9.54	8.34	30.58	18.75	2.67	4	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:43	10.19	8.41	30.67	18.62	3.08	5	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:43	9.67	8.58	30.45	18.59	3.27	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	10	8:22	9.44	8.42	30.96	18.64	2.77	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	10	8:22	9.28	8.33	30.65	18.49	2.89	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Ebb	Middle	5.5	8:23	10.03	8.62	30.79	18.53	2.96	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Ebb	Middle	5.5	8:23	9.29	8.61	31.02	18.71	2.85	5	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	8:24	10.04	8.55	30.54	18.59	3.13	5	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	8:24	9.42	8.38	30.64	18.69	2.88	6	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	9:36	9.16	8.51	30.46	18.69	3.55	4	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	9:36	9.70	8.37	30.57	18.75	3.48	5	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Ebb	Middle	5.8	9:37	10.01	8.51	30.91	18.70	3.22	5	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Ebb	Middle	5.8	9:37	9.80	8.60	30.54	18.73	3.17	5	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:38	9.19	8.48	30.47	18.61	3.17	7	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:38	9.06	8.36	30.85	18.68	3.36	8	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	12.8	9:13	9.47	8.41	30.93	18.62	2.77	8	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	12.8	9:13	9.46	8.39	30.72	18.57	2.54	7	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Ebb	Middle	6.9	9:14	9.21	8.52	30.48	18.76	2.77	6	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Ebb	Middle	6.9	9:14	9.06	8.41	30.41	18.73	3.02	7	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:15	8.94	8.40	30.78	18.57	2.25	6	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:15	10.22	8.55	30.57	18.71	2.37	6	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	9:00	9.32	8.51	30.76	18.66	3.32	8	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	9:00	9.47	8.40	30.50	18.64	3.27	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR2	20201222	Cloudy	Moderate	Mid-Ebb	Middle	5.8	9:01	9.90	8.34	30.58	18.74	3.37	7	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Ebb	Middle	5.8	9:01	9.02	8.33	30.99	18.64	3.08	6	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:02	9.45	8.42	30.67	18.60	2.42	5	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:02	9.78	8.50	30.86	18.57	2.24	6	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	7.5	9:19	9.43	8.41	30.94	18.81	3.30	8	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	7.5	9:19	10.18	8.39	30.86	18.58	3.46	9	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Ebb	Middle	4.25	9:20	9.34	8.54	31.03	18.79	2.52	7	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Ebb	Middle	4.25	9:20	10.13	8.57	30.86	18.72	2.42	8	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:21	8.94	8.53	30.51	18.66	2.03	5	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:21	8.98	8.39	30.88	18.76	2.11	5	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	7.2	9:46	9.38	8.36	30.84	18.72	2.65	6	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	7.2	9:46	9.14	8.54	30.93	18.61	2.32	6	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Ebb	Middle	4.1	9:47	9.27	8.44	30.45	18.61	3.22	6	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Ebb	Middle	4.1	9:47	9.88	8.39	31.02	18.70	3.28	5	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:48	8.99	8.50	30.75	18.82	3.04	5	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	9:48	10.18	8.39	30.81	18.65	2.79	4	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	8.2	8:56	9.06	8.33	30.98	18.69	2.86	3	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Ebb	Bottom	8.2	8:56	9.86	8.43	30.45	18.57	3.12	4	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Ebb	Middle	4.6	8:57	9.43	8.60	31.01	18.61	2.78	5	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Ebb	Middle	4.6	8:57	9.93	8.44	31.00	18.55	3.02	6	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	8:58	9.05	8.44	30.42	18.65	2.93	6	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Ebb	Surface	1	8:58	9.44	8.41	30.43	18.75	3.12	6	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	4.3	12:38	9.08	8.29	30.76	19.04	3.75	4	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	4.3	12:38	9.61	8.34	30.83	19.07	3.56	4	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	12:39	9.43	8.46	31.05	19.02	2.48	6	-	-	-
B1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	12:39	8.87	8.50	30.98	19.07	2.73	6	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Flood	Bottom	3.5	12:59	9.34	8.32	30.90	19.18	2.81	5	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Flood	Bottom	3.5	12:59	9.43	8.39	30.75	19.22	3.31	5	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:00	9.72	8.42	31.04	19.17	3.05	3	-	-	-
B2	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:00	9.06	8.36	30.60	19.09	3.29	4	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B3	20201222	Cloudy	Moderate	Mid-Flood	Bottom	3.9	13:22	10.01	8.53	30.44	19.07	2.83	4	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Flood	Bottom	3.9	13:22	9.39	8.26	30.53	19.23	2.79	5	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:23	9.89	8.30	30.52	19.13	3.21	7	-	-	-
B3	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:23	9.52	8.53	30.66	19.07	2.98	6	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Flood	Bottom	4.1	13:31	9.31	8.42	30.47	19.29	3.60	4	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Flood	Bottom	4.1	13:31	9.62	8.53	30.75	19.40	3.06	5	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:32	9.76	8.53	31.02	19.33	2.91	4	-	-	-
B4	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:32	9.80	8.54	30.40	19.37	2.70	5	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Flood	Bottom	10	13:25	9.80	8.50	30.39	19.30	3.60	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Flood	Bottom	10	13:25	9.44	8.49	30.60	19.32	3.60	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Flood	Middle	5.5	13:26	9.94	8.52	30.53	19.28	3.58	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Flood	Middle	5.5	13:26	9.37	8.45	30.56	19.34	3.20	6	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:27	9.92	8.54	30.27	19.25	3.29	5	-	-	-
C1A	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:27	9.70	8.45	31.08	19.31	2.84	4	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Flood	Bottom	10.5	12:30	9.61	8.28	30.30	19.22	3.42	7	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Flood	Bottom	10.5	12:30	9.86	8.42	30.92	19.20	3.70	6	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Flood	Middle	5.75	12:31	9.14	8.38	30.98	19.11	3.04	5	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Flood	Middle	5.75	12:31	9.53	8.40	30.56	18.95	2.86	6	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	12:32	9.55	8.37	31.13	19.27	2.81	5	-	-	-
C2A	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	12:32	9.18	8.50	30.62	19.13	3.03	6	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	11.1	12:50	9.28	8.34	30.99	19.03	3.52	11	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	11.1	12:50	8.84	8.43	30.88	19.24	3.74	11	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Flood	Middle	6.05	12:51	8.87	8.46	30.42	19.23	3.43	5	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Flood	Middle	6.05	12:51	8.82	8.40	30.78	19.17	3.16	5	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	12:52	9.42	8.42	30.52	19.01	2.65	4	-	-	-
CR1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	12:52	9.70	8.34	30.34	19.14	2.89	5	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Flood	Bottom	10.5	13:05	9.98	8.47	30.31	19.24	2.81	7	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Flood	Bottom	10.5	13:05	9.32	8.37	31.00	19.32	3.23	7	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Flood	Middle	5.75	13:06	9.18	8.43	30.65	19.08	2.95	5	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Flood	Middle	5.75	13:06	9.33	8.37	31.12	19.10	2.65	6	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
CR2	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:07	9.37	8.51	30.63	19.34	2.57	6	-	-	-
CR2	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:07	9.47	8.41	30.51	19.13	3.00	5	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Flood	Bottom	7	13:55	9.59	8.43	30.80	19.28	3.21	5	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Flood	Bottom	7	13:55	9.85	8.45	30.86	19.21	2.78	5	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Flood	Middle	4	13:56	8.79	8.30	30.65	19.37	2.63	6	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Flood	Middle	4	13:56	8.95	8.42	30.44	19.17	2.46	5	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:57	9.87	8.26	30.28	19.35	3.20	6	-	-	-
F1A	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:57	9.32	8.50	30.42	19.30	2.96	6	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	7.5	13:47	9.16	8.46	30.54	19.18	3.36	4	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	7.5	13:47	8.95	8.49	30.34	19.33	3.74	5	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Flood	Middle	4.25	13:48	9.28	8.49	31.04	19.37	2.97	5	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Flood	Middle	4.25	13:48	8.94	8.33	31.11	19.29	2.74	4	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:49	9.89	8.40	30.40	19.36	2.47	5	-	-	-
H1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	13:49	8.76	8.38	31.02	19.29	2.21	6	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	6.5	14:17	9.31	8.26	30.95	19.40	3.73	5	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Flood	Bottom	6.5	14:17	9.20	8.36	30.82	19.44	3.18	6	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Flood	Middle	3.75	14:18	8.99	8.49	30.31	19.29	2.97	5	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Flood	Middle	3.75	14:18	9.92	8.33	30.54	19.36	3.31	4	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	14:19	9.83	8.42	30.47	19.36	2.56	5	-	-	-
M1	20201222	Cloudy	Moderate	Mid-Flood	Surface	1	14:19	9.78	8.25	30.35	19.26	2.48	4	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	10:21	8.00	8.38	30.67	20.77	2.39	3	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	4.2	10:21	8.16	8.38	31.08	20.87	2.40	3	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	10:22	8.83	8.49	30.44	20.93	2.80	5	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	10:22	8.97	8.41	31.17	20.84	2.69	5	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	4.1	10:03	8.68	8.37	30.53	20.62	3.08	7	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	4.1	10:03	8.12	8.57	30.43	20.92	2.69	7	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	10:04	8.44	8.42	30.42	20.65	2.49	5	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	10:04	8.54	8.31	31.17	20.67	2.61	5	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	9:42	8.45	8.31	30.89	20.85	3.21	4	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	9:42	8.09	8.59	31.03	20.85	2.78	4	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B3	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:43	8.54	8.50	30.80	20.74	2.62	5	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:43	9.19	8.40	30.97	20.67	2.69	6	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	9:34	8.88	8.56	30.79	20.85	2.46	4	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	3.7	9:34	8.21	8.39	31.14	20.65	2.90	4	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:35	8.46	8.56	31.09	20.68	2.76	7	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:35	7.96	8.58	30.41	20.82	2.38	7	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	9.7	8:22	8.03	8.44	30.84	20.71	2.28	6	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	9.7	8:22	8.01	8.52	30.51	20.72	2.45	6	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Ebb	Middle	5.35	8:23	9.00	8.52	30.96	20.46	3.06	6	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Ebb	Middle	5.35	8:23	8.45	8.35	31.04	20.68	2.72	5	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	8:24	8.38	8.43	30.69	20.42	2.43	5	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	8:24	8.01	8.60	30.98	20.73	2.85	5	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	9:35	9.09	8.43	30.89	20.65	3.15	7	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	10.6	9:35	8.82	8.50	30.62	20.89	3.43	7	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Ebb	Middle	5.8	9:36	8.41	8.44	30.63	20.68	2.72	7	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Ebb	Middle	5.8	9:36	8.77	8.47	30.58	20.82	3.04	7	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:37	8.63	8.31	30.61	20.88	2.80	7	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:37	8.74	8.51	30.46	20.82	2.56	7	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	12.3	9:14	8.96	8.46	30.43	20.50	2.74	4	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	12.3	9:14	8.91	8.58	31.17	20.69	3.23	3	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Ebb	Middle	6.65	9:15	9.01	8.46	30.60	20.48	2.99	6	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Ebb	Middle	6.65	9:15	8.42	8.37	30.87	20.78	2.52	6	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:16	8.51	8.48	31.05	20.64	2.97	6	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:16	8.35	8.60	30.63	20.61	2.89	7	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	10.3	9:01	9.20	8.55	31.12	20.56	3.24	4	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	10.3	9:01	8.90	8.48	30.74	20.83	3.34	5	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Ebb	Middle	5.65	9:02	9.04	8.32	30.42	20.83	2.67	5	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Ebb	Middle	5.65	9:02	8.53	8.59	30.74	20.64	2.29	5	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:03	8.24	8.46	30.81	20.53	2.76	7	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:03	9.05	8.39	30.46	20.48	2.59	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
F1A	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	8.2	9:12	8.31	8.46	31.16	20.62	2.96	10	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	8.2	9:12	8.29	8.38	31.01	20.58	2.57	10	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Ebb	Middle	4.6	9:13	7.92	8.52	30.77	20.50	3.06	6	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Ebb	Middle	4.6	9:13	8.49	8.39	30.46	20.81	3.04	7	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:14	9.20	8.59	30.51	20.56	2.33	5	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	9:14	7.97	8.59	30.81	20.58	2.36	5	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	7.4	8:45	8.06	8.53	30.51	20.52	2.60	6	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	7.4	8:45	7.96	8.36	30.63	20.69	2.77	6	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Ebb	Middle	4.2	8:46	8.58	8.55	30.84	20.39	2.67	4	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Ebb	Middle	4.2	8:46	8.77	8.55	30.66	20.50	2.93	3	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	8:47	8.06	8.40	30.67	20.70	2.66	3	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	8:47	8.40	8.60	30.48	20.71	2.24	3	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	8.3	8:49	8.91	8.35	31.16	20.76	2.24	4	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Ebb	Bottom	8.3	8:49	8.06	8.34	30.74	20.68	2.66	4	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Ebb	Middle	4.65	8:50	8.28	8.47	31.11	20.64	2.92	5	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Ebb	Middle	4.65	8:50	8.70	8.41	30.47	20.70	2.64	5	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	8:51	9.19	8.43	30.79	20.57	2.40	6	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Ebb	Surface	1	8:51	8.13	8.47	31.12	20.66	2.35	6	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	4.4	12:58	8.61	8.66	31.10	21.31	2.62	4	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	4.4	12:58	8.48	8.54	31.24	21.17	2.83	5	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	12:59	9.18	8.38	30.71	21.32	2.65	6	-	-	-
B1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	12:59	9.21	8.53	30.49	21.29	2.30	6	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Flood	Bottom	3.6	13:12	9.28	8.48	31.06	21.64	2.60	4	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Flood	Bottom	3.6	13:12	8.59	8.59	31.09	21.41	2.22	4	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:13	8.94	8.46	30.60	21.30	2.08	6	-	-	-
B2	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:13	9.30	8.47	30.69	21.58	2.28	4	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Flood	Bottom	4.1	13:32	8.61	8.55	31.18	21.58	2.22	6	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Flood	Bottom	4.1	13:32	9.41	8.40	30.88	21.68	2.40	6	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:33	8.62	8.61	30.72	21.44	2.24	4	-	-	-
B3	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:33	8.37	8.45	31.12	21.66	2.08	4	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B4	20201224	Cloudy	Moderate	Mid-Flood	Bottom	3.5	13:40	8.63	8.55	31.07	21.57	3.07	4	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Flood	Bottom	3.5	13:40	9.42	8.53	30.59	21.69	3.12	4	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:41	9.06	8.53	30.94	21.54	2.62	5	-	-	-
B4	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:41	9.24	8.67	30.78	21.39	2.28	5	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Flood	Bottom	8.9	13:51	8.73	8.46	30.86	21.39	3.42	8	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Flood	Bottom	8.9	13:51	8.78	8.47	30.39	21.24	3.10	8	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Flood	Middle	4.95	13:52	8.30	8.57	30.92	21.48	2.96	5	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Flood	Middle	4.95	13:52	8.62	8.66	30.63	21.56	3.02	5	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:53	8.90	8.52	30.82	21.44	2.91	3	-	-	-
C1A	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:53	8.54	8.66	30.82	21.42	2.70	3	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Flood	Bottom	10.8	12:58	9.17	8.62	30.68	21.47	3.04	4	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Flood	Bottom	10.8	12:58	8.14	8.45	30.82	21.17	3.63	4	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Flood	Middle	5.9	12:59	8.40	8.42	30.82	21.31	3.20	6	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Flood	Middle	5.9	12:59	8.53	8.63	30.57	21.42	2.92	6	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:00	8.79	8.50	30.46	21.48	2.18	7	-	-	-
C2A	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:00	9.13	8.47	30.86	21.29	2.13	7	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	11.9	13:20	8.16	8.36	30.37	21.36	3.29	7	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	11.9	13:20	8.30	8.56	30.74	21.48	2.94	7	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Flood	Middle	6.45	13:21	8.27	8.55	30.97	21.31	3.18	6	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Flood	Middle	6.45	13:21	9.16	8.62	30.38	21.63	3.16	6	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:22	8.72	8.38	30.62	21.34	3.08	5	-	-	-
CR1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:22	9.02	8.37	30.76	21.63	2.81	5	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Flood	Bottom	9.9	13:32	8.33	8.37	31.06	21.68	2.85	5	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Flood	Bottom	9.9	13:32	8.37	8.47	31.25	21.30	3.17	5	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Flood	Middle	5.45	13:33	9.33	8.35	31.00	21.63	3.16	6	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Flood	Middle	5.45	13:33	8.47	8.53	30.64	21.69	3.02	6	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:34	8.67	8.36	31.05	21.57	2.49	8	-	-	-
CR2	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	13:34	8.39	8.58	30.93	21.45	2.13	7	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Flood	Bottom	6.9	14:39	9.23	8.60	31.12	21.40	3.01	7	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Flood	Bottom	6.9	14:39	8.96	8.63	30.78	21.39	2.93	7	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
F1A	20201224	Cloudy	Moderate	Mid-Flood	Middle	3.95	14:40	8.22	8.50	30.62	21.60	2.11	5	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Flood	Middle	3.95	14:40	8.71	8.45	30.55	21.57	2.34	5	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	14:41	8.62	8.67	30.87	21.53	2.64	3	-	-	-
F1A	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	14:41	9.22	8.57	30.70	21.44	2.58	3	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	7	14:13	8.82	8.48	30.78	21.35	3.14	6	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	7	14:13	8.86	8.62	30.93	21.33	2.70	6	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Flood	Middle	4	14:14	8.58	8.56	31.12	21.59	2.64	4	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Flood	Middle	4	14:14	8.81	8.60	30.90	21.28	2.61	4	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	14:15	8.60	8.60	30.76	21.57	2.63	4	-	-	-
H1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	14:15	9.46	8.59	30.73	21.51	2.94	4	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	7	14:10	8.56	8.49	30.62	21.42	3.15	3	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Flood	Bottom	7	14:10	8.86	8.34	30.77	21.39	2.81	3	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Flood	Middle	4	14:11	9.29	8.67	30.46	21.60	2.06	4	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Flood	Middle	4	14:11	9.38	8.65	30.44	21.33	2.30	4	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	14:12	8.43	8.66	30.55	21.42	2.65	5	-	-	-
M1	20201224	Cloudy	Moderate	Mid-Flood	Surface	1	14:12	9.25	8.43	30.86	21.36	2.89	5	-	-	-
B1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	4.2	11:10	7.89	8.38	29.84	20.81	3.11	6	-	-	-
B1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	4.2	11:10	7.96	8.36	30.57	20.75	2.78	6	-	-	-
B1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	11:11	8.68	8.56	30.28	20.71	2.44	4	-	-	-
B1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	11:11	8.86	8.39	30.15	20.79	2.56	4	-	-	-
B2	20201228	Sunny	Moderate	Mid-Ebb	Bottom	4.7	11:28	8.81	8.35	30.11	20.66	2.83	6	-	-	-
B2	20201228	Sunny	Moderate	Mid-Ebb	Bottom	4.7	11:28	8.67	8.37	30.42	20.57	3.34	6	-	-	-
B2	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	11:29	8.36	8.27	30.23	20.57	3.02	3	-	-	-
B2	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	11:29	8.79	8.46	29.52	20.53	2.99	4	-	-	-
B3	20201228	Sunny	Moderate	Mid-Ebb	Bottom	3.4	10:48	8.48	8.29	29.81	20.69	3.79	3	-	-	-
B3	20201228	Sunny	Moderate	Mid-Ebb	Bottom	3.4	10:48	8.95	8.41	30.13	20.57	3.26	4	-	-	-
B3	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:49	8.20	8.47	30.62	20.49	2.98	3	-	-	-
B3	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:49	8.75	8.31	30.49	20.57	2.78	3	-	-	-
B4	20201228	Sunny	Moderate	Mid-Ebb	Bottom	3.1	10:39	8.20	8.28	29.55	20.37	2.99	6	-	-	-
B4	20201228	Sunny	Moderate	Mid-Ebb	Bottom	3.1	10:39	8.07	8.56	30.37	20.35	3.01	6	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
B4	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:40	8.24	8.48	29.93	20.23	3.01	4	-	-	-
B4	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:40	8.87	8.36	29.55	20.57	2.81	4	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Ebb	Bottom	8.6	9:18	8.04	8.54	29.78	20.44	3.56	3	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Ebb	Bottom	8.6	9:18	7.87	8.46	30.14	20.52	3.46	3	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.8	9:19	8.16	8.56	30.51	20.69	3.34	3	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.8	9:19	8.05	8.41	30.52	20.42	3.25	2	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	9:20	8.53	8.32	30.41	20.51	2.76	2	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	9:20	8.81	8.47	30.26	20.58	3.07	2	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Ebb	Bottom	11.4	10:35	9.09	8.53	29.61	20.36	3.81	4	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Ebb	Bottom	11.4	10:35	9.09	8.44	30.53	20.64	3.38	4	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Ebb	Middle	6.2	10:36	8.38	8.54	30.20	20.48	3.25	5	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Ebb	Middle	6.2	10:36	8.81	8.36	29.71	20.61	2.93	6	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:37	9.12	8.37	30.25	20.33	2.33	6	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:37	9.08	8.41	29.87	20.69	2.38	6	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	11.6	10:14	7.97	8.35	30.23	20.69	3.46	7	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	11.6	10:14	8.15	8.47	29.92	20.55	3.92	7	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Ebb	Middle	6.3	10:15	8.55	8.40	29.53	20.22	2.97	6	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Ebb	Middle	6.3	10:15	8.93	8.32	30.34	20.25	3.18	6	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:16	8.10	8.32	30.41	20.22	2.40	6	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:16	8.15	8.56	29.54	20.34	2.53	5	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Ebb	Bottom	10.4	10:00	8.40	8.44	29.86	20.66	2.76	5	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Ebb	Bottom	10.4	10:00	8.83	8.40	30.51	20.74	2.95	4	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Ebb	Middle	5.7	10:01	7.84	8.27	30.52	20.43	3.28	3	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Ebb	Middle	5.7	10:01	8.63	8.56	30.47	20.54	2.82	3	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:02	8.84	8.48	30.32	20.63	3.04	3	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:02	8.44	8.36	30.43	20.50	3.42	3	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Ebb	Bottom	7.6	9:54	7.97	8.65	30.32	20.69	3.15	2	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Ebb	Bottom	7.6	9:54	8.35	8.32	30.07	20.56	3.12	2	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.3	9:55	8.19	8.44	30.30	20.60	2.84	3	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.3	9:55	9.34	8.57	30.29	20.51	2.75	3	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
F1A	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	9:56	8.18	8.54	30.37	20.63	2.56	4	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	9:56	7.96	8.27	30.01	20.69	2.93	4	-	-	-
H1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	7.7	9:45	8.03	8.35	30.33	20.62	3.17	9	-	-	-
H1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	7.7	9:45	8.31	8.56	30.04	20.51	3.15	9	-	-	-
H1	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.35	9:46	8.64	8.36	30.30	20.44	2.96	5	-	-	-
H1	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.35	9:46	8.95	8.58	29.76	20.63	3.23	5	-	-	-
H1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	9:47	8.72	8.33	30.41	20.69	2.92	3	-	-	-
H1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	9:47	8.04	8.51	30.47	20.58	3.31	3	-	-	-
M1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	8.3	10:15	8.36	8.31	30.57	20.76	3.85	4	-	-	-
M1	20201228	Sunny	Moderate	Mid-Ebb	Bottom	8.3	10:15	8.28	8.41	29.74	20.46	3.28	4	-	-	-
M1	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.65	10:16	8.70	8.55	30.06	20.21	3.14	6	-	-	-
M1	20201228	Sunny	Moderate	Mid-Ebb	Middle	4.65	10:16	8.73	8.39	29.91	20.51	2.91	5	-	-	-
M1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:17	8.55	8.28	30.49	20.42	2.90	7	-	-	-
M1	20201228	Sunny	Moderate	Mid-Ebb	Surface	1	10:17	8.30	8.33	29.86	20.60	3.22	7	-	-	-
B1	20201228	Sunny	Moderate	Mid-Flood	Bottom	3.8	14:42	8.44	8.62	30.55	21.34	3.13	4	-	-	-
B1	20201228	Sunny	Moderate	Mid-Flood	Bottom	3.8	14:42	8.60	8.38	30.50	21.47	3.17	4	-	-	-
B1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	14:43	8.66	8.55	30.86	21.15	3.18	5	-	-	-
B1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	14:43	8.35	8.43	30.03	21.38	2.66	6	-	-	-
B2	20201228	Sunny	Moderate	Mid-Flood	Bottom	3.5	14:56	8.71	8.41	29.91	21.44	3.49	4	-	-	-
B2	20201228	Sunny	Moderate	Mid-Flood	Bottom	3.5	14:56	8.69	8.44	30.70	21.43	3.54	3	-	-	-
B2	20201228	Sunny	Moderate	Mid-Flood	Surface	1	14:57	8.29	8.43	29.97	21.31	3.39	5	-	-	-
B2	20201228	Sunny	Moderate	Mid-Flood	Surface	1	14:57	8.30	8.39	29.88	21.50	2.88	5	-	-	-
B3	20201228	Sunny	Moderate	Mid-Flood	Bottom	3.9	15:18	8.91	8.47	30.35	21.07	3.17	5	-	-	-
B3	20201228	Sunny	Moderate	Mid-Flood	Bottom	3.9	15:18	8.99	8.53	29.59	21.35	3.62	5	-	-	-
B3	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:19	8.79	8.51	30.04	21.25	3.17	5	-	-	-
B3	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:19	9.15	8.32	30.53	21.33	2.93	5	-	-	-
B4	20201228	Sunny	Moderate	Mid-Flood	Bottom	4.3	15:26	8.24	8.40	30.61	21.34	3.11	4	-	-	-
B4	20201228	Sunny	Moderate	Mid-Flood	Bottom	4.3	15:26	8.17	8.59	30.57	21.47	3.61	4	-	-	-
B4	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:27	8.58	8.55	30.36	21.15	2.59	4	-	-	-
B4	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:27	9.08	8.52	29.53	21.47	2.80	4	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C1A	20201228	Sunny	Moderate	Mid-Flood	Bottom	8.9	15:38	8.92	8.61	30.03	21.06	3.09	6	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Flood	Bottom	8.9	15:38	8.16	8.61	29.84	21.51	3.10	7	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Flood	Middle	4.95	15:39	8.31	8.36	30.28	20.99	2.97	5	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Flood	Middle	4.95	15:39	8.49	8.35	29.77	21.51	3.09	4	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:40	8.71	8.31	30.28	20.97	3.17	4	-	-	-
C1A	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:40	8.95	8.56	29.85	21.29	2.91	3	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Flood	Bottom	10.5	14:42	8.98	8.43	30.05	21.51	3.87	4	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Flood	Bottom	10.5	14:42	8.81	8.47	30.40	21.43	3.80	4	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Flood	Middle	5.75	14:43	8.68	8.57	30.09	21.35	3.25	4	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Flood	Middle	5.75	14:43	8.28	8.49	30.39	21.56	2.71	4	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Flood	Surface	1	14:44	8.29	8.46	30.25	21.24	2.46	5	-	-	-
C2A	20201228	Sunny	Moderate	Mid-Flood	Surface	1	14:44	9.12	8.33	30.82	21.44	2.78	5	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Flood	Bottom	11.8	15:04	8.30	8.35	29.61	21.40	3.75	5	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Flood	Bottom	11.8	15:04	8.64	8.52	30.72	21.51	3.88	5	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Flood	Middle	6.4	15:05	8.78	8.46	30.48	21.32	2.82	4	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Flood	Middle	6.4	15:05	8.97	8.53	30.10	21.31	3.26	4	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:06	8.71	8.49	30.23	21.28	2.94	4	-	-	-
CR1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:06	8.62	8.62	30.37	21.18	2.56	4	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Flood	Bottom	10.4	15:19	8.10	8.59	29.87	21.54	3.42	3	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Flood	Bottom	10.4	15:19	8.87	8.43	29.95	21.50	3.53	3	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Flood	Middle	5.7	15:20	8.57	8.41	30.61	21.16	2.69	4	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Flood	Middle	5.7	15:20	8.37	8.40	29.94	21.43	3.21	4	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:21	8.63	8.48	30.36	21.44	2.53	5	-	-	-
CR2	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:21	8.90	8.43	30.39	21.51	2.37	5	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Flood	Bottom	6.7	16:15	8.67	8.49	29.86	20.81	2.83	6	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Flood	Bottom	6.7	16:15	8.90	8.32	30.83	21.31	2.88	6	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Flood	Middle	3.85	16:16	9.02	8.54	29.78	21.25	2.95	6	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Flood	Middle	3.85	16:16	8.27	8.47	30.73	20.96	2.69	6	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Flood	Surface	1	16:17	9.03	8.47	29.70	20.74	2.64	4	-	-	-
F1A	20201228	Sunny	Moderate	Mid-Flood	Surface	1	16:17	8.26	8.57	30.74	20.95	2.83	4	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
H1	20201228	Sunny	Moderate	Mid-Flood	Bottom	6.6	16:03	8.87	8.55	29.69	21.14	3.17	6	-	-	-
H1	20201228	Sunny	Moderate	Mid-Flood	Bottom	6.6	16:03	8.43	8.35	29.98	21.18	2.86	6	-	-	-
H1	20201228	Sunny	Moderate	Mid-Flood	Middle	3.8	16:04	8.44	8.31	30.47	21.09	2.98	4	-	-	-
H1	20201228	Sunny	Moderate	Mid-Flood	Middle	3.8	16:04	8.22	8.36	30.28	20.91	3.34	4	-	-	-
H1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	16:05	8.39	8.59	30.43	21.34	3.27	3	-	-	-
H1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	16:05	8.50	8.49	29.56	21.20	2.90	3	-	-	-
M1	20201228	Sunny	Moderate	Mid-Flood	Bottom	6.5	15:55	8.52	8.46	29.76	20.93	3.75	5	-	-	-
M1	20201228	Sunny	Moderate	Mid-Flood	Bottom	6.5	15:55	8.86	8.35	30.37	21.01	3.88	5	-	-	-
M1	20201228	Sunny	Moderate	Mid-Flood	Middle	3.75	15:56	8.33	8.45	30.32	21.18	3.19	4	-	-	-
M1	20201228	Sunny	Moderate	Mid-Flood	Middle	3.75	15:56	8.36	8.51	30.52	21.30	3.30	4	-	-	-
M1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:57	8.63	8.51	30.35	21.30	2.93	2	-	-	-
M1	20201228	Sunny	Moderate	Mid-Flood	Surface	1	15:57	8.62	8.54	30.80	21.11	3.07	3	-	-	-
B1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	3.9	12:18	8.59	8.37	30.33	18.82	3.21	8	-	-	-
B1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	3.9	12:18	9.49	8.55	30.30	19.04	2.80	8	-	-	-
B1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	12:19	9.13	8.63	30.36	18.94	2.97	7	-	-	-
B1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	12:19	8.97	8.40	30.33	18.98	2.57	7	-	-	-
B2	20201230	Sunny	Moderate	Mid-Ebb	Bottom	4.1	12:30	8.49	8.54	31.16	19.03	2.89	8	-	-	-
B2	20201230	Sunny	Moderate	Mid-Ebb	Bottom	4.1	12:30	9.17	8.40	30.76	18.78	2.64	7	-	-	-
B2	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	12:31	9.12	8.54	31.08	18.90	2.89	9	-	-	-
B2	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	12:31	9.31	8.49	30.33	19.01	2.46	9	-	-	-
B3	20201230	Sunny	Moderate	Mid-Ebb	Bottom	4	11:55	8.88	8.58	30.40	18.80	2.72	8	-	-	-
B3	20201230	Sunny	Moderate	Mid-Ebb	Bottom	4	11:55	9.32	8.45	30.63	18.97	2.98	7	-	-	-
B3	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:56	8.68	8.48	31.00	18.99	2.29	7	-	-	-
B3	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:56	9.04	8.52	30.84	18.78	2.12	8	-	-	-
B4	20201230	Sunny	Moderate	Mid-Ebb	Bottom	3.7	11:47	9.36	8.53	30.52	18.84	2.99	6	-	-	-
B4	20201230	Sunny	Moderate	Mid-Ebb	Bottom	3.7	11:47	8.41	8.41	30.93	19.00	2.83	7	-	-	-
B4	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:48	8.43	8.37	30.54	18.95	2.72	7	-	-	-
B4	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:48	9.32	8.54	30.32	18.91	3.06	7	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Ebb	Bottom	8.7	10:15	8.95	8.63	30.26	18.45	3.46	7	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Ebb	Bottom	8.7	10:15	8.93	8.65	30.47	18.54	2.89	8	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C1A	20201230	Sunny	Moderate	Mid-Ebb	Middle	4.85	10:16	8.70	8.44	30.93	18.64	3.42	7	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Ebb	Middle	4.85	10:16	8.89	8.68	30.67	18.49	2.94	8	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	10:17	8.87	8.54	30.36	18.67	3.28	11	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	10:17	9.53	8.67	31.23	18.72	2.80	11	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Ebb	Bottom	10.4	11:30	8.47	8.43	30.80	18.76	2.76	11	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Ebb	Bottom	10.4	11:30	9.30	8.57	30.26	18.70	3.09	10	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Ebb	Middle	5.7	11:31	8.76	8.42	30.63	18.76	3.16	8	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Ebb	Middle	5.7	11:31	9.17	8.45	31.13	18.86	3.26	9	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:32	9.54	8.63	30.60	18.90	3.30	9	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:32	8.59	8.54	31.17	18.87	2.94	8	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	11.3	11:06	8.93	8.65	31.18	18.71	3.15	11	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	11.3	11:06	9.34	8.61	30.33	18.77	2.98	10	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Ebb	Middle	6.15	11:07	8.58	8.41	30.26	18.64	2.80	11	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Ebb	Middle	6.15	11:07	9.35	8.45	30.85	18.88	3.23	10	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:08	9.44	8.40	31.22	18.78	3.02	12	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:08	8.77	8.61	31.27	18.70	2.65	12	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Ebb	Bottom	10.3	10:53	8.58	8.41	30.42	18.78	2.88	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Ebb	Bottom	10.3	10:53	9.15	8.66	30.22	18.89	2.92	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Ebb	Middle	5.65	10:54	9.60	8.38	30.91	18.66	3.29	8	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Ebb	Middle	5.65	10:54	8.54	8.44	30.97	18.57	3.27	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	10:55	9.29	8.39	30.26	18.71	2.88	7	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	10:55	9.08	8.49	30.45	18.61	2.65	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Ebb	Bottom	6.9	11:26	9.23	8.60	30.28	18.75	3.13	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Ebb	Bottom	6.9	11:26	9.53	8.57	30.87	18.94	2.92	9	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Ebb	Middle	3.95	11:27	9.42	8.67	30.26	18.79	3.08	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Ebb	Middle	3.95	11:27	8.61	8.58	30.47	18.93	2.82	7	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:28	9.09	8.50	30.66	18.66	2.26	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:28	9.12	8.51	30.19	18.77	2.67	7	-	-	-
H1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	6.8	10:39	8.30	8.45	30.55	18.57	3.02	11	-	-	-
H1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	6.8	10:39	8.42	8.58	31.02	18.74	2.68	10	-	-	-

Integrated Waste Management Facilities, Phase 1

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
H1	20201230	Sunny	Moderate	Mid-Ebb	Middle	3.9	10:40	8.56	8.52	30.91	18.54	2.50	10	-	-	-
H1	20201230	Sunny	Moderate	Mid-Ebb	Middle	3.9	10:40	8.44	8.41	30.78	18.60	2.77	10	-	-	-
H1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	10:41	8.62	8.44	30.41	18.53	3.29	9	-	-	-
H1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	10:41	8.65	8.40	30.33	18.66	2.95	9	-	-	-
M1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	8.6	11:04	9.19	8.61	30.19	18.68	3.20	8	-	-	-
M1	20201230	Sunny	Moderate	Mid-Ebb	Bottom	8.6	11:04	8.83	8.52	30.72	18.85	2.71	8	-	-	-
M1	20201230	Sunny	Moderate	Mid-Ebb	Middle	4.8	11:05	9.19	8.66	31.17	18.74	3.35	9	-	-	-
M1	20201230	Sunny	Moderate	Mid-Ebb	Middle	4.8	11:05	9.28	8.39	30.77	18.70	3.37	10	-	-	-
M1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:06	8.52	8.41	30.69	18.71	2.81	10	-	-	-
M1	20201230	Sunny	Moderate	Mid-Ebb	Surface	1	11:06	8.37	8.52	30.41	18.87	3.20	9	-	-	-
B1	20201230	Sunny	Moderate	Mid-Flood	Bottom	4.3	15:32	7.45	8.27	30.44	19.69	3.00	6	-	-	-
B1	20201230	Sunny	Moderate	Mid-Flood	Bottom	4.3	15:32	6.65	8.08	30.21	19.76	3.11	7	-	-	-
B1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:33	7.76	8.30	30.80	19.73	2.67	7	-	-	-
B1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:33	7.41	8.15	30.83	19.52	2.36	7	-	-	-
B2	20201230	Sunny	Moderate	Mid-Flood	Bottom	4	15:51	7.61	8.28	30.68	19.69	3.35	7	-	-	-
B2	20201230	Sunny	Moderate	Mid-Flood	Bottom	4	15:51	6.32	8.49	30.52	19.56	3.48	7	-	-	-
B2	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:52	6.68	8.42	30.70	19.62	2.73	6	-	-	-
B2	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:52	7.47	8.44	30.94	19.59	3.00	7	-	-	-
B3	20201230	Sunny	Moderate	Mid-Flood	Bottom	4	16:07	6.61	8.38	30.33	19.58	2.89	7	-	-	-
B3	20201230	Sunny	Moderate	Mid-Flood	Bottom	4	16:07	6.95	8.12	30.94	19.32	2.95	8	-	-	-
B3	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:08	7.91	8.42	30.68	19.70	2.65	7	-	-	-
B3	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:08	7.49	8.18	30.79	19.42	3.08	8	-	-	-
B4	20201230	Sunny	Moderate	Mid-Flood	Bottom	4.4	16:15	6.87	8.05	30.37	19.66	3.14	7	-	-	-
B4	20201230	Sunny	Moderate	Mid-Flood	Bottom	4.4	16:15	7.66	8.40	30.52	19.37	3.62	8	-	-	-
B4	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:16	7.08	8.38	30.60	19.60	2.89	8	-	-	-
B4	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:16	7.66	8.22	30.39	19.79	2.83	9	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Flood	Bottom	9.1	16:22	6.53	8.21	30.30	19.60	3.11	8	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Flood	Bottom	9.1	16:22	6.64	8.42	30.59	19.54	3.39	7	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Flood	Middle	5.05	16:23	7.96	8.14	30.74	19.50	3.27	8	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Flood	Middle	5.05	16:23	6.48	8.47	30.28	19.34	3.24	7	-	-	-

Integrated Waste Management Facilities, Phase 1


Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
C1A	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:24	7.91	8.30	31.00	19.32	3.18	8	-	-	-
C1A	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:24	6.77	8.32	30.74	19.44	2.86	7	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Flood	Bottom	10.5	15:30	8.64	8.45	30.59	19.43	3.16	7	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Flood	Bottom	10.5	15:30	7.62	8.13	30.20	19.54	2.86	8	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Flood	Middle	5.75	15:31	8.01	8.15	30.93	19.62	3.04	8	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Flood	Middle	5.75	15:31	7.00	8.36	30.90	19.67	2.86	9	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:32	6.74	8.37	30.50	19.71	3.14	10	-	-	-
C2A	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:32	7.42	8.26	30.25	19.65	3.36	9	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Flood	Bottom	12.1	15:50	6.63	8.24	30.34	19.37	3.35	8	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Flood	Bottom	12.1	15:50	7.50	8.11	30.27	19.40	3.31	9	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Flood	Middle	6.55	15:51	7.03	8.11	30.86	19.47	2.82	8	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Flood	Middle	6.55	15:51	6.74	8.26	30.41	19.62	2.41	9	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:52	6.55	8.06	30.44	19.67	2.85	9	-	-	-
CR1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	15:52	7.53	8.23	30.34	19.34	2.73	10	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Flood	Bottom	10	16:03	6.35	8.06	31.03	19.36	3.41	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Flood	Bottom	10	16:03	7.76	8.49	30.70	19.57	3.14	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Flood	Middle	5.5	16:04	6.90	8.06	30.61	19.71	3.11	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Flood	Middle	5.5	16:04	7.04	8.12	30.66	19.42	3.37	9	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:05	6.89	8.14	30.68	19.56	2.45	7	-	-	-
CR2	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:05	7.68	8.09	30.81	19.61	2.49	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Flood	Bottom	7.6	17:00	7.14	8.20	30.27	19.38	3.31	7	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Flood	Bottom	7.6	17:00	6.24	8.44	30.51	19.29	3.73	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Flood	Middle	4.3	17:01	6.55	8.35	30.22	19.45	2.84	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Flood	Middle	4.3	17:01	6.48	8.32	30.64	19.29	2.92	9	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Flood	Surface	1	17:02	7.17	8.19	30.94	19.16	3.27	8	-	-	-
F1A	20201230	Sunny	Moderate	Mid-Flood	Surface	1	17:02	7.58	8.13	30.38	19.46	3.02	9	-	-	-
H1	20201230	Sunny	Moderate	Mid-Flood	Bottom	6.8	16:46	7.30	8.30	30.37	19.16	3.40	9	-	-	-
H1	20201230	Sunny	Moderate	Mid-Flood	Bottom	6.8	16:46	7.34	8.45	30.68	19.22	2.94	8	-	-	-
H1	20201230	Sunny	Moderate	Mid-Flood	Middle	3.9	16:47	6.56	8.22	30.38	19.45	3.06	8	-	-	-
H1	20201230	Sunny	Moderate	Mid-Flood	Middle	3.9	16:47	7.08	8.36	30.37	19.46	3.44	9	-	-	-

Location	Date (YYYYMMDD)	Weather	Sea Condition	Tidal	Water Level	Depth (m)	Time (hh:mm)	DO (mg/L)	pH	Sal (ppt)	Temp (°C)	Turbidity (NTU) note 1	SS (mg/L)	Total Alkalinity (mg/L)	Current Velocity (m/s)	Direction in NESW
H1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:48	6.67	8.48	30.63	19.37	2.89	7	-	-	-
H1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:48	7.85	8.30	30.21	19.10	3.22	8	-	-	-
M1	20201230	Sunny	Moderate	Mid-Flood	Bottom	7.1	16:41	7.99	8.07	30.79	19.52	3.36	8	-	-	-
M1	20201230	Sunny	Moderate	Mid-Flood	Bottom	7.1	16:41	6.75	8.25	30.25	19.22	2.86	9	-	-	-
M1	20201230	Sunny	Moderate	Mid-Flood	Middle	4.05	16:42	6.64	8.40	31.00	19.15	2.63	8	-	-	-
M1	20201230	Sunny	Moderate	Mid-Flood	Middle	4.05	16:42	7.18	8.46	30.24	19.43	2.87	9	-	-	-
M1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:43	6.56	8.39	30.68	19.13	2.44	11	-	-	-
M1	20201230	Sunny	Moderate	Mid-Flood	Surface	1	16:43	7.23	8.27	30.80	19.24	2.16	10	-	-	-

Remark


Note 1: Measurements of turbidity would be rounding to 0.1 NTU for proven accuracy as per the equipment specs during utilization of data.

Dissolved Oxygen (Surface & Middle) during MID-FLOOD

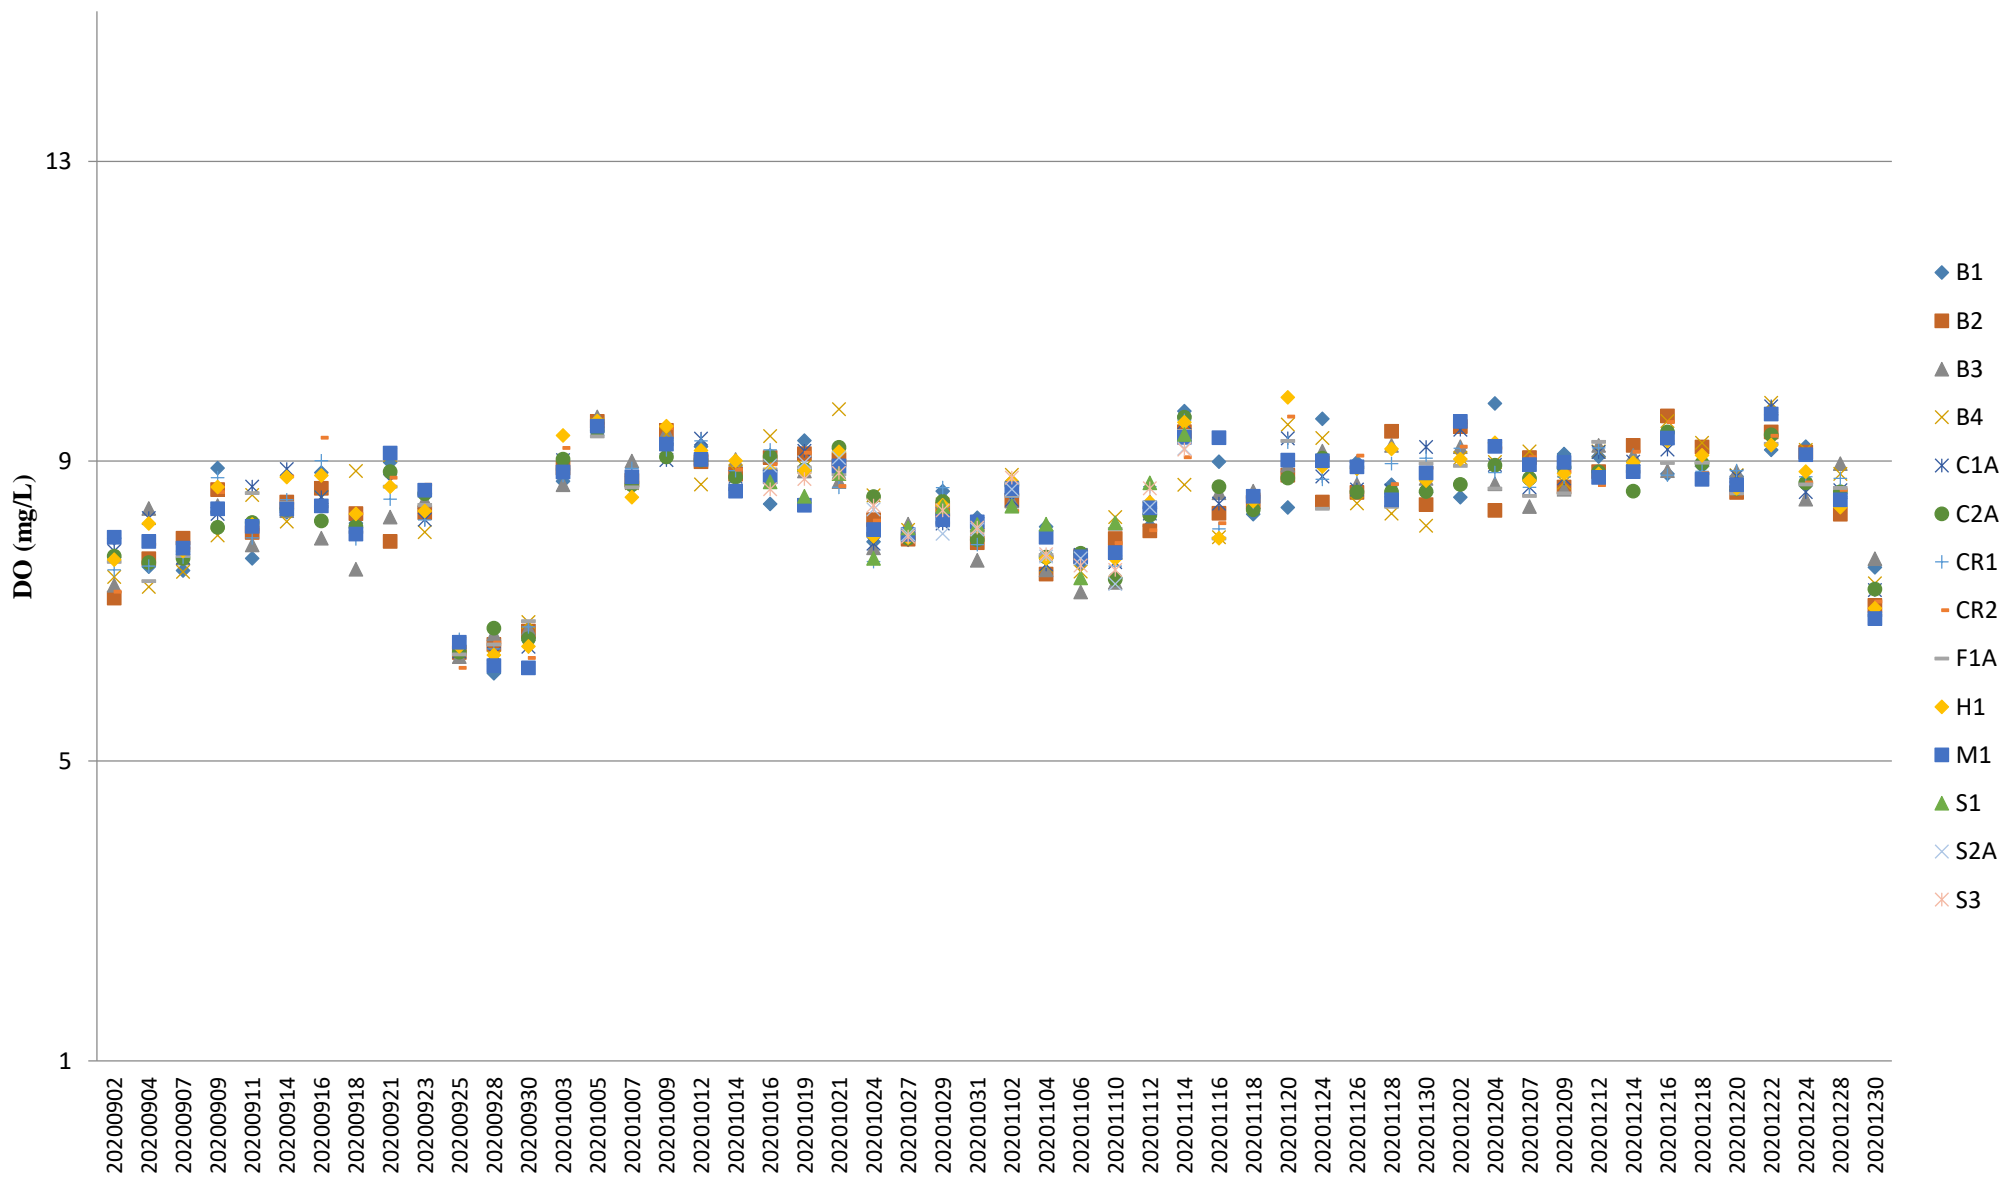


Note: The Action and Limit Level of dissolved oxygen can be referred to **Table 2.8** of the monthly EM&A report.

Dissolved Oxygen (Surface & Middle) during MID-EBB

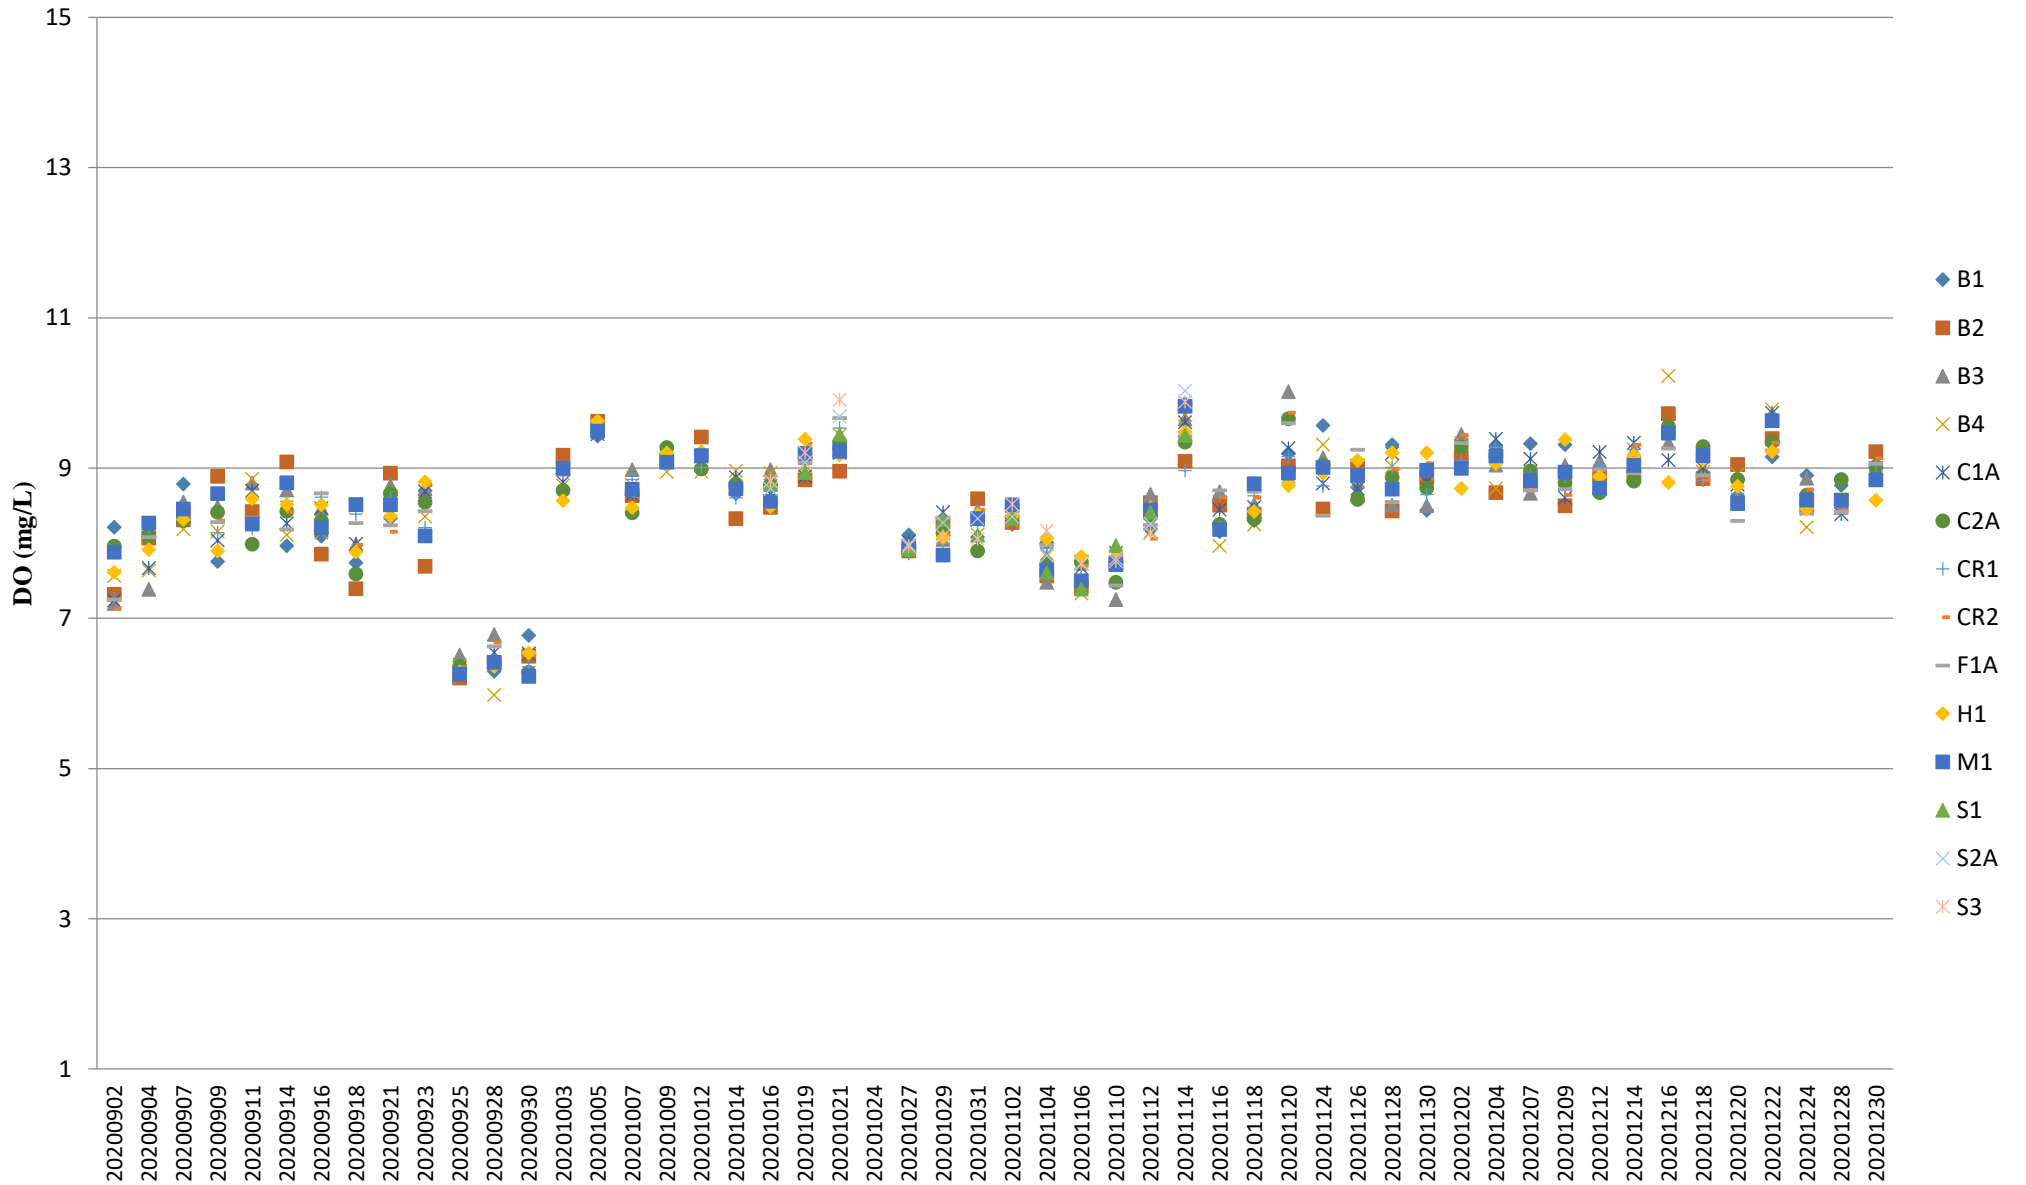


Note: The Action and Limit Level of dissolved oxygen can be referred to **Table 2.8** of the monthly EM&A report.

Dissolved Oxygen (Bottom) during MID-FLOOD

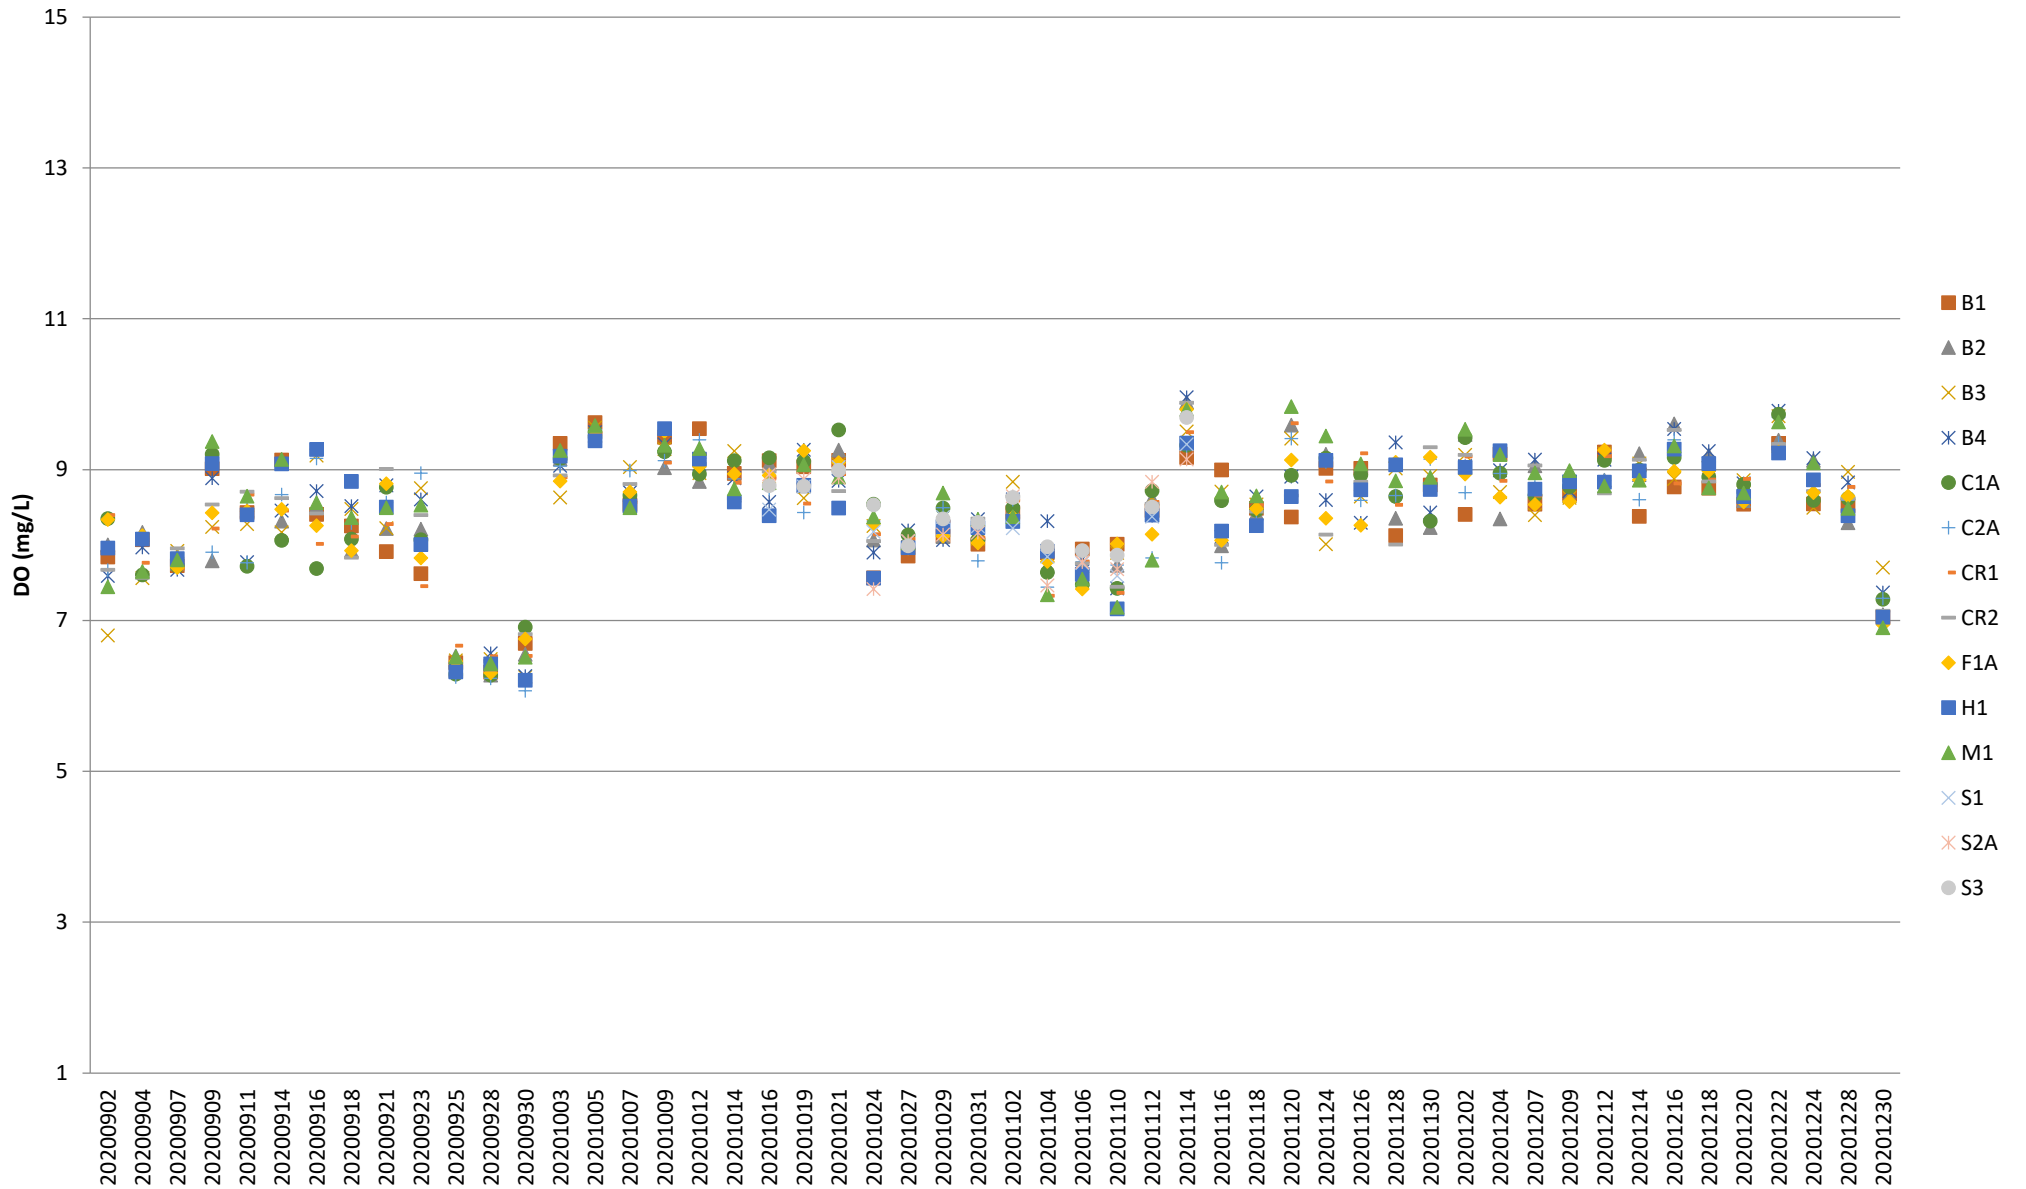


Note: The Action and Limit Level of dissolved oxygen can be referred to **Table 2.8** of the monthly EM&A report.

Dissolved Oxygen (Bottom) during MID-EBB

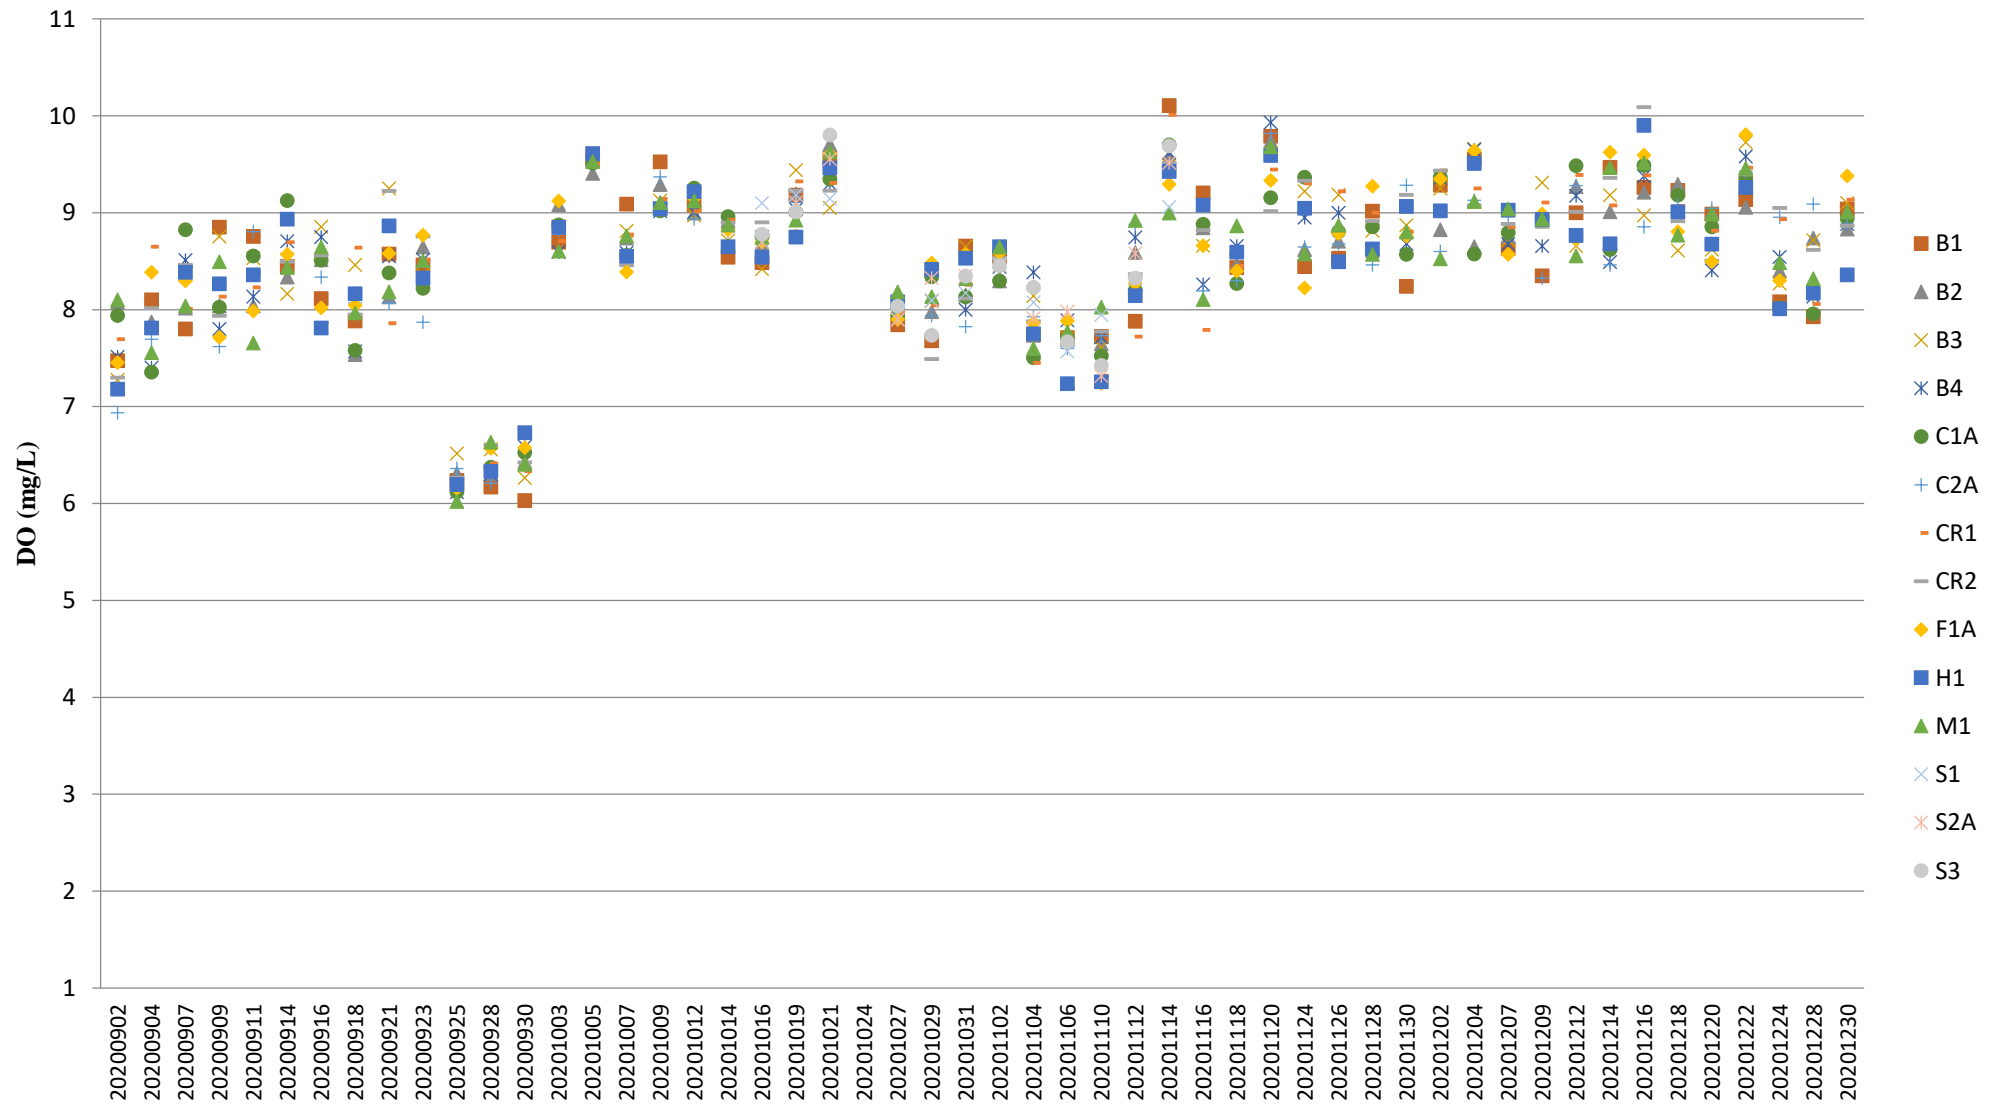


Note: The Action and Limit Level of dissolved oxygen can be referred to **Table 2.8** of the monthly EM&A report.


pH (Depth-averaged) during MID-FLOOD

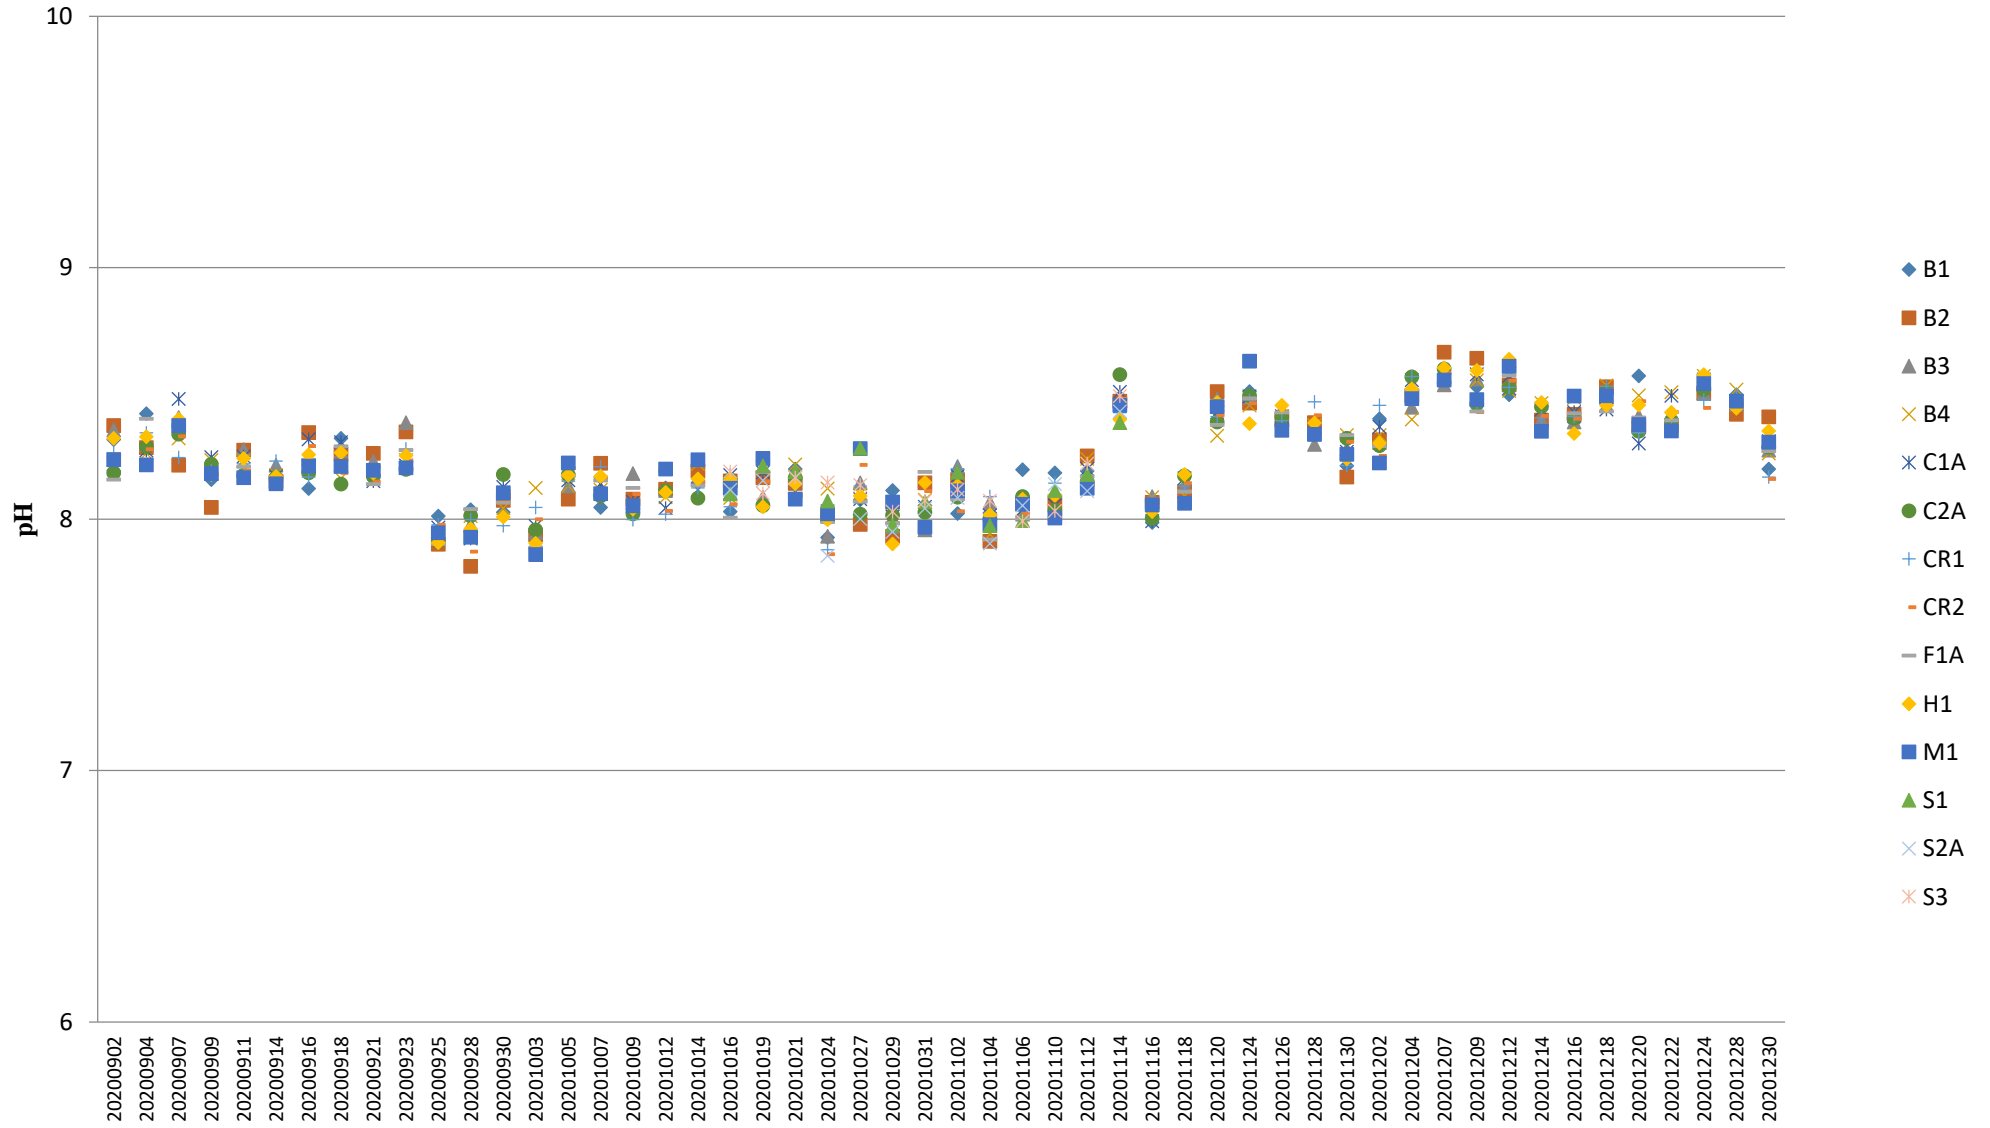

pH (Depth-averaged) MID-EBB

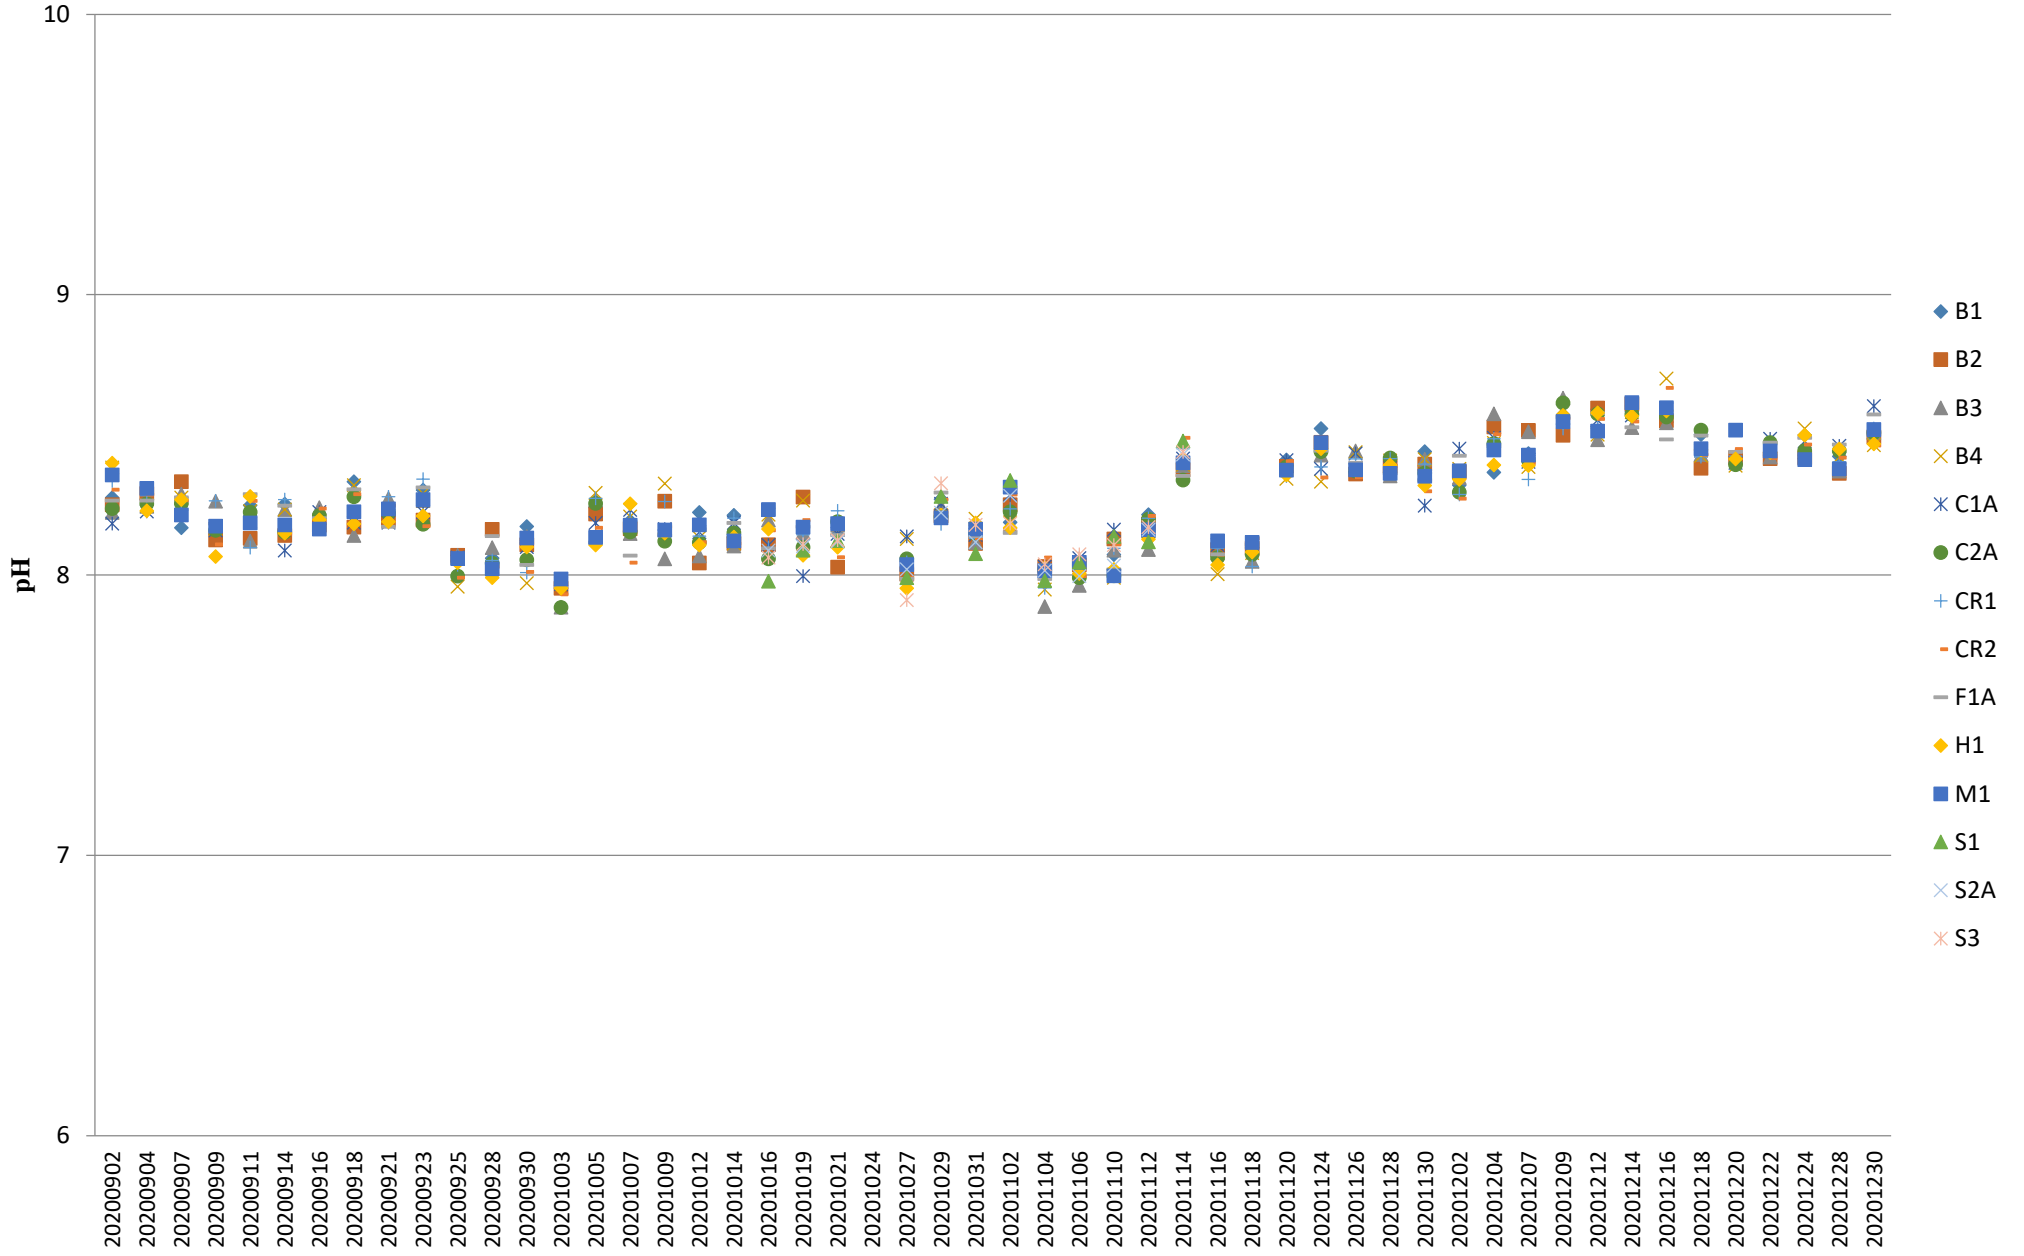


Turbidity (Depth-averaged) during MID-FLOOD

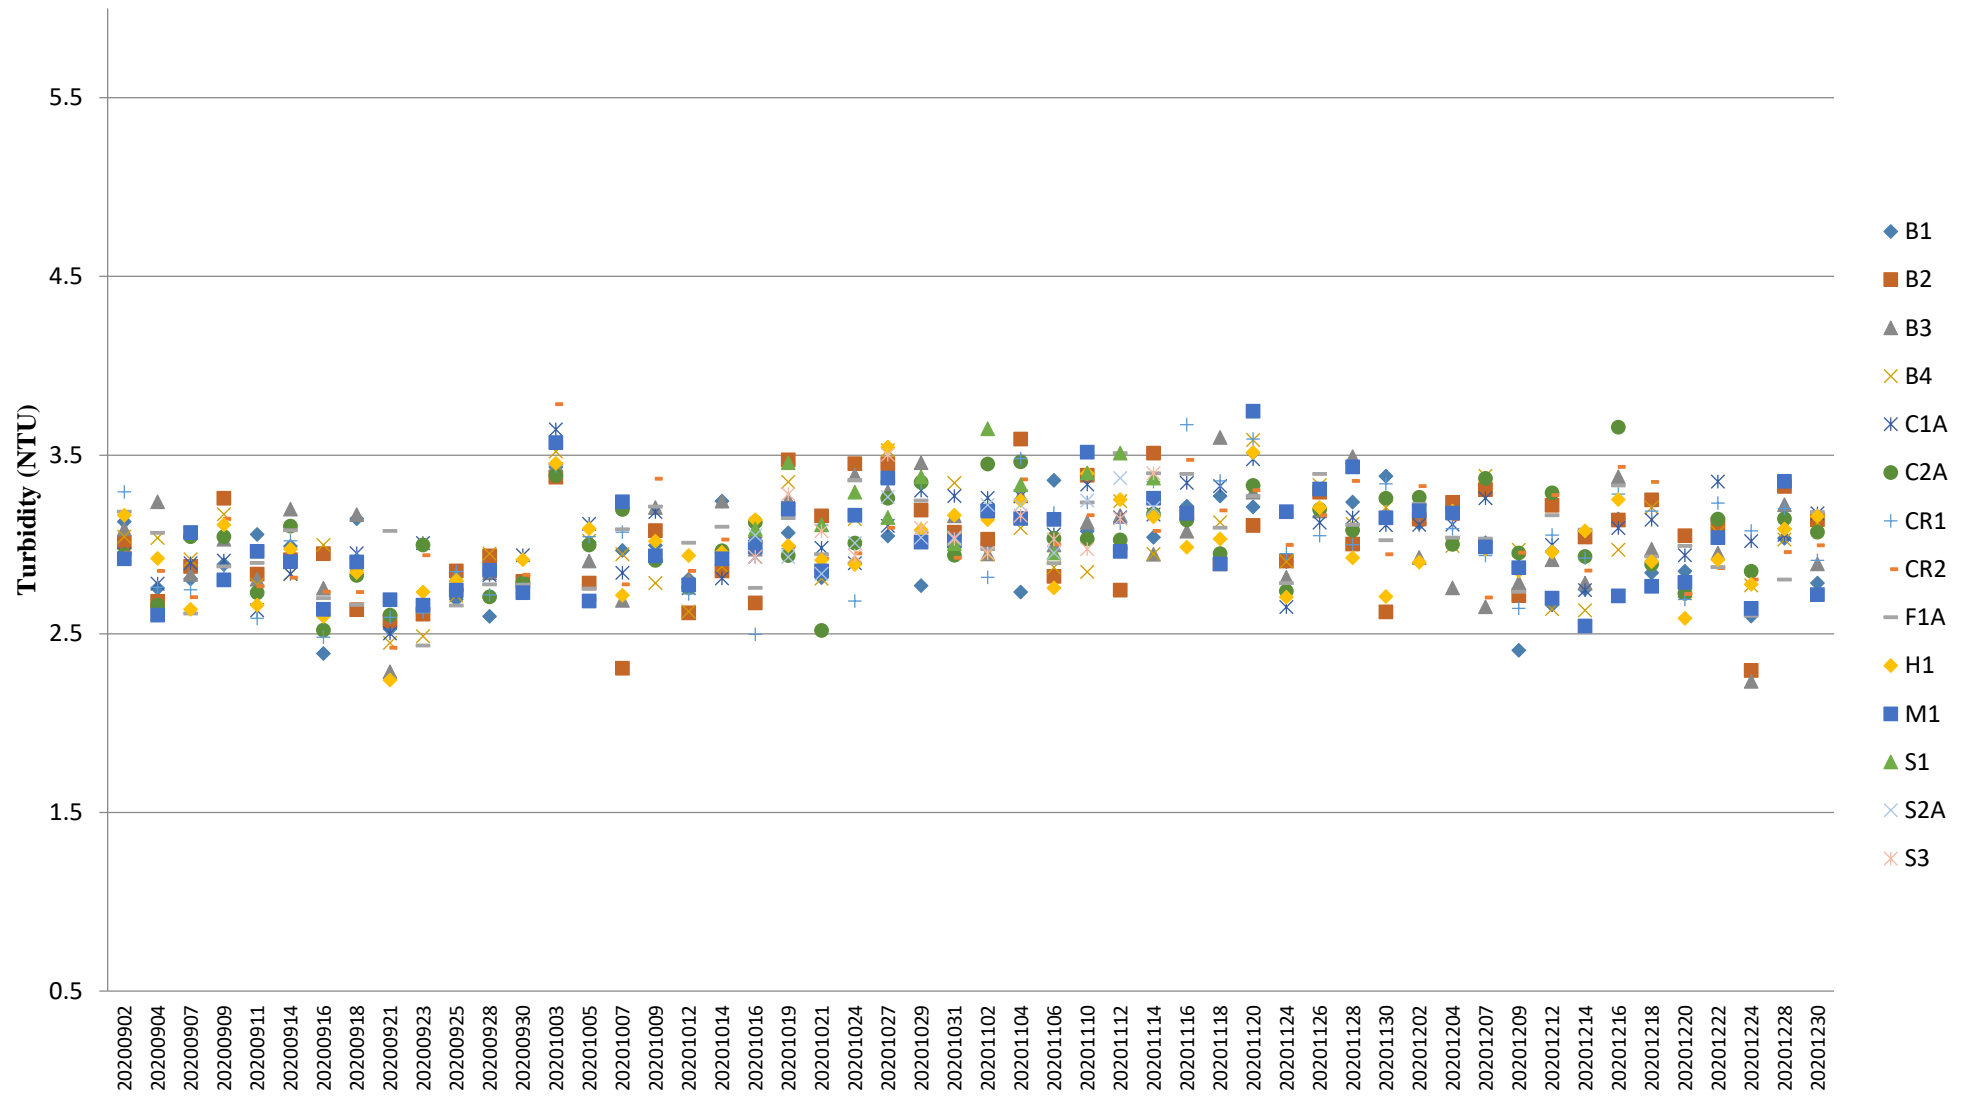


Note: The Action and Limit Level of turbidity can be referred to **Table 2.8** of the monthly EM&A report.

Turbidity (Depth-averaged) during MID-EBB

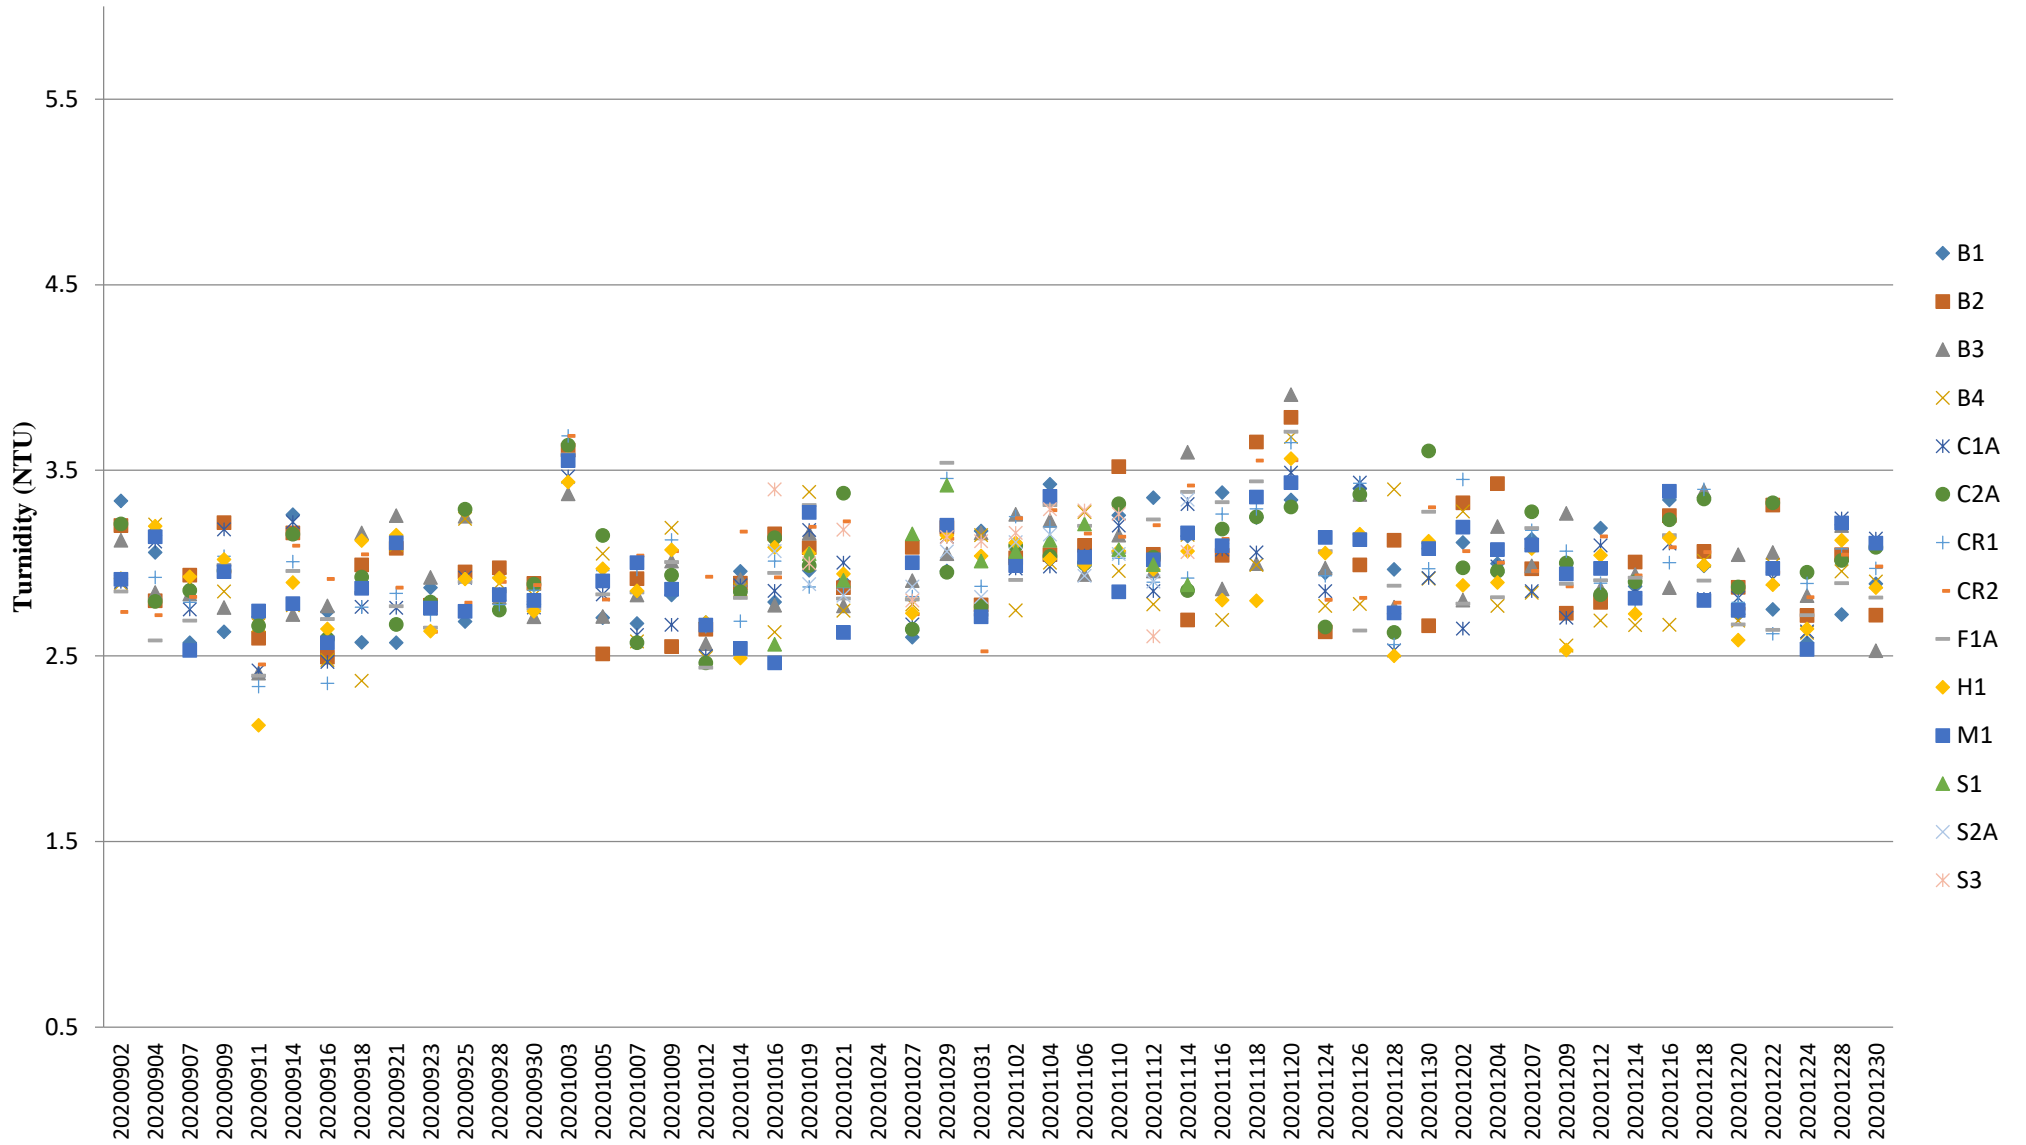


Note: The Action and Limit Level of turbidity can be referred to **Table 2.8** of the monthly EM&A report.

Suspended Solids (Depth-averaged) during MID-FLOOD

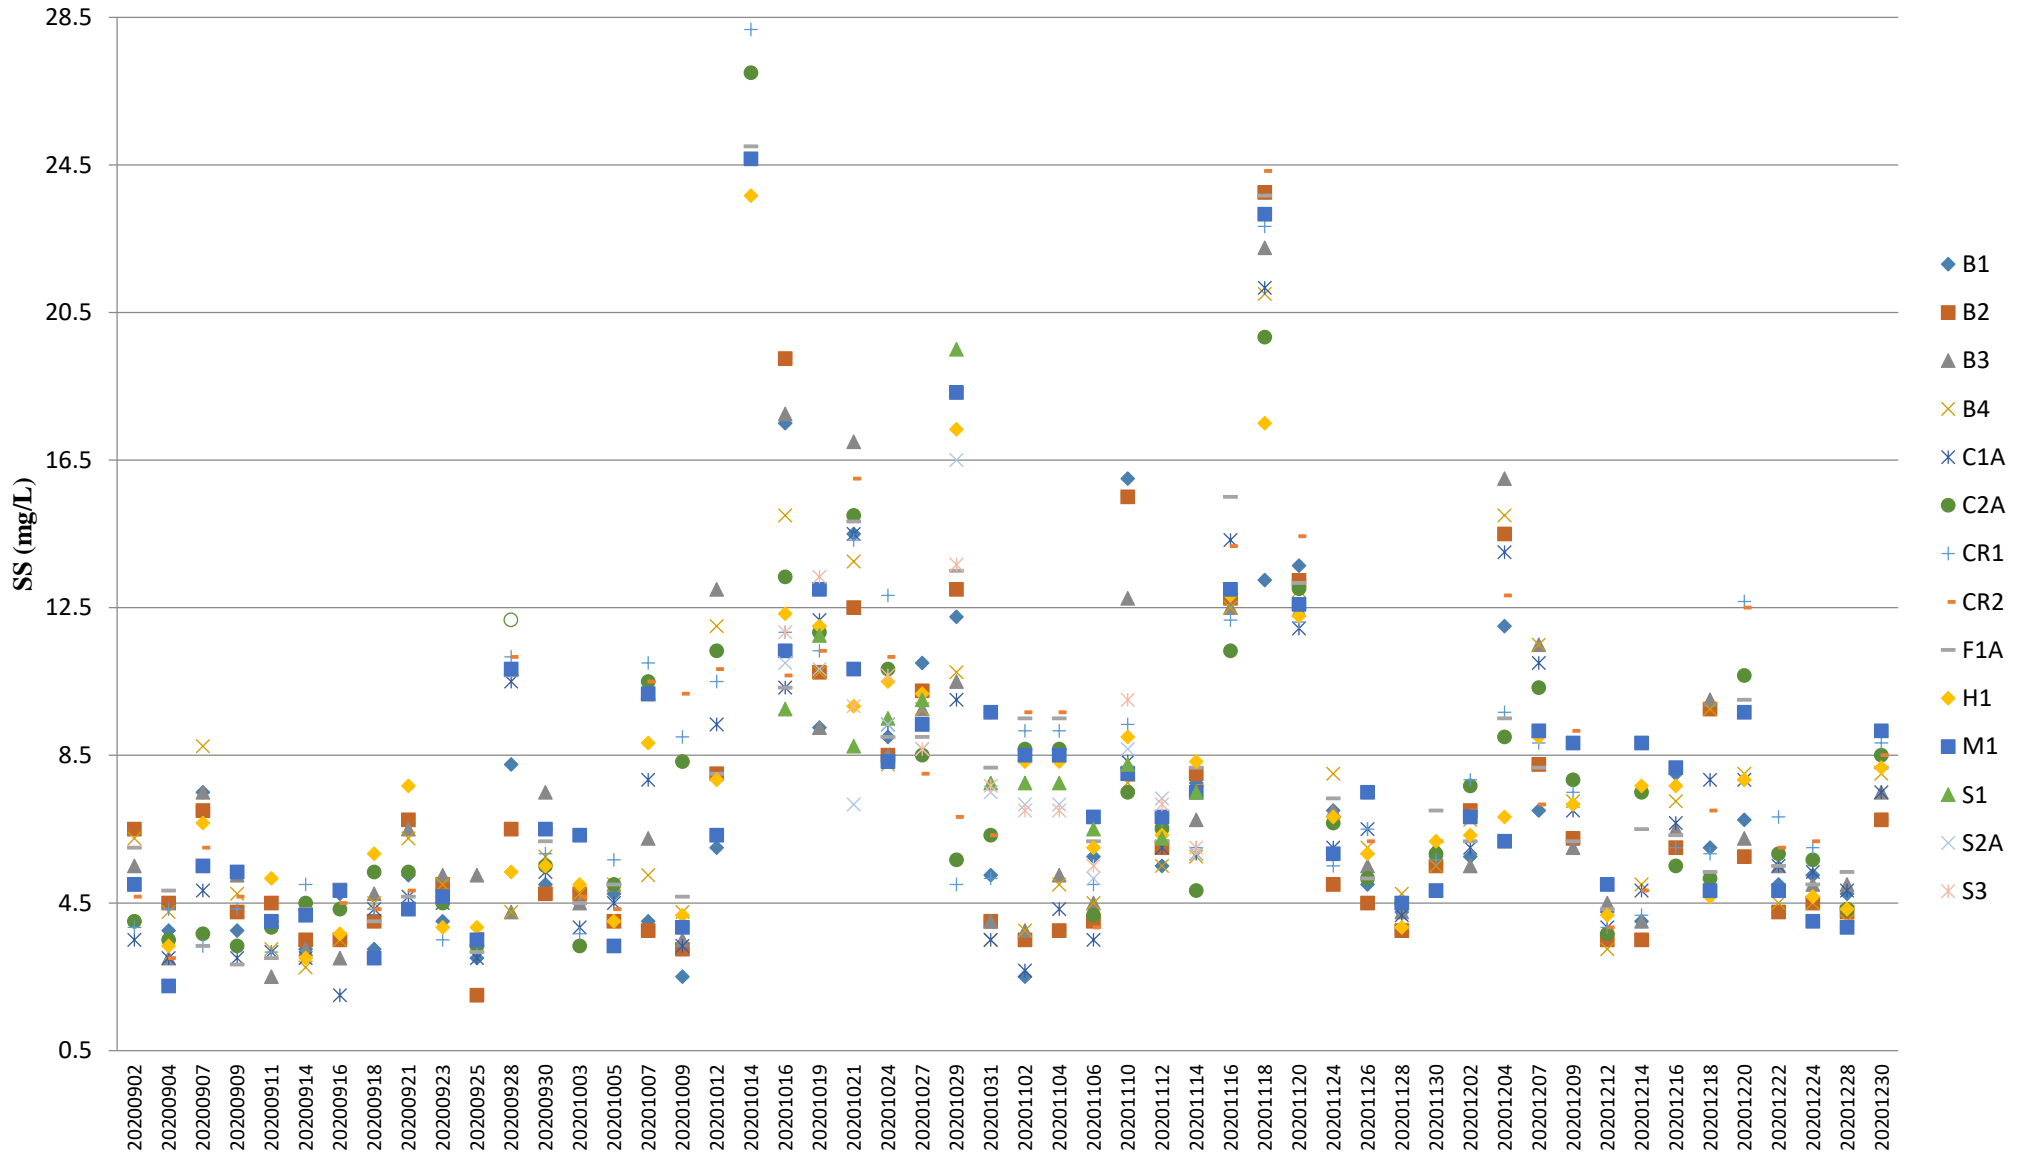


Note: The Action and Limit Level of suspended solids can be referred to **Table 2.8** of the monthly EM&A report.

Suspended Solids (Depth-averaged) during MID-EBB

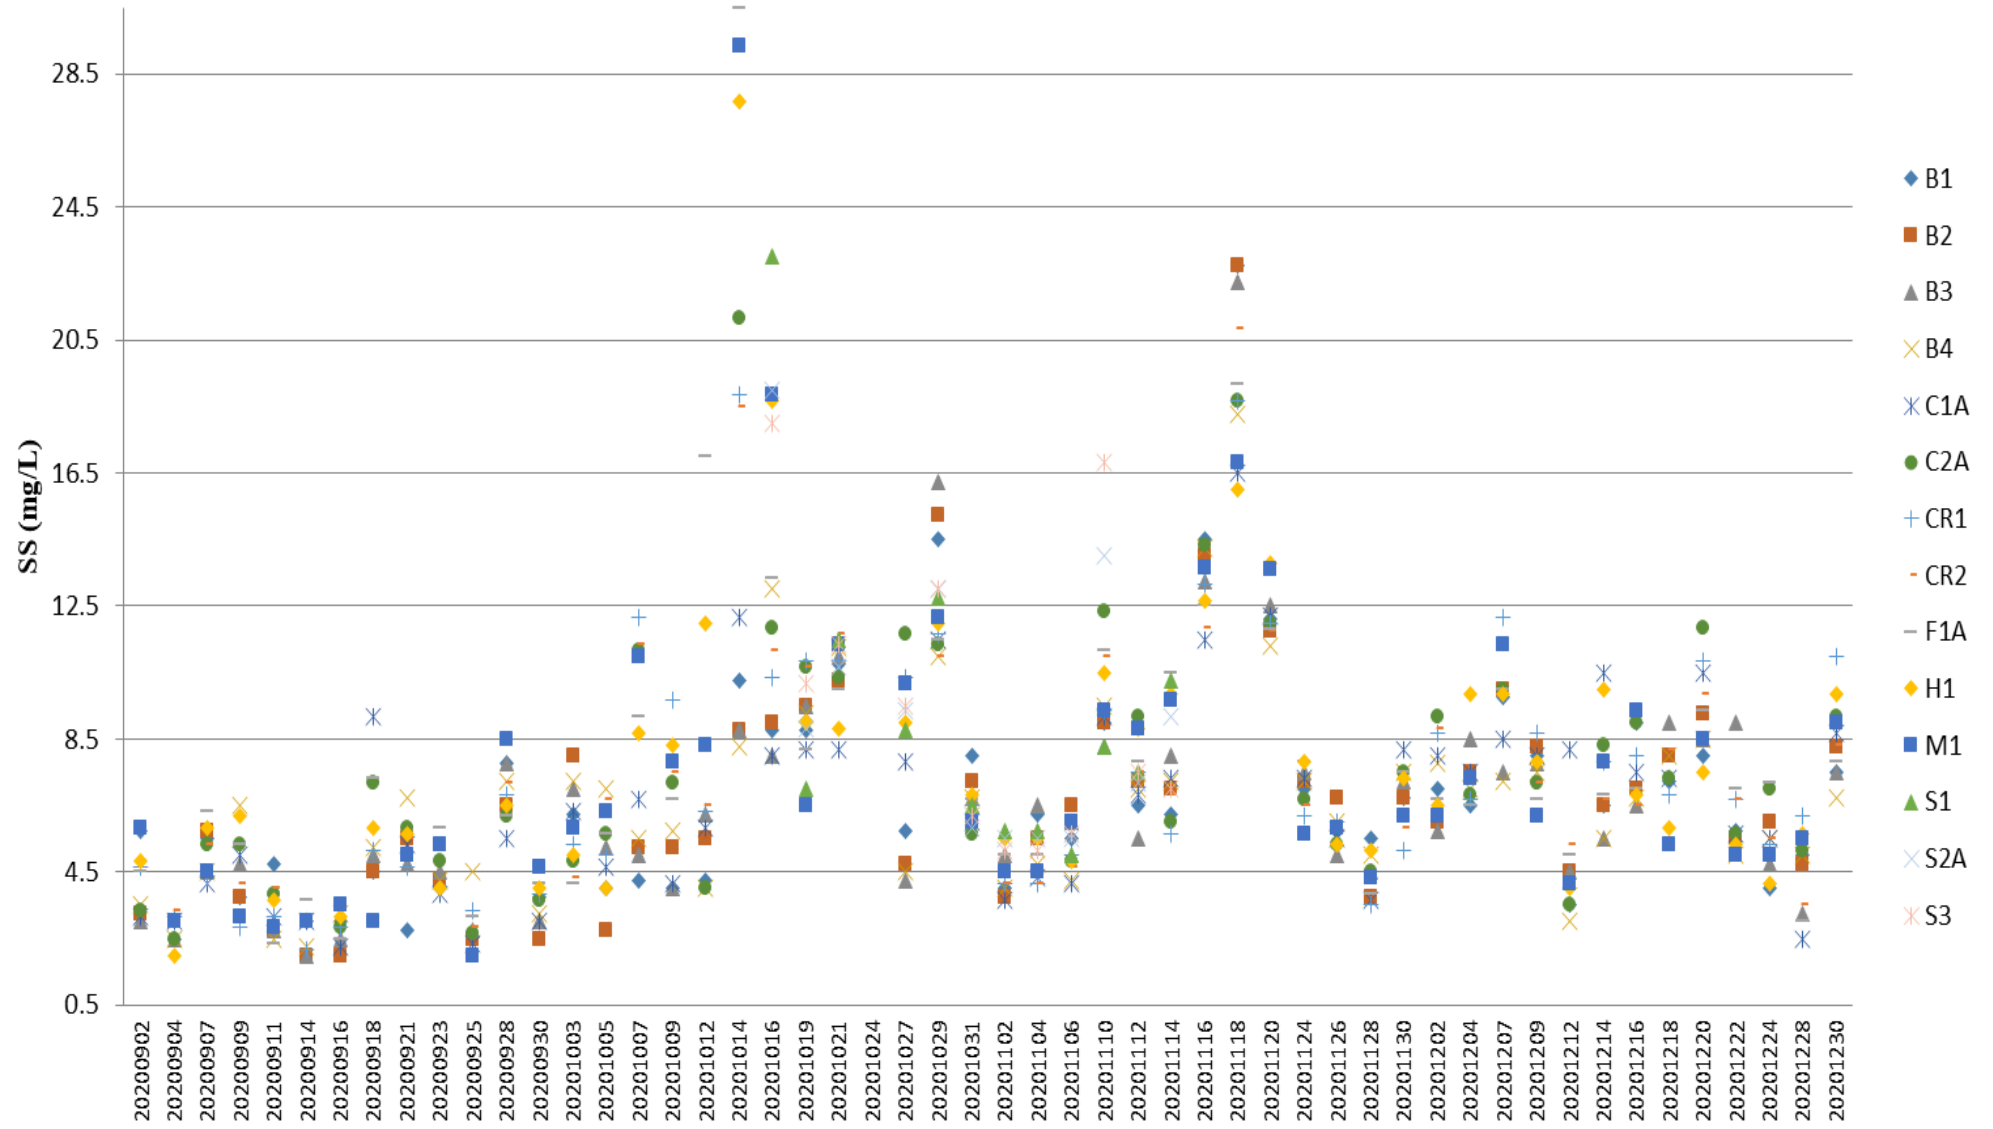


Note: The Action and Limit Level of suspended solids can be referred to **Table 2.8** of the monthly EM&A report.

Temperature (Depth-averaged) during MID-FLOOD

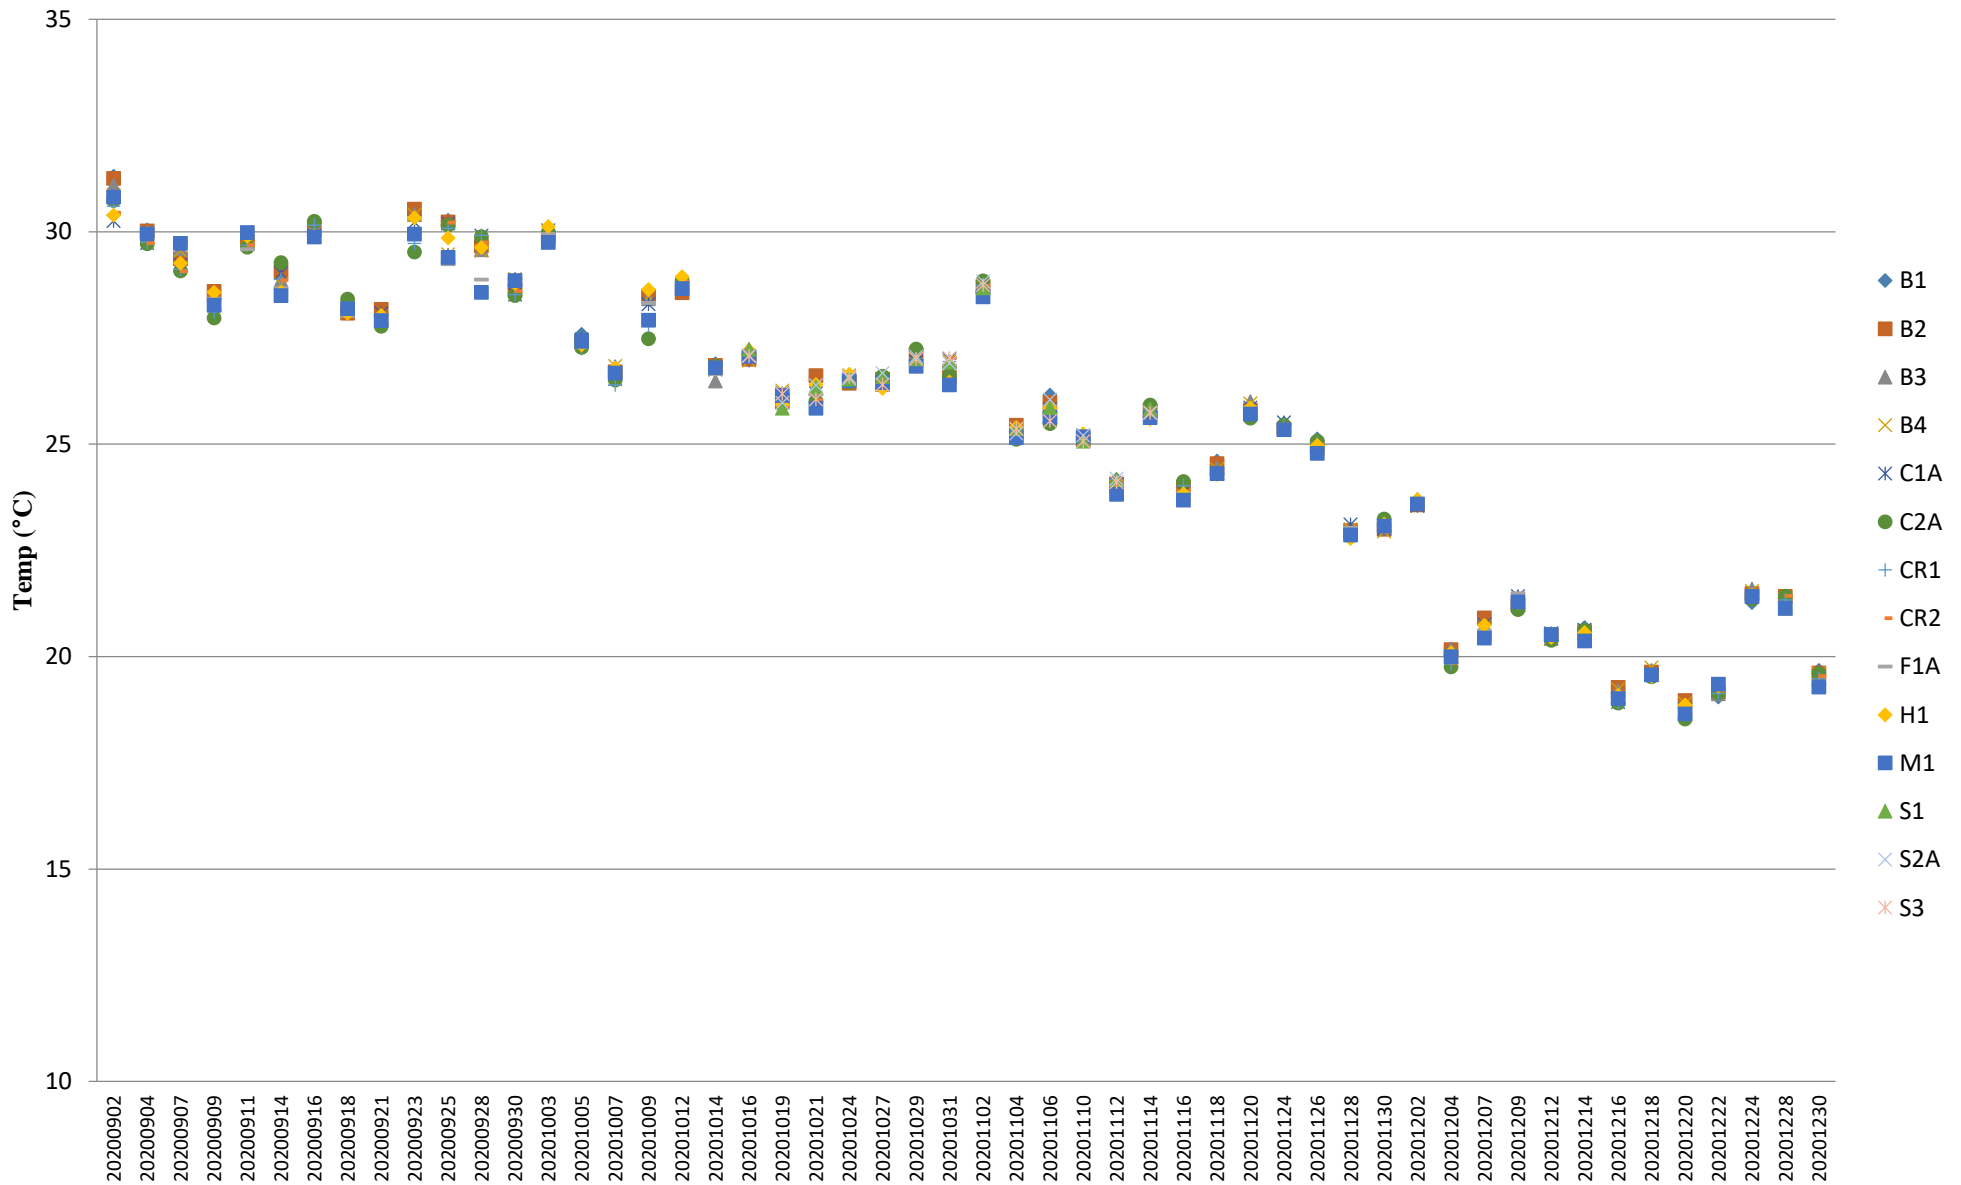


Note: The Action and Limit Level of temperature can be referred to **Table 2.8** of the monthly EM&A report.

Temperature (Depth-averaged) during MID-EBB

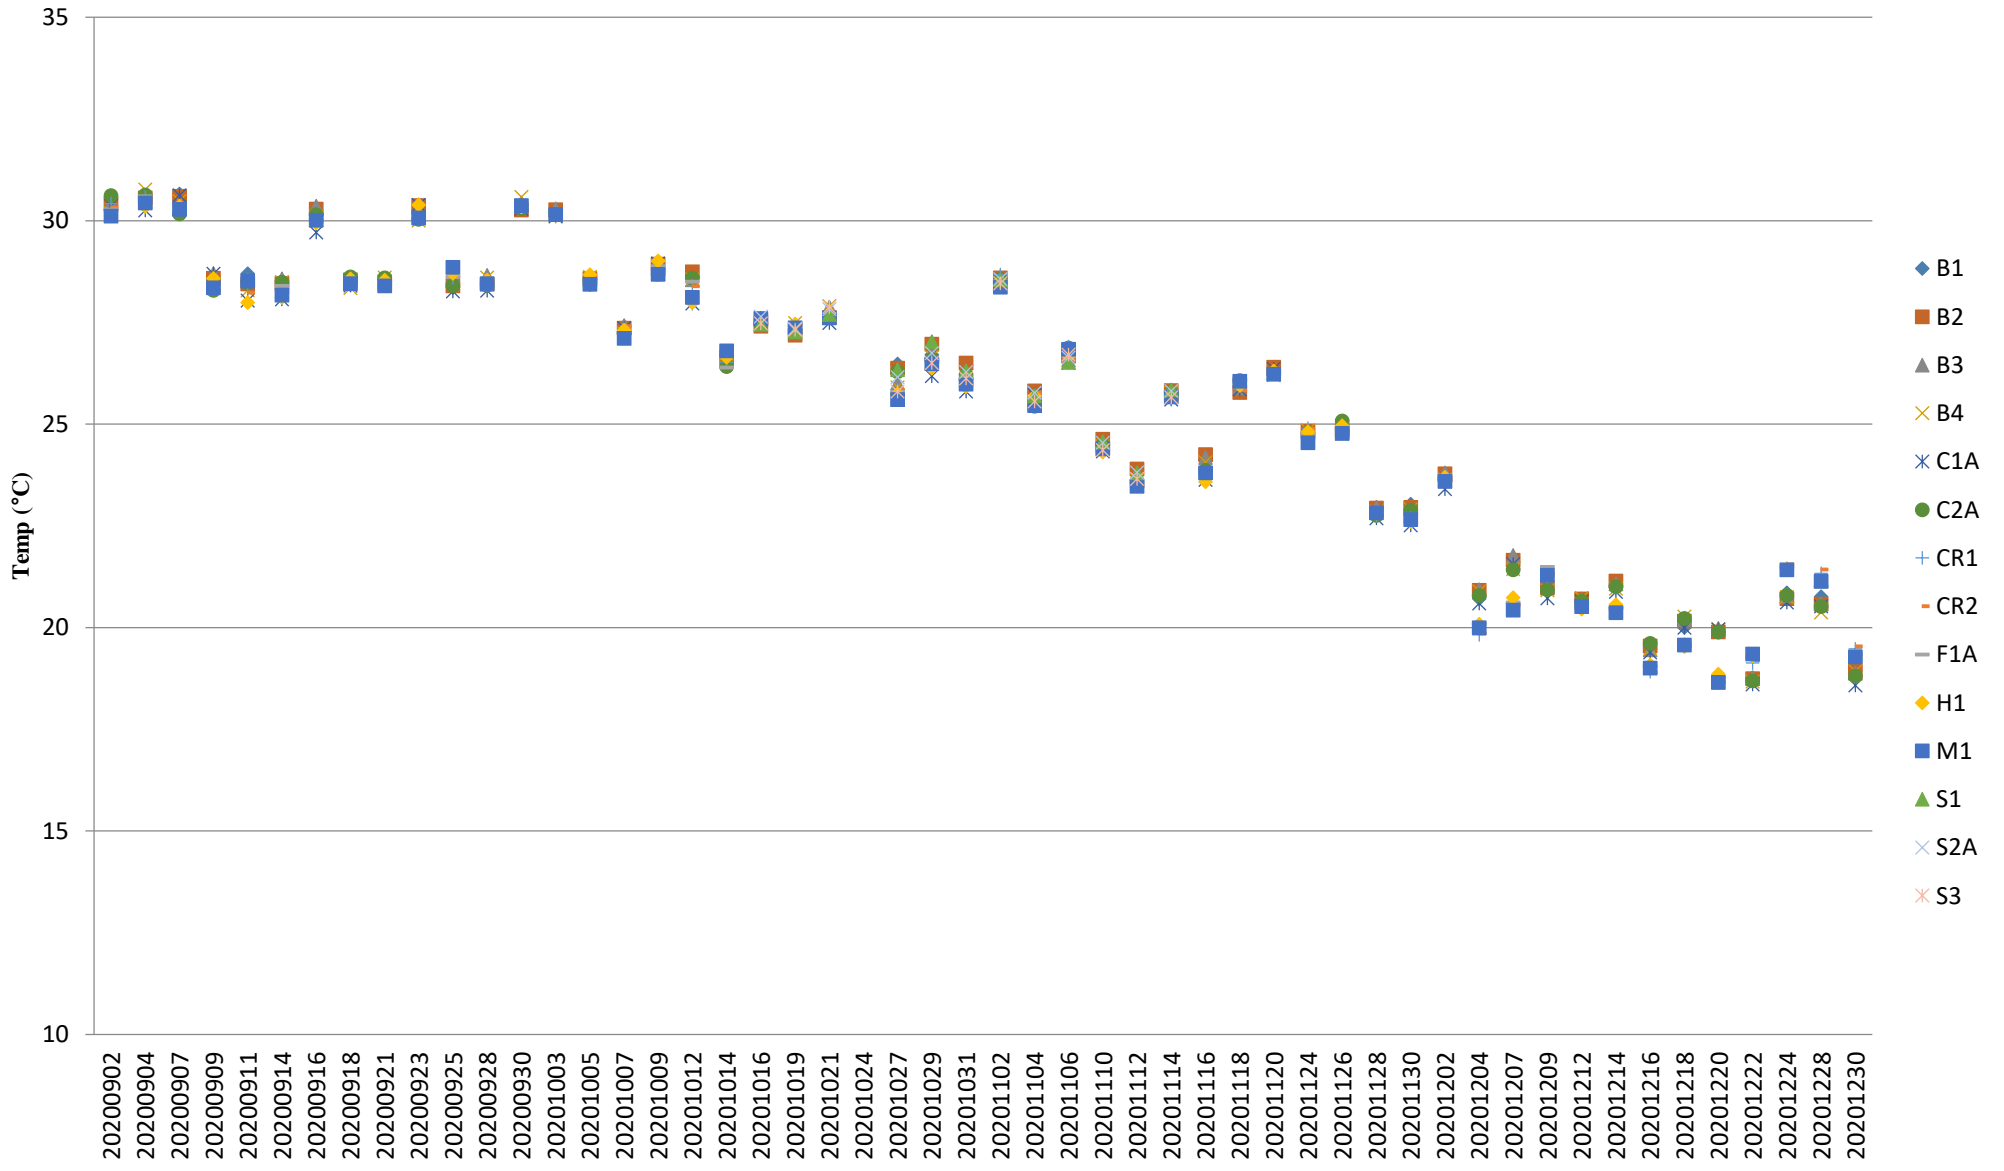


Note: The Action and Limit Level of temperature can be referred to **Table 2.8** of the monthly EM&A report.

Total Alkalinity (Depth-averaged) during MID-FLOOD

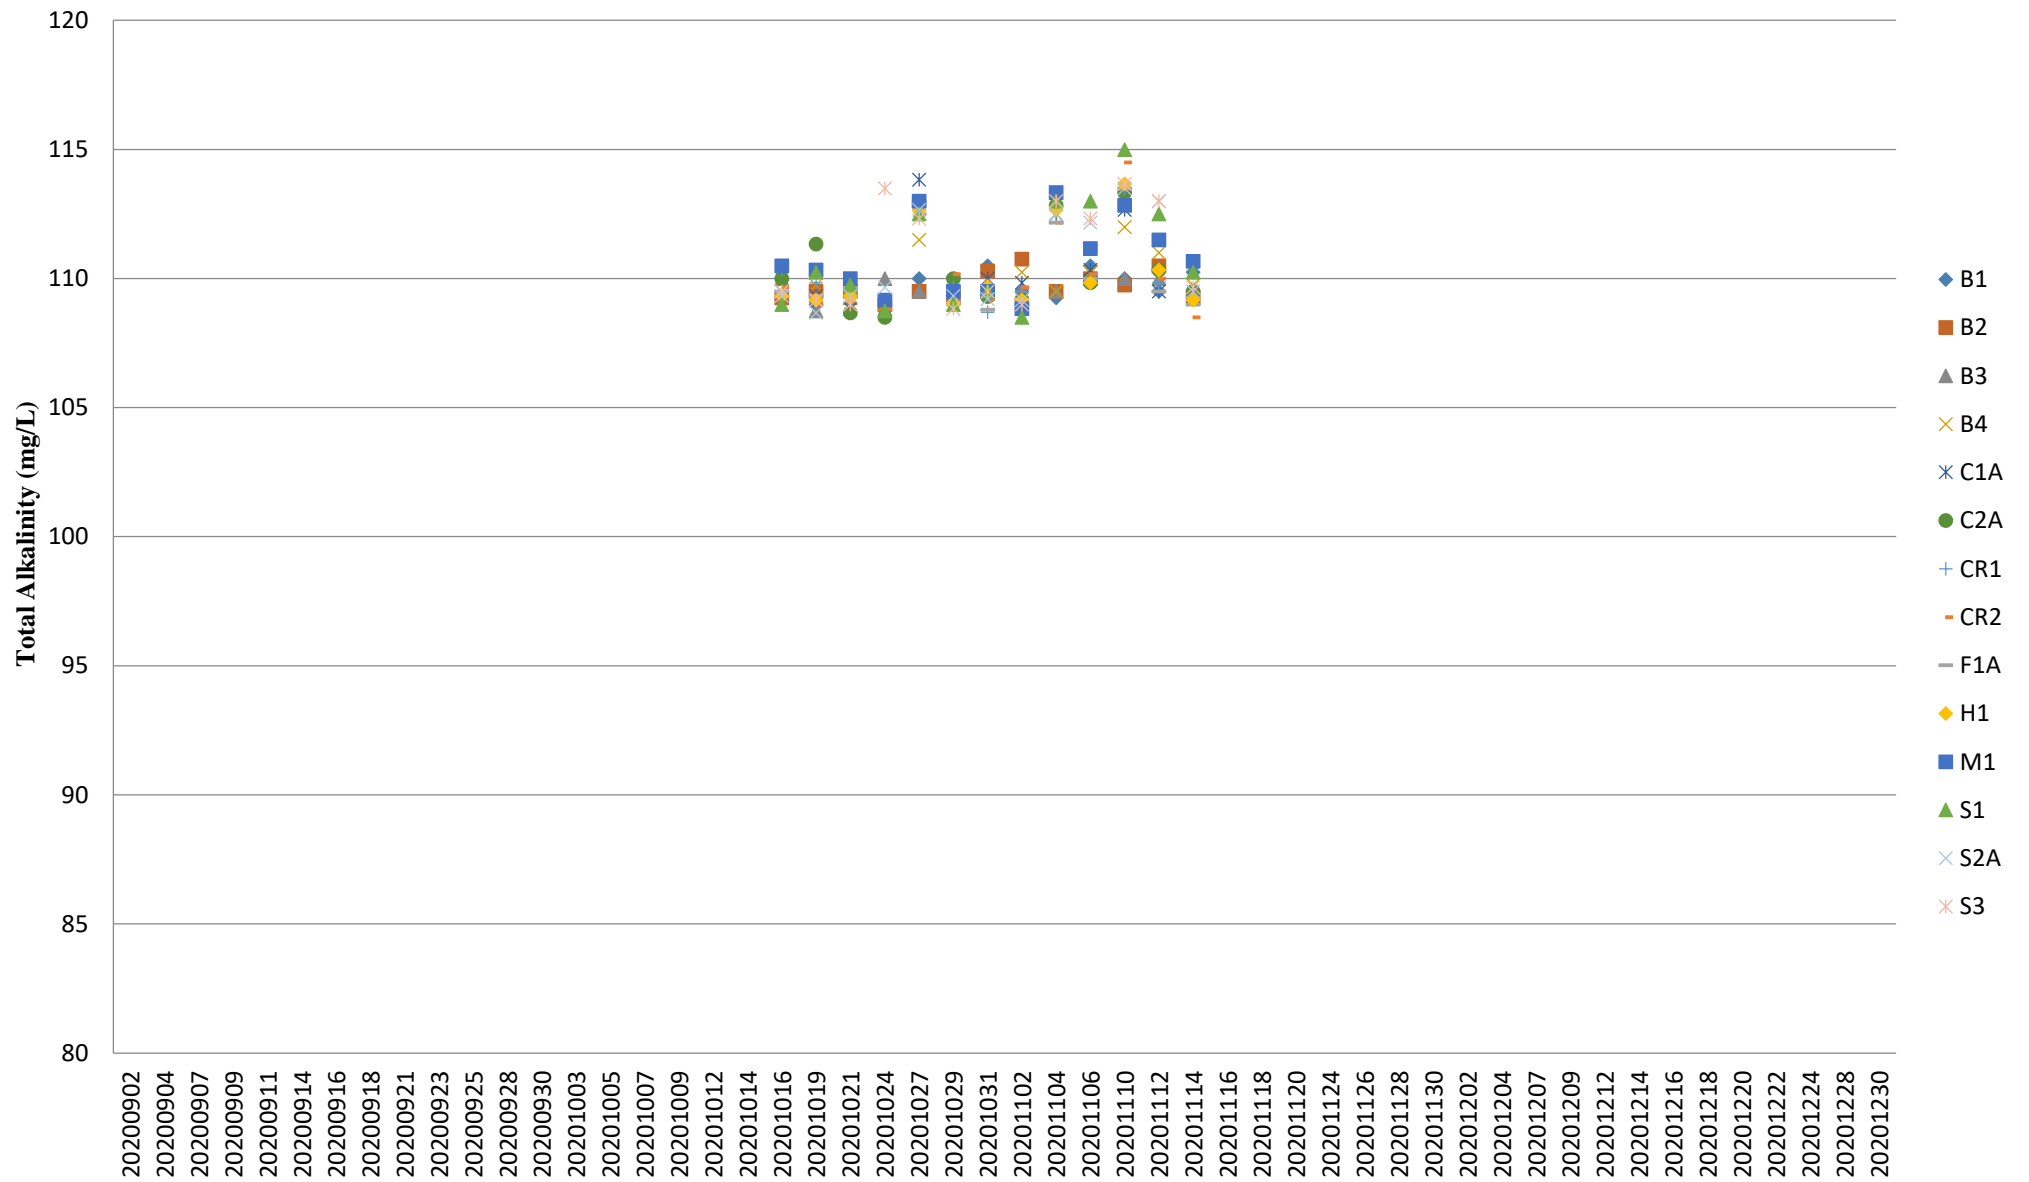

Note: The Action and Limit Level of total alkalinity can be referred to **Table 2.8** of the monthly EM&A report.

Total Alkalinity (Depth-averaged) during MID-EBB

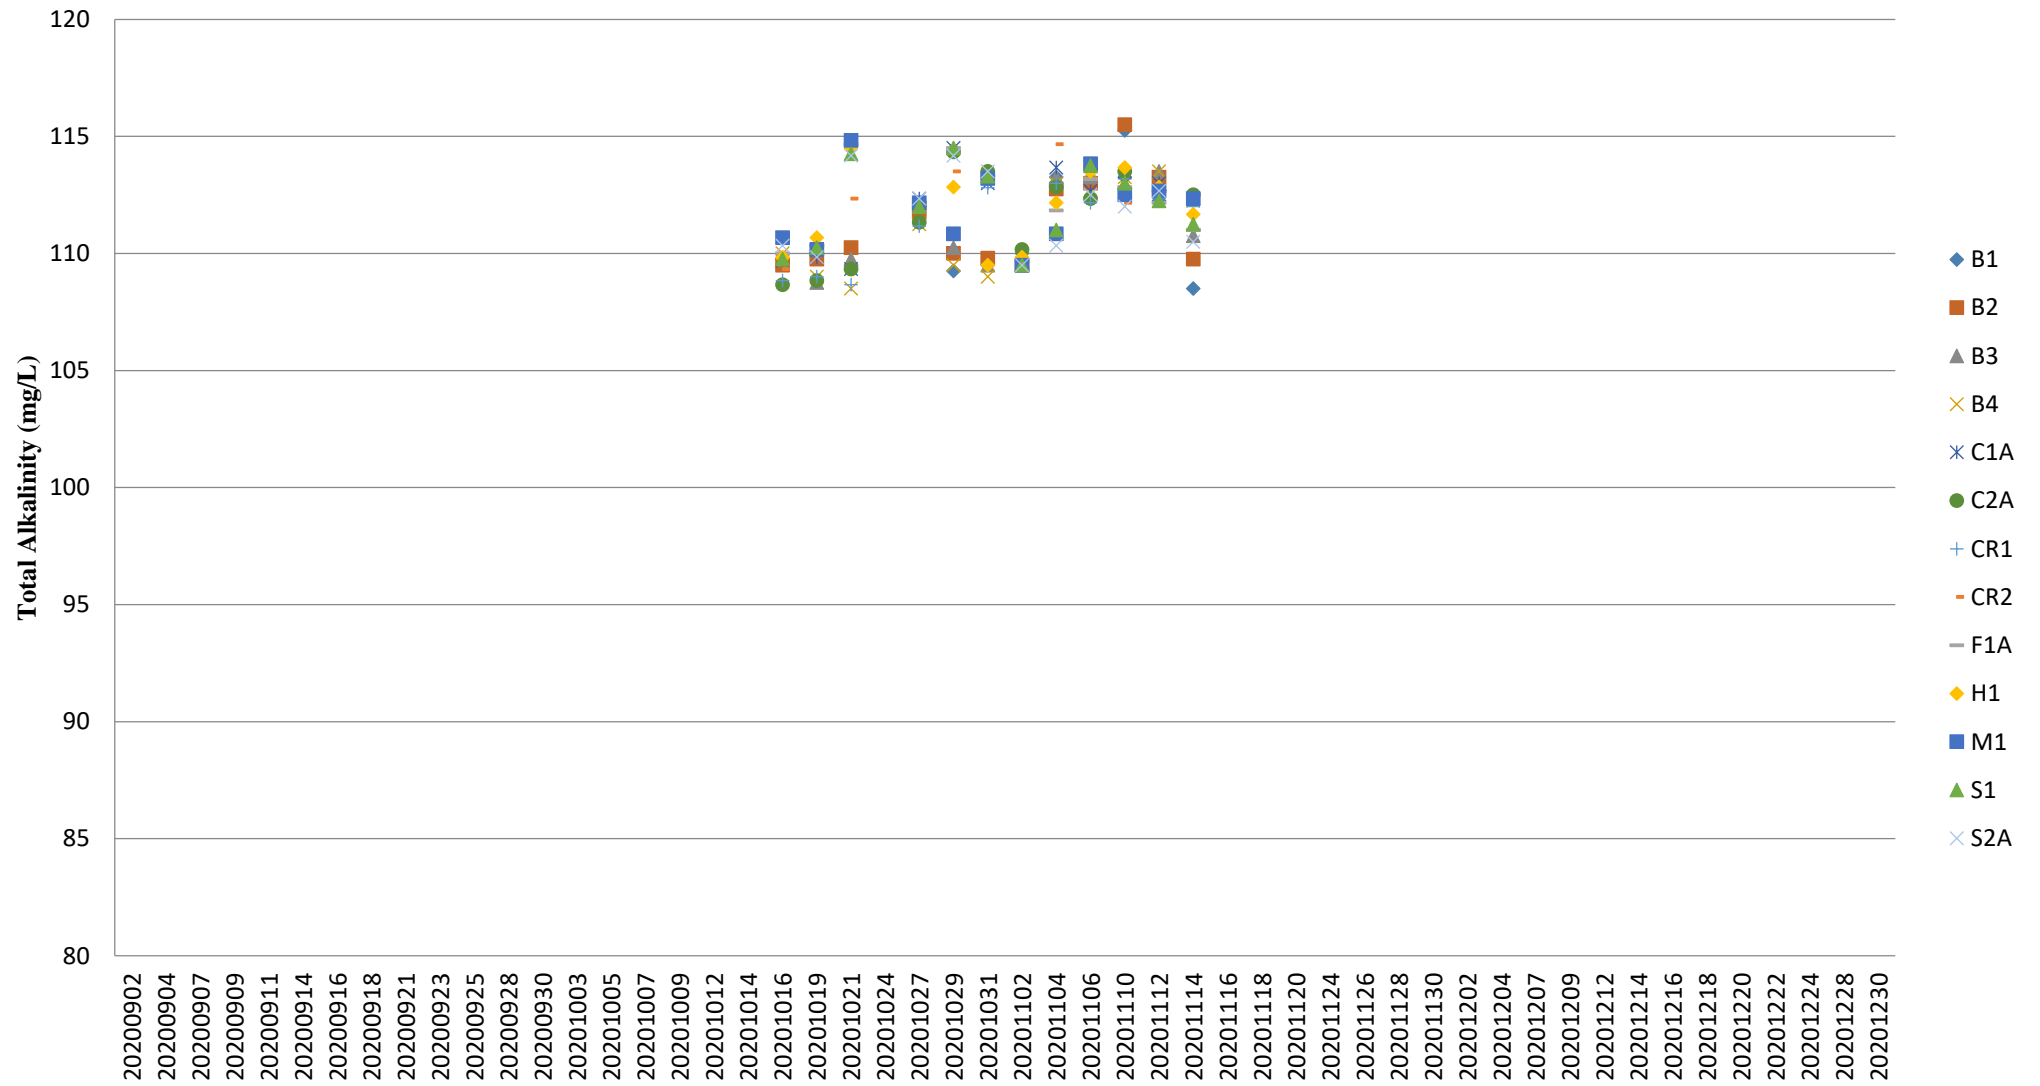

Note: The Action and Limit Level of total alkalinity can be referred to **Table 2.8** of the monthly EM&A report.

Appendix E HOKLAS Laboratory Certificate



Hong Kong Accreditation Service
香港認可處

Certificate of Accreditation
認可證書

This is to certify that
特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong
香港新界葵涌永業街1-3號忠信針織中心11樓

*has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a
為香港認可處執行機關根據認可諮詢委員會建議而接受的*

HOKLAS Accredited Laboratory
「香港實驗所認可計劃」認可實驗所

*This laboratory meets the requirements of ISO / IEC 17025 : 2005 – General requirements for the competence
此實驗所符合ISO / IEC 17025 : 2005 – 《測試及校正實驗所能力的通用規定》所訂的要求。
of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as
這項認可資格演示在指定範疇所需的技術能力及實驗所質量管理系統的運作
獲認可進行載於香港實驗所認可計劃《認可實驗所名冊》內下述測試類別中的指定
listed in the HOKLAS Directory of Accredited Laboratories within the test category of
測試或校正工作*

Environmental Testing
環境測試

*This laboratory is accredited in accordance with the recognised international Standard ISO / IEC 17025 : 2005.
本實驗所乃根據公認的國際標準 ISO / IEC 17025 : 2005 獲得認可。*

*This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory
這項認可資格演示在指定範疇所需的技術能力及實驗所質量管理系統的運作
quality management system (see joint IAF-ILAC-ISO Communiqué).
(見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。*

*The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive
香港認可處根據認可處執行機關的權限在此蓋上通用印章*

CHAN Sing Sing, Terence, Executive Administrator
執行幹事 陳成城
Issue Date : 5 May 2009
簽發日期 : 二零零九年五月五日

Registration Number : **HOKLAS 066**
註冊號碼 :

Date of First Registration : 15 September 1995
首次註冊日期 : 一九九五年九月十五日





Hong Kong Accreditation Service
香港認可處

Certificate of Accreditation
認可證書

This is to certify that
特此證明

ACUMEN LABORATORY AND TESTING LIMITED
浩科檢測中心有限公司

Lot 12, Tam Kon Shan Road, North Tsing Yi, New Territories, Hong Kong
香港新界青衣北担杆山路12路段

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a
在認可諮詢委員會的建議下獲香港認可處執行機關接受為

HOKLAS Accredited Laboratory
「香港實驗室認可計劃」認可實驗室

This laboratory meets the requirements of ISO/IEC 17025:2005 and it has been accredited for performing specific tests or calibrations as listed in the scope of accreditation within the test category of

Environmental Testing

此實驗室符合ISO/IEC 17025:2005所訂的要求
並獲認可進行載於認可範圍內下述測試類別中的指定測試或校正工作

環境測試

This accreditation to ISO/IEC 17025:2005 demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (see joint IAF-ILAC-ISO Communiqué).
此項 ISO/IEC 17025:2005 的認可資格證明此實驗室所具備指定範疇內所須的技術能力並實施一套實驗室質量管理體系(見國際認可論壇、國際實驗室認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive
現經香港認可處執行機關授權在此蓋上香港認可處的印章

WONG Wang-wah, Executive Administrator
執行幹事 黃宏華
Issue Date : 16 July 2014
簽發日期：二零一四年七月十六日

Registration Number : HOKLAS 241
註冊號碼：



Date of First Registration : 16 July 2014
首次註冊日期：二零一四年七月十六日

This certificate is issued subject to the terms and conditions laid down by HKAS.
本證書按照香港認可處訂立的條款及條件發出

L 001195

Appendix F Water Quality Equipment Calibration Certificate



專業化驗有限公司
QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong
Email: info@qualityprotest.com; Website: www.qualityprotest.com
Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AJ110068
Date of Issue : 27 November 2020
Page No. : 1 of 2

PART A – CUSTOMER INFORMATION

Acuity Sustainability Consulting Limited
Unit C, 11/F, Ford Glory Plaza
37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, Hong Kong
Attn: Mr. Nelson TSUI

PART B – DESCRIPTION

Name of Equipment : Multi Water Quality Checker U-53
Manufacturer : Horiba
Serial Number : A55XB7UP
Date of Received : Nov 16, 2020
Date of Calibration : Nov 27, 2020
Date of Next Calibration^(a) : Feb 26, 2021

PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H ⁺ B
Dissolved Oxygen	APHA 21e 4500-O G
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

PART D – CALIBRATION RESULTS^(b,c)

(1) pH at 25°C

Target (pH unit)	Displayed Reading ^(d) (pH Unit)	Tolerance ^(e) (pH Unit)	Results
4.00	4.18	0.18	Satisfactory
7.42	7.27	-0.15	Satisfactory
10.01	9.88	-0.13	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

(2) Temperature


Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
15	15.4	0.40	Satisfactory
23	23.8	0.80	Satisfactory
35	34.6	-0.40	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

Remark(s): -

- ^(a) The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.
^(b) The results relate only to the calibrated equipment as received
^(c) The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.
^(d) "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.
^(e) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.


LEE Chun-ning, Desmond
Senior Chemist



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AJ110068
Date of Issue : 27 November 2020
Page No. : 2 of 2

PART D – CALIBRATION RESULTS (Cont'd)

(3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.10	0.00	-0.10	Satisfactory
3.59	3.84	0.25	Satisfactory
5.01	4.99	-0.02	Satisfactory
7.83	7.57	-0.26	Satisfactory

Tolerance limit of dissolved oxygen should be less than ± 0.50 (mg/L)

(4) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.95	-0.50	Satisfactory
20	19.02	-4.90	Satisfactory
30	29.03	-3.23	Satisfactory

Tolerance limit of salinity should be less than ± 10.0 (%)

(5) Turbidity

Expected Reading (NTU)	Displayed Reading ^(f) (NTU)	Tolerance ^(g) (%)	Results
0	0.61	--	Satisfactory
10	10.08	0.8	Satisfactory
20	19.50	-2.5	Satisfactory
100	99.10	-0.9	Satisfactory
800	777.00	-2.9	Satisfactory


Tolerance limit of turbidity should be less than ± 10.0 (%)

~ END OF REPORT ~

Remark(s): -

^(f) "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

^(g) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.

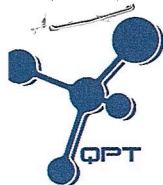

專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AJ090064
Date of Issue : 25 September 2020
Page No. : 1 of 2

PART A – CUSTOMER INFORMATION

Acuity Sustainability Consulting Limited
Unit C, 11/F, Ford Glory Plaza
37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, Hong Kong
Attn: Mr. Nelson TSUI

PART B – DESCRIPTION

Name of Equipment : Multi Water Quality Checker U-53
Manufacturer : Horiba
Serial Number : L20550GA
Date of Received : Sep 17, 2020
Date of Calibration : Sep 25, 2020
Date of Next Calibration^(a) : Dec 24, 2020

PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H ⁺ B
Dissolved Oxygen	APHA 21e 4500-O G
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

PART D – CALIBRATION RESULTS^(b,c)

(1) pH at 25°C

Target (pH unit)	Displayed Reading ^(d) (pH Unit)	Tolerance ^(e) (pH Unit)	Results
4.00	4.08	0.08	Satisfactory
7.42	7.46	0.04	Satisfactory
10.01	10.02	0.01	Satisfactory

Tolerance of pH should be less than ± 0.20 (pH unit)

(2) Temperature


Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
14.5	14.42	-0.08	Satisfactory
26.0	25.45	-0.55	Satisfactory
40.0	39.77	-0.23	Satisfactory


Tolerance limit of temperature should be less than ± 2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

Remark(s): -

- ^(a) The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.
^(b) The results relate only to the calibrated equipment as received
^(c) The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.
^(d) "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.
^(e) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.


LEE Chun-ning, Desmond
Senior Chemist

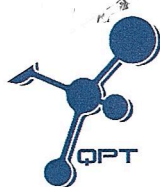

專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AJ090064
Date of Issue : 25 September 2020
Page No. : 2 of 2

PART D – CALIBRATION RESULTS (Cont'd)

(3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.05	0.00	-0.05	Satisfactory
2.58	2.11	-0.37	Satisfactory
5.08	5.08	0.00	Satisfactory
7.82	7.63	-0.19	Satisfactory

Tolerance limit of dissolved oxygen should be less than ± 0.50 (mg/L)

(4) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.92	-0.08	Satisfactory
20	20.12	0.06	Satisfactory
30	31.03	3.43	Satisfactory

Tolerance limit of salinity should be less than ± 10.0 (%)

(5) Turbidity

Expected Reading (NTU)	Displayed Reading ^(f) (NTU)	Tolerance ^(g) (%)	Results
0	0.33	--	Satisfactory
10	9.65	-3.5	Satisfactory
20	18.9	-5.5	Satisfactory
100	100	0.0	Satisfactory
800	781	-2.4	Satisfactory

Tolerance limit of turbidity should be less than ± 10.0 (%)

~ END OF REPORT ~

Remark(s): -

^(f) "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

^(g) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司
QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong
Email: info@qualityprotest.com; Website: www.qualityprotest.com
Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AJ110022
Date of Issue : 11 November 2020
Page No. : 1 of 2

PART A – CUSTOMER INFORMATION

Acuity Sustainability Consulting Limited
Unit C, 11/F, Ford Glory Plaza
37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, Hong Kong
Attn: Mr. Nelson TSUI

PART B – DESCRIPTION

Name of Equipment : Multi Water Quality Checker U-53
Manufacturer : Horiba
Serial Number : UHB5F2BB
Date of Received : Nov 04, 2020
Date of Calibration : Nov 11, 2020
Date of Next Calibration^(a) : Feb 10, 2021

PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

<u>Parameter</u>	<u>Reference Method</u>
pH at 25°C	APHA 21e 4500-H ⁺ B
Dissolved Oxygen	APHA 21e 4500-O G
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.
Oxidation-Reduction Potential	APHA 22e 2580 B

PART D – CALIBRATION RESULTS^(b,c)

(1) pH at 25°C

Target (pH unit)	Displayed Reading ^(d) (pH Unit)	Tolerance ^(e) (pH Unit)	Results
4.00	4.10	0.10	Satisfactory
7.42	7.46	0.04	Satisfactory
10.01	10.02	0.01	Satisfactory

Tolerance of pH should be less than ± 0.20 (pH unit)

(2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
12	12.38	0.38	Satisfactory
25	25.01	0.01	Satisfactory
35	35.75	0.75	Satisfactory

Tolerance limit of temperature should be less than ± 2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

Remark(s): -

- ^(a) The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.
^(b) The results relate only to the calibrated equipment as received
^(c) The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.
^(d) "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.
^(e) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.


LEE Chun-ning, Desmond
Senior Chemist



REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AJ110022
Date of Issue : 11 November 2020
Page No. : 2 of 2

PART D – CALIBRATION RESULTS (Cont'd)

(3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.07	0.00	-0.07	Satisfactory
4.60	4.27	-0.33	Satisfactory
6.32	6.11	-0.21	Satisfactory
7.98	8.00	0.02	Satisfactory

Tolerance limit of dissolved oxygen should be less than ± 0.50 (mg/L)

(4) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.88	-1.20	Satisfactory
20	19.60	-2.00	Satisfactory
30	28.55	-4.83	Satisfactory

Tolerance limit of salinity should be less than ± 10.0 (%)

(5) Turbidity

Expected Reading (NTU)	Displayed Reading ^(f) (NTU)	Tolerance ^(g) (%)	Results
0	0.46	--	Satisfactory
10	10.01	0.1	Satisfactory
20	20.11	0.5	Satisfactory
100	96.80	-3.2	Satisfactory
800	797.00	-0.4	Satisfactory

Tolerance limit of turbidity should be less than ± 10.0 (%)

(6) Oxidation-Reduction Potential

Expected Reading (mV)	Displayed Reading (mV)	Tolerance (mV) ^(g)	Results
222	225	3	Satisfactory

Tolerance limit of Oxidation-Reduction Potential should be less than ± 10 (mV)

~ END OF REPORT ~

Remark(s): -

^(f) "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

^(g) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.

Appendix H Noise Monitoring Equipment Calibration Certificate

Certificate of Calibration

for

Description: *Sound Level Meter*
Manufacturer: *SVANTEK*
Type No.: *971 (Serial No.: 77731)*
Microphone: *ACO 7052E (Serial No.: 72681)*
Preamplifier: *SV18 (Serial No.: 78763)*

Submitted by:

Customer: *Acuity Sustainability Consulting Limited*
Address: *Unit C, 11/F., Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon*

Upon receipt for calibration, the instrument was found to be:

- Within**
 Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 12 February 2020

Date of calibration: 13 February 2020

Calibrated by: Ng
Calibration Technician

Certified by: Mr. Ng Yan Wa
Laboratory Manager

Date of issue: 13 February 2020

Certificate No.: APJ19-160-CC001



Page 1 of 4

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: 23.7°C
 Air Pressure: 1006 hPa
 Relative Humidity: 66.2 %

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV180064	HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
34.2-136.2	dBA SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
34.2-136.2	dBA SPL	Fast	94	1000	94.0	Ref
			104		104.0	±0.3
			114		114.0	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
34.2-136.2	dBA SPL	Fast	94	1000	94.0	Ref
		Slow			94.0	±0.3

Certificate No.: APJ19-160-CC001



Page 2 of 4

Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
34.2-136.2	dB	SPL	Fast	94	31.5	94.1	±2.0
					63	94.0	±1.5
					125	93.9	±1.5
					250	93.9	±1.4
					500	93.9	±1.4
					1000	94.0	Ref
					2000	94.1	±1.6
					4000	93.9	±1.6
				8000	91.2	+2.1; -3.1	

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
34.2-136.2	dBA	SPL	Fast	94	31.5	54.8	-39.4±2.0
					63	67.8	-26.2±1.5
					125	77.9	-16.1±1.5
					250	85.3	-8.6±1.4
					500	90.7	-3.2±1.4
					1000	94.0	Ref
					2000	95.3	+1.2±1.6
					4000	94.9	+1.0±1.6
				8000	90.1	-1.1±2.1; -3.1	

C-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
34.2-136.2	dBC	SPL	Fast	94	31.5	91.1	-3.0±2.0
					63	93.2	-0.8±1.5
					125	93.7	-0.2±1.5
					250	93.9	-0.0±1.4
					500	93.9	-0.0±1.4
					1000	94.0	Ref
					2000	93.8	-0.2±1.6
					4000	93.1	-0.8±1.6
				8000	88.2	-3.0 +2.1: -3.1	



Certificate No.: APJ19-160-CC001

Page 3 of 4

5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.15
	63 Hz	± 0.10
	125 Hz	± 0.10
	250 Hz	± 0.10
	500 Hz	± 0.10
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.15
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.



Certificate of Calibration

for

Description: *Sound Level Meter*
Manufacturer: *NTi*
Type No.: *XL2 (Serial No.: A2A-13661-E0)*
Microphone: *ACO 7052 (Serial No.: 73784)*
Preamplifier: *NTi Audio MA220 (M2211) (Serial No.:6282)*

Submitted by:

Customer: *Acuity Sustainability Consulting Limited*
Address: *Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing
Hong Street, Cheung Sha Wan, Kowloon*

Upon receipt for calibration, the instrument was found to be:

- Within
 Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 22 September 2020

Date of calibration: 23 September 2020

Calibrated by: *Jason Leung*
Calibration Technician

Certified by: *Mr. Tang Cheuk Hang*
Mr. Tang Cheuk Hang
Quality Manager

Date of issue: 23 September 2020

Certificate No.: APJ20-107-CC001



Page 1 of 4

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: 24.9 °C
 Air Pressure: 1006 hPa
 Relative Humidity: 64.5 %

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV200041	HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)				Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz		
40-140	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)				Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz		
30-130	dBA	SPL	Fast	94	1000	94.0	Ref
				104		104.0	±0.3
				114		114.1	±0.3

Time Weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz		
30-130	dBA	SPL	Fast	94	1000	94.0	Ref
			Slow			94.0	±0.3

Certificate No.: APJ20-107-CC001



Page 2 of 4

Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
30-130	dB	SPL	94	Fast	31.5	94.3	±2.0
					63	94.2	±1.5
					125	94.2	±1.5
					250	94.1	±1.4
					500	94.1	±1.4
					1000	94.0	Ref
					2000	94.2	±1.6
					4000	94.9	±1.6
					8000	94.9	+2.1; -3.1

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
30-130	dBA	SPL	94	Fast	31.5	54.9	-39.4±2.0
					63	68.0	-26.2±1.5
					125	78.1	-16.1±1.5
					250	85.5	-8.6±1.4
					500	90.9	-3.2±1.4
					1000	94.0	Ref
					2000	95.4	+1.2±1.6
					4000	95.9	+1.0±1.6
					8000	93.8	-1.1±2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
30-130	dBC	SPL	94	Fast	31.5	91.3	-3.0±2.0
					63	93.4	-0.8±1.5
					125	94.0	-0.2±1.5
					250	94.1	-0.0±1.4
					500	94.1	-0.0±1.4
					1000	94.0	Ref
					2000	94.1	-0.2±1.6
					4000	94.1	-0.8±1.6
					8000	92.9	-3.0±2.1; -3.1

5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 0.05
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.



Certificate of Calibration

for

Description: Sound Level Meter
Manufacturer: NTi Audio
Type No.: XL2 (Serial No.: A2A-13663-E0)
Microphone: ACO 7052 (Serial No.: 73912)
Preamplifier: NTi Audio MA220 (Serial No.: 5735)

Submitted by:

Customer: Acuity Sustainability Consulting Limited
Address: Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street,
Cheung Sha Wan, Kowloon, Hong Kong

Upon receipt for calibration, the instrument was found to be:

- Within
 Outside


the allowable tolerance.


The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 08 September 2020

Date of calibration: 09 September 2020

Calibrated by: 
Calibration Technician

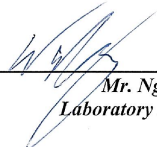Certified by: 
Mr. Ng Yan Wa
Laboratory Manager

Date of issue: 09 September 2020

Certificate No.: APJ20-104-CC001



Page 1 of 4

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: _____ 23.8°C
 Air Pressure: _____ 1008 hPa
 Relative Humidity: _____ 62.5%

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV200041	HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)			Applied value		UUT Reading	IEC 61672 Class 1	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading	IEC 61672 Class 1	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	94	1000	94.0	Ref
				104		104.0	±0.3
				114		114.0	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading	IEC 61672 Class 1	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	94	1000	94.0	Ref
			Slow			94.0	±0.3

Frequency Response

Linear Response

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dB	SPL	Fast	94	31.5	94.3	±2.0
					63	94.3	±1.5
					125	94.3	±1.5
					250	94.2	±1.4
					500	94.1	±1.4
					1000	94.0	Ref
					2000	93.8	±1.6
					4000	93.6	±1.6
				8000	93.4	+2.1; -3.1	

A-weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	94	31.5	54.8	-39.4±2.0
					63	68.0	-26.2±1.5
					125	78.1	-16.1±1.5
					250	85.5	-8.6±1.4
					500	90.8	-3.2±1.4
					1000	94.0	Ref
					2000	95.0	+1.2±1.6
					4000	94.6	+1.0±1.6
				8000	92.3	-1.1+2.1; -3.1	

C-weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBC	SPL	Fast	94	31.5	91.2	-3.0±2.0
					63	93.4	-0.8±1.5
					125	94.1	-0.2±1.5
					250	94.1	-0.0±1.4
					500	94.1	-0.0±1.4
					1000	94.0	Ref
					2000	93.6	-0.2±1.6
					4000	92.8	-0.8±1.6
				8000	90.4	-3.0+2.1; -3.1	

5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 0.05
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate of Calibration

for

Description: *Sound Level Meter*
Manufacturer: *NTi Audio*
Type No.: *XL2 (Serial No.: A2A-13548-E0)*
Microphone: *ACO 7052 (Serial No.:73780)*
Preamplifier: *NTi Audio MA220 (Serial No.:5235)*

Submitted by:

Customer: *Acuity Sustainability Consulting Limited*
Address: *Unit C, 11/F., Ford Glory Plaza, No. 37-39 Wing Hong Street,
Cheung Sha Wan, Kowloon*

Upon receipt for calibration, the instrument was found to be:

- Within**
 Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 7 January 2020

Date of calibration: 10 January 2020

Calibrated by: 
Calibration Technician

Certified by: 
Tang Cheuk Hang
Quality Manager

Date of issue: 10 January 2020

Certificate No.: APJ19-143-CC001



Page 1 of 4

**1. Calibration Precaution:**

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: 23.0 °C
 Air Pressure: 1006 hPa
 Relative Humidity: 71.0 %

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV180064	HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA SPL	Fast	94	1000	94.0	±0.4	


Linearity

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA SPL	Fast	94	1000	94.0	Ref	
			104		104.0	±0.3	
			114		114.0	±0.3	

Time Weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA SPL	Fast	94	1000	94.0	Ref	
		Slow			94.0	±0.3	

Certificate No.: APJ19-143-CC001

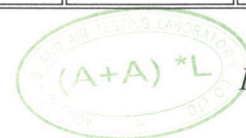

Page 2 of 4

Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
30-130	dB	SPL	Fast	94	31.5	94.0	±2.0
					63	94.1	±1.5
					125	94.1	±1.5
					250	94.0	±1.4
					500	94.0	±1.4
					1000	94.0	Ref
					2000	93.8	±1.6
					4000	93.4	±1.6
					8000	92.4	+2.1; -3.1

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
30-130	dBA	SPL	Fast	94	31.5	54.8	-39.4±2.0
					63	67.9	-26.2±1.5
					125	78.0	-16.1±1.5
					250	85.4	-8.6±1.4
					500	90.8	-3.2±1.4
					1000	94.0	Ref
					2000	95.0	+1.2±1.6
					4000	94.4	+1.0±1.6
					8000	91.3	-1.1±2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB	
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz			
30-130	dBC	SPL	Fast	94	31.5	91.0	-3.0±2.0
					63	93.3	-0.8±1.5
					125	93.9	-0.2±1.5
					250	94.1	-0.0±1.4
					500	94.1	-0.0±1.4
					1000	94.0	Ref
					2000	93.6	-0.2±1.6
					4000	92.6	-0.8±1.6
					8000	89.4	-3.0±2.1; -3.1

5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.05
	125 Hz	± 0.10
	250 Hz	± 0.10
	500 Hz	± 0.10
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.





綜合試驗有限公司

SOILS & MATERIALS ENGINEERING CO., LTD.

香港新界葵涌永基路22-24號椰林閣集團大廈全幢

The Whole Block of YLK Group Building, Nos. 22-24 Wing Kei Road, Kwai Chung, New Territories, Hong Kong.

Tel: (852) 2873 6860 Fax: (852) 2555 7533 E-mail: smec@cigismec.com Website: www.cigismec.com



CERTIFICATE OF CALIBRATION

Certificate No.: 20CA0803 01

Page: 1 of 2

Item tested

Description: Acoustical Calibrator (Class 1)
Manufacturer: Pulsar Instruments Ltd.
Type/Model No.: 105
Serial/Equipment No.: 63705
Adaptors used: -

Item submitted by

Customer: Acuity Sustainability Consulting Limited.
Address of Customer: -
Request No.: -
Date of receipt: 03-Aug-2020

Date of test: 06-Aug-2020

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2341427	11-May-2021	SCL
Preamplifier	B&K 2673	2743150	03-Jun-2021	CEPREI
Measuring amplifier	B&K 2610	2346941	03-Jun-2021	CEPREI
Signal generator	DS 360	33873	19-May-2021	CEPREI
Digital multi-meter	34401A	US36087050	19-May-2021	CEPREI
Audio analyzer	8903B	GB41300350	18-May-2021	CEPREI
Universal counter	53132A	MY40003662	18-May-2021	CEPREI

Ambient conditions

Temperature: 22 ± 1 °C
Relative humidity: 55 ± 10 %
Air pressure: 1005 ± 5 hPa

Test specifications


- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.


Details of the performed measurements are presented on page 2 of this certificate.

Approved Signatory:

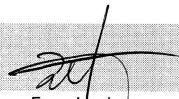
Feng Junqi

Date: 07-Aug-2020

Company Chop:

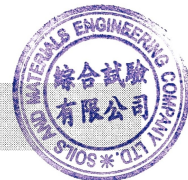

Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



綜合試驗有限公司

SOILS & MATERIALS ENGINEERING CO., LTD.

香港新界葵涌永基路22-24號椰林閣集團大廈全幢

The Whole Block of YLK Group Building, Nos. 22-24 Wing Kei Road, Kwai Chung, New Territories, Hong Kong.

Tel: (852) 2873 6860 Fax: (852) 2555 7533 E-mail: smec@cigismec.com Website: www.cigismec.com



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 20CA0803 01

Page: 2 of 2

1, Measured Sound Pressure Level

The output Sound Pressure Level in the calibrator head was measured at the setting and frequency shown using a calibrated laboratory standard microphone and insert voltage technique. The results are given in below with the estimated uncertainties.

Frequency Shown Hz	Output Sound Pressure Level Setting dB	Measured Output Sound Pressure Level dB	(Output level in dB re 20 μ Pa)
			Estimated Expanded Uncertainty dB
1000	94.00	93.78	0.10

2, Sound Pressure Level Stability - Short Term Fluctuations

The Short Term Fluctuations was determined by measuring the maximum and minimum of the fast weighted DC output of the B&K 2610 measuring amplifier over a 20 second time interval as required in the standard. The Short Term Fluctuation was found to be:

At 1000 Hz STF = 0.027 dB

Estimated expanded uncertainty 0.005 dB

3, Actual Output Frequency

The determination of actual output frequency was made using a B&K 4180 microphone together with a B&K 2673 preamplifier connected to a B&K 2610 measuring amplifier. The AC output of the B&K 2610 was taken to an universal counter which was used to determine the frequency averaged over 20 second of operation as required by the standard. The actual output frequency at 1 KHz was:

At 1000 Hz Actual Frequency = 1000.3 Hz

Estimated expanded uncertainty 0.1 Hz Coverage factor k = 2.2

4, Total Noise and Distortion

For the Total Noise and Distortion measurement, the unfiltered AC output of the B&K 2610 measuring amplifier was connected to an Agilent Type 8903 B distortion analyser. The TND result at 1 KHz was:

At 1000 Hz TND = 0.6 %

Estimated expanded uncertainty 0.7 %

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Fung Chi Yik

Date: 06-Aug-2020

Checked by:

Feng Junqi

Date: 07-Aug-2020

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.

Appendix I Event / Action Plan for Noise Exceedance

Event	Actions to be taken by Environmental Team as immediate as practicable	Actions to be taken by Independent Environmental Checker as immediate as practicable	Actions to be taken by Supervising Officer's Representative as immediate as practicable	Actions to be taken by Contractor as immediate as practicable
Action Level being exceeded	<ol style="list-style-type: none"> 1. Notify IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, SO and Contractor; 4. Discuss with the IEC and Contractor on remedial measures required; 5. Increase monitoring frequency to check mitigation effectiveness. (The above actions should be taken within 2 working days after the exceedance is identified) 	<ol style="list-style-type: none"> 1. Review the investigation results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the SO accordingly; 3. Advise the SO on the effectiveness of the proposed remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified). 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified). 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC and SO; 2. Implement noise mitigation proposals. (The above actions should be taken within 2 working days after the exceedance is identified)
Limit Level being exceeded	<ol style="list-style-type: none"> 1. Inform IEC, SO, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and SO on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results; 8. If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified) 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; (The above actions should be taken within 2 working days after the exceedance is identified) 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified) 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC and SO within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the SO until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)

Appendix J Noise Monitoring Data

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 1 (M1 / N_S1)

Monitoring date: 1, 7, 14, 21, 28 December 2020 (Daytime)

1&2, 7&8, 14&15, 21&22, 28&29 December 2020 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Air-conditioning units nearby

Noise Monitoring data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
1 Dec 2020	16:02	-	16:32	Sunny	55.5	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
1 Dec 2020	19:02	-	19:07	Fine	59.0	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	20:02	-	20:07		55.9		
	21:02	-	21:07		55.8		
2 Dec 2020	01:02	-	01:07	Fine	63.0	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	03:02	-	03:07		61.8		
	05:02	-	05:07		58.7		
7 Dec 2020	16:02	-	16:32	Fine	59.6	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
7 Dec 2020	19:02	-	19:07	Fine	63.4	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	20:02	-	20:07		58.4		
	21:02	-	21:07		54.1		
8 Dec 2020	01:02	-	01:07	Fine	63.2	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	03:02	-	03:07		54.9		
	05:02	-	05:07		53.9		
14 Dec 2020	16:02	-	16:32	Sunny	56.2	XL2 (Serial No. A2A-13661-E0)	Pulsar 105 (No. 63705)
14 Dec 2020	19:02	-	19:07	Fine	51.9	XL2 (Serial No. A2A-13661-E0)	Pulsar 105 (No. 63705)
	20:02	-	20:07		53.6		
	21:02	-	21:07		63.1		
15 Dec 2020	01:02	-	01:07	Fine	54.4	XL2 (Serial No. A2A-13661-E0)	Pulsar 105 (No. 63705)
	03:02	-	03:07		54.8		
	05:02	-	05:07		55.3		
21 Dec 2020	16:01	-	16:31	Sunny	54.7	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)

Date	Start time		End time	Weather	L_{eq 30min} dB(A) / L_{eq 5min} dB(A)	Sound Level Meter Used	Calibrator Used
21 Dec 2020	19:01	-	19:06	Fine	54.3	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	20:01	-	20:06		51.7		
	21:01	-	21:06		54.8		
22 Dec 2020	01:01	-	01:06	Fine	55.4	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	03:01	-	03:06		55.2		
	05:01	-	05:06		56.4		
28 Dec 2020	16:03	-	16:38	Sunny	55.3	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
28 Dec 2020	19:03	-	19:08	Fine	55.4	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	20:03	-	20:08		56.7		
	21:03	-	21:08		56.3		
29 Dec 2020	01:03	-	01:08	Fine	54.9	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	03:03	-	03:08		53.6		
	05:03	-	05:08		55.1		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 2 (M2 / N_S2)

Monitoring date: 1, 7, 14, 21, 28 December 2020 (Daytime)

1&2, 7&8, 14&15, 21&22, 28&29 December 2020 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)

Noise source other than construction activities from the Project: Nil

Noise Monitoring data:

Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
1 Dec 2020	16:04	-	16:34	Sunny	57.0	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
1 Dec 2020	19:04	-	19:09	Fine	56.4	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	20:04	-	20:09		57.2		
	21:04	-	21:09		55.9		
2 Dec 2020	01:04	-	01:09	Fine	56.2	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	03:04	-	03:09		55.6		
	05:04	-	05:09		54.8		
7 Dec 2020	16:01	-	16:31	Fine	58.3	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
7 Dec 2020	19:01	-	19:06	Fine	56.9	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	20:01	-	20:06		58.5		
	21:01	-	21:06		55.2		
8 Dec 2020	01:01	-	01:06	Fine	55.6	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	03:01	-	03:06		56.7		
	05:01	-	05:06		54.8		
14 Dec 2020	16:05	-	16:35	Sunny	56.8	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
14 Dec 2020	19:05	-	19:10	Fine	50.3	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	20:05	-	20:10		52.5		
	21:05	-	21:10		58.7		
15 Dec 2020	01:05	-	01:10	Fine	60.1	XL2 (Serial No. A2A-13663-E0)	Pulsar 105 (No. 63705)
	03:05	-	03:10		54.9		
	05:05	-	05:10		55.5		
21 Dec 2020	16:02	-	16:32	Sunny	69.8	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)

Date	Start time		End time	Weather	L_{eq 30min} dB(A) / L_{eq 5min} dB(A)	Sound Level Meter Used	Calibrator Used
21 Dec 2020	19:02	-	19:07	Fine	58.9	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	20:02	-	20:07		55.1		
	21:02	-	21:07		54.3		
22 Dec 2020	01:02	-	01:07	Fine	56.7	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	03:02	-	03:07		50.9		
	05:02	-	05:07		52.9		
28 Dec 2020	16:04	-	16:39	Sunny	60.5	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
28 Dec 2020	19:04	-	19:09	Fine	54.0	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	20:04	-	20:09		56.7		
	21:04	-	21:09		59.5		
29 Dec 2020	01:04	-	01:09	Fine	58.7	XL2 (Serial No. A2A-13548-E0)	Pulsar 105 (No. 63705)
	03:04	-	03:09		57.6		
	05:04	-	05:09		53.5		

Location: Shek Kwu Chau Treatment & Rehabilitation Centre Hostel 3 (M3 / N_S3)

Monitoring date: 1, 7, 14, 21, 28 December 2020 (Daytime)

1&2, 7&8, 14&15, 21&22, 28&29 December 2020 (Evening & Night time)

Parameter : $L_{eq\ 30min}$ (Daytime), $L_{eq\ 5min}$ (Evening & Night time)


Noise source other than construction activities from the Project: Air-conditioning units nearby

Noise Monitoring data:


Date	Start time		End time	Weather	$L_{eq\ 30min}$ dB(A) / $L_{eq\ 5min}$ dB(A)	Sound Level Meter Used	Calibrator Used
1 Dec 2020	16:03	-	16:33	Sunny	50.0	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
1 Dec 2020	19:03	-	19:08	Fine	52.2	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	20:03	-	20:08		48.0		
	21:03	-	21:08		57.9		
2 Dec 2020	01:03	-	01:08	Fine	62.1	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	03:03	-	03:08		60.0		
	05:03	-	05:08		48.2		
7 Dec 2020	16:01	-	16:31	Fine	58.8	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
7 Dec 2020	19:01	-	19:06	Fine	60.7	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	20:01	-	20:06		57.0		
	21:01	-	21:06		61.4		
8 Dec 2020	01:01	-	01:06	Fine	61.6	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	03:01	-	03:06		58.3		
	05:01	-	05:06		53.0		
14 Dec 2020	16:01	-	16:31	Sunny	53.8	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
14 Dec 2020	19:01	-	19:06	Fine	57.2	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	20:01	-	20:06		49.3		
	21:01	-	21:06		49.5		
15 Dec 2020	01:01	-	01:06	Fine	53.6	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	03:01	-	03:06		51.5		
	05:01	-	05:06		50.8		
21 Dec 2020	16:02	-	16:32	Sunny	61.2	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)

Date	Start time		End time	Weather	L_{eq 30min} dB(A) / L_{eq 5min} dB(A)	Sound Level Meter Used	Calibrator Used
21 Dec 2020	19:02	-	19:07	Fine	52.4	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	20:02	-	20:07		51.1		
	21:02	-	21:07		53.0		
22 Dec 2020	01:02	-	01:07	Fine	59.9	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	03:02	-	03:07		59.5		
	05:02	-	05:07		52.6		
28 Dec 2020	16:05	-	16:35	Sunny	56.2	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
28 Dec 2020	19:05	-	19:10	Fine	52.2	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	20:05	-	20:10		52.4		
	21:05	-	21:10		48.9		
29 Dec 2020	01:05	-	01:10	Fine	52.3	SVAN 971 (Serial No. 77731)	Pulsar 105 (No. 63705)
	03:05	-	03:10		53.4		
	05:05	-	05:10		54.3		


Impact Noise Monitoring Results during Day Time (0700 - 1900 hours)

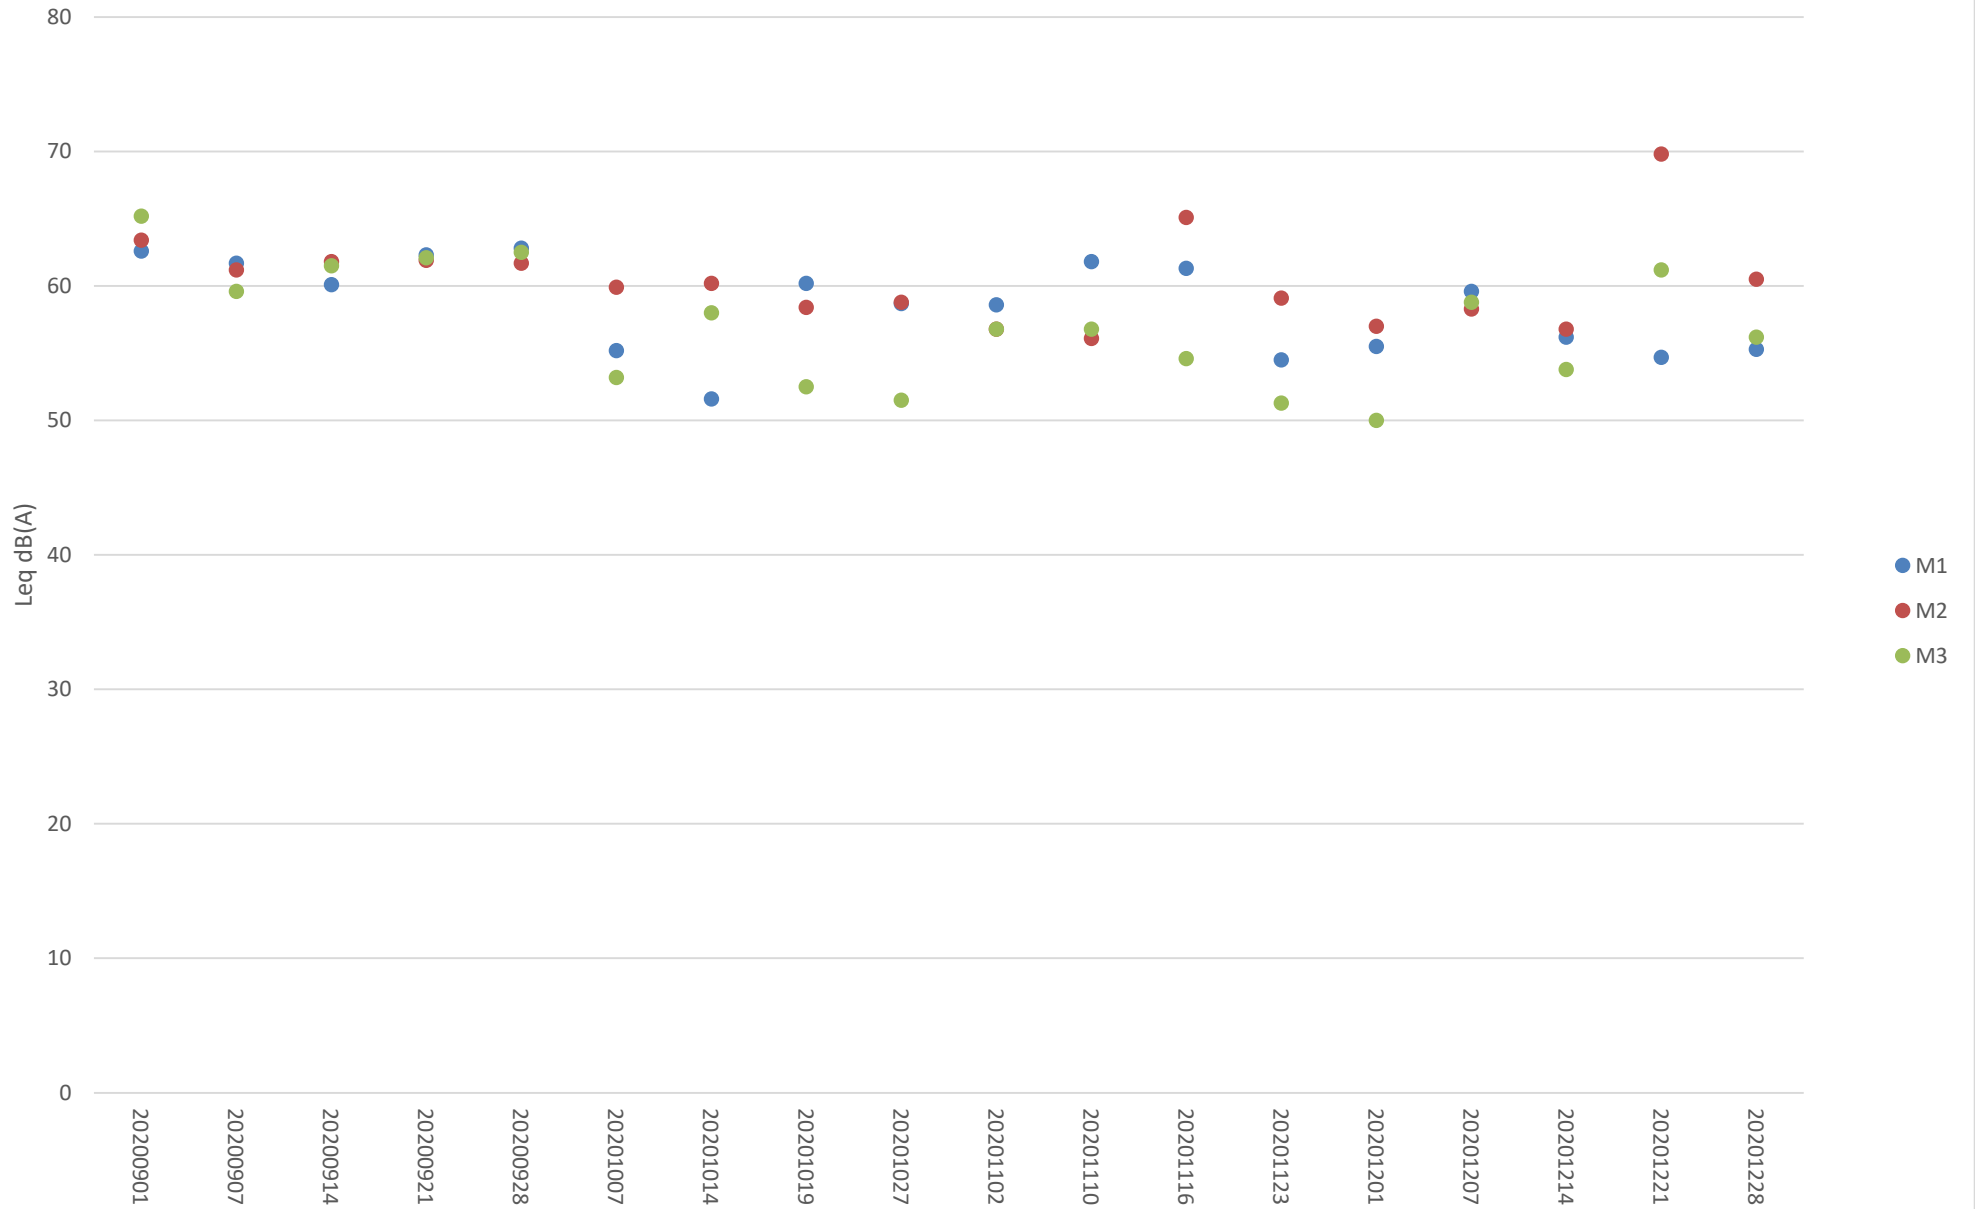

Additional Impact Noise Monitoring Results during Evening Time (1900 - 2300 hours)

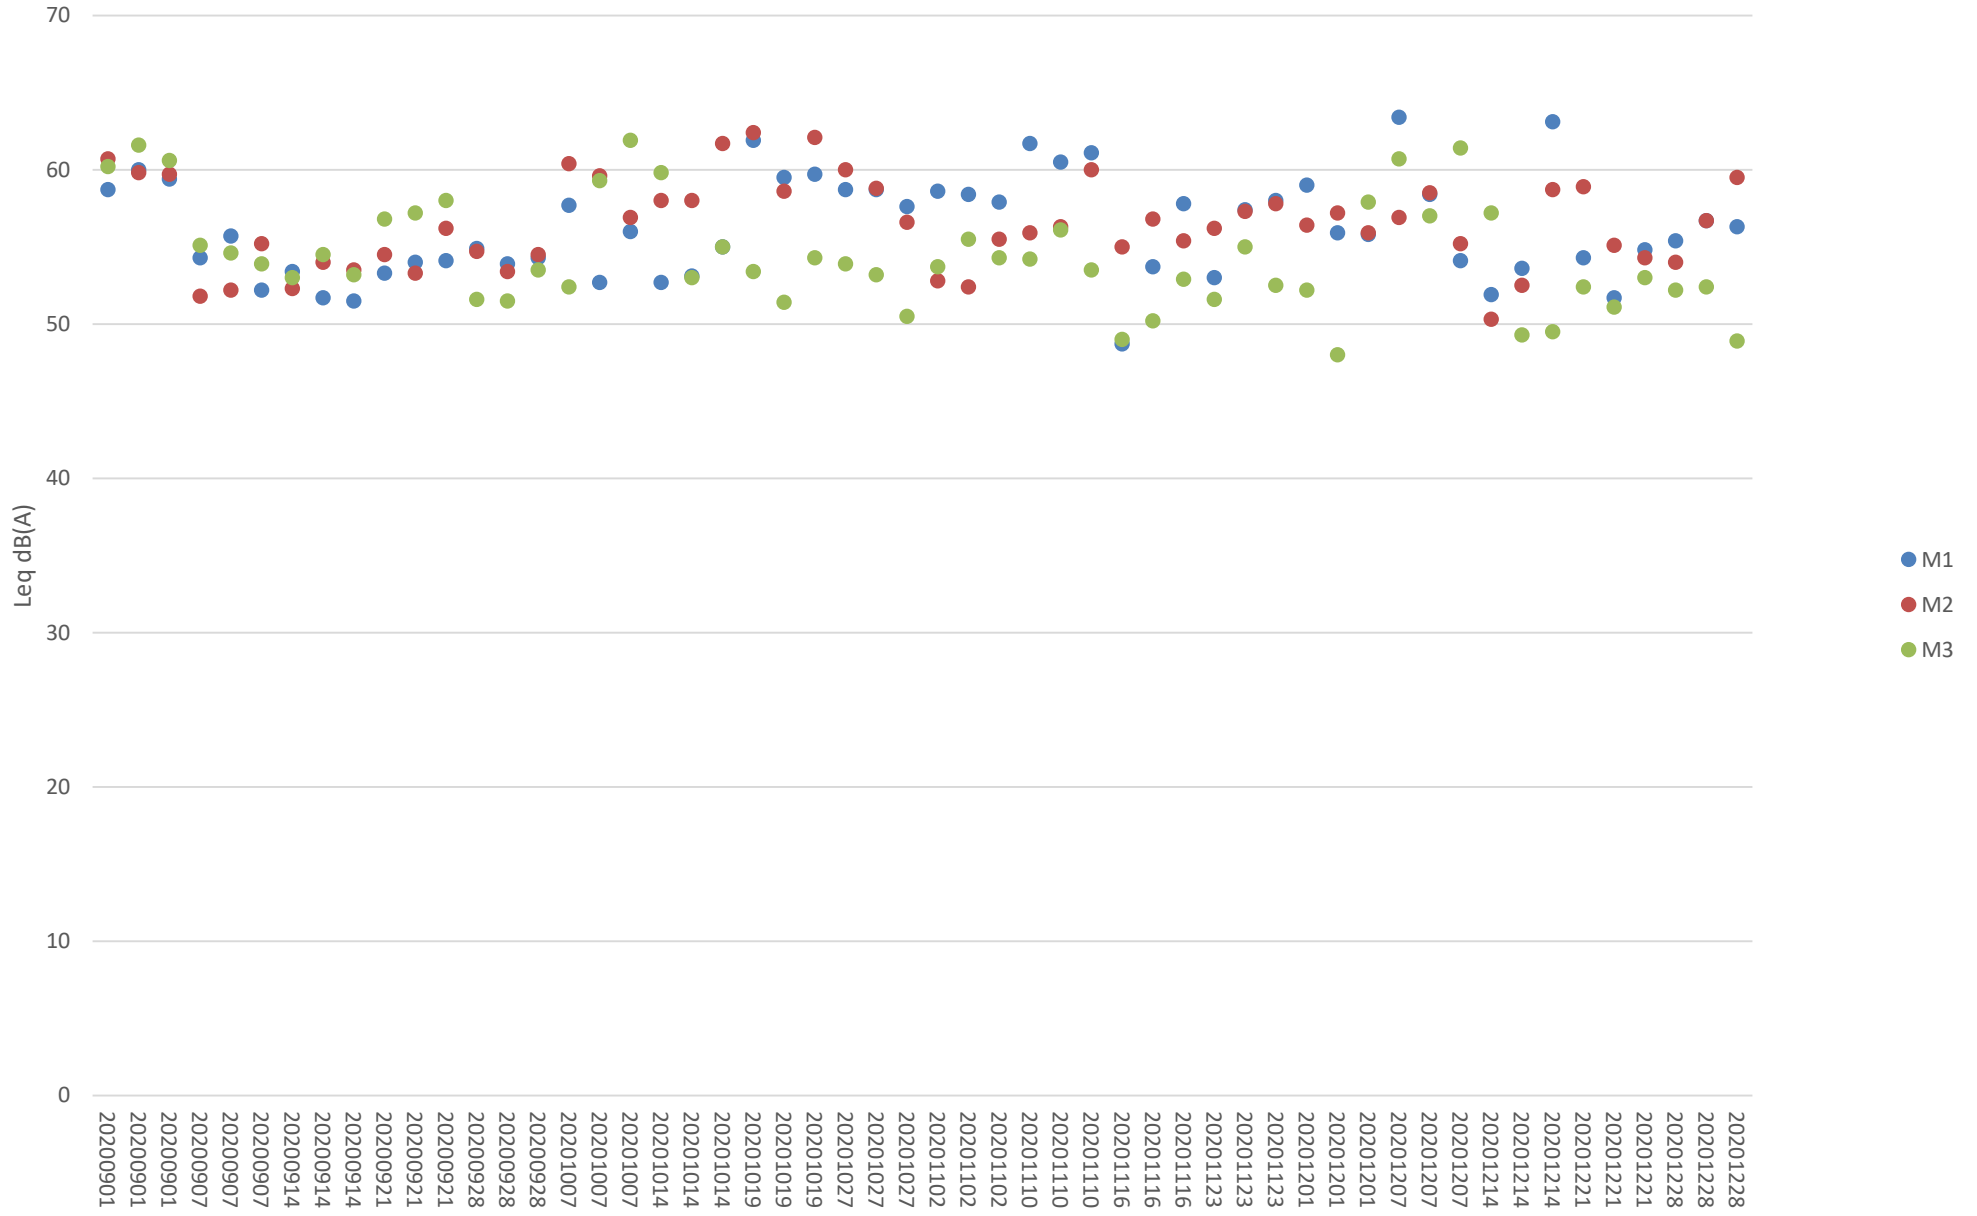

Additional Impact Noise Monitoring Results during Night Time (2300 - 0700 hours)

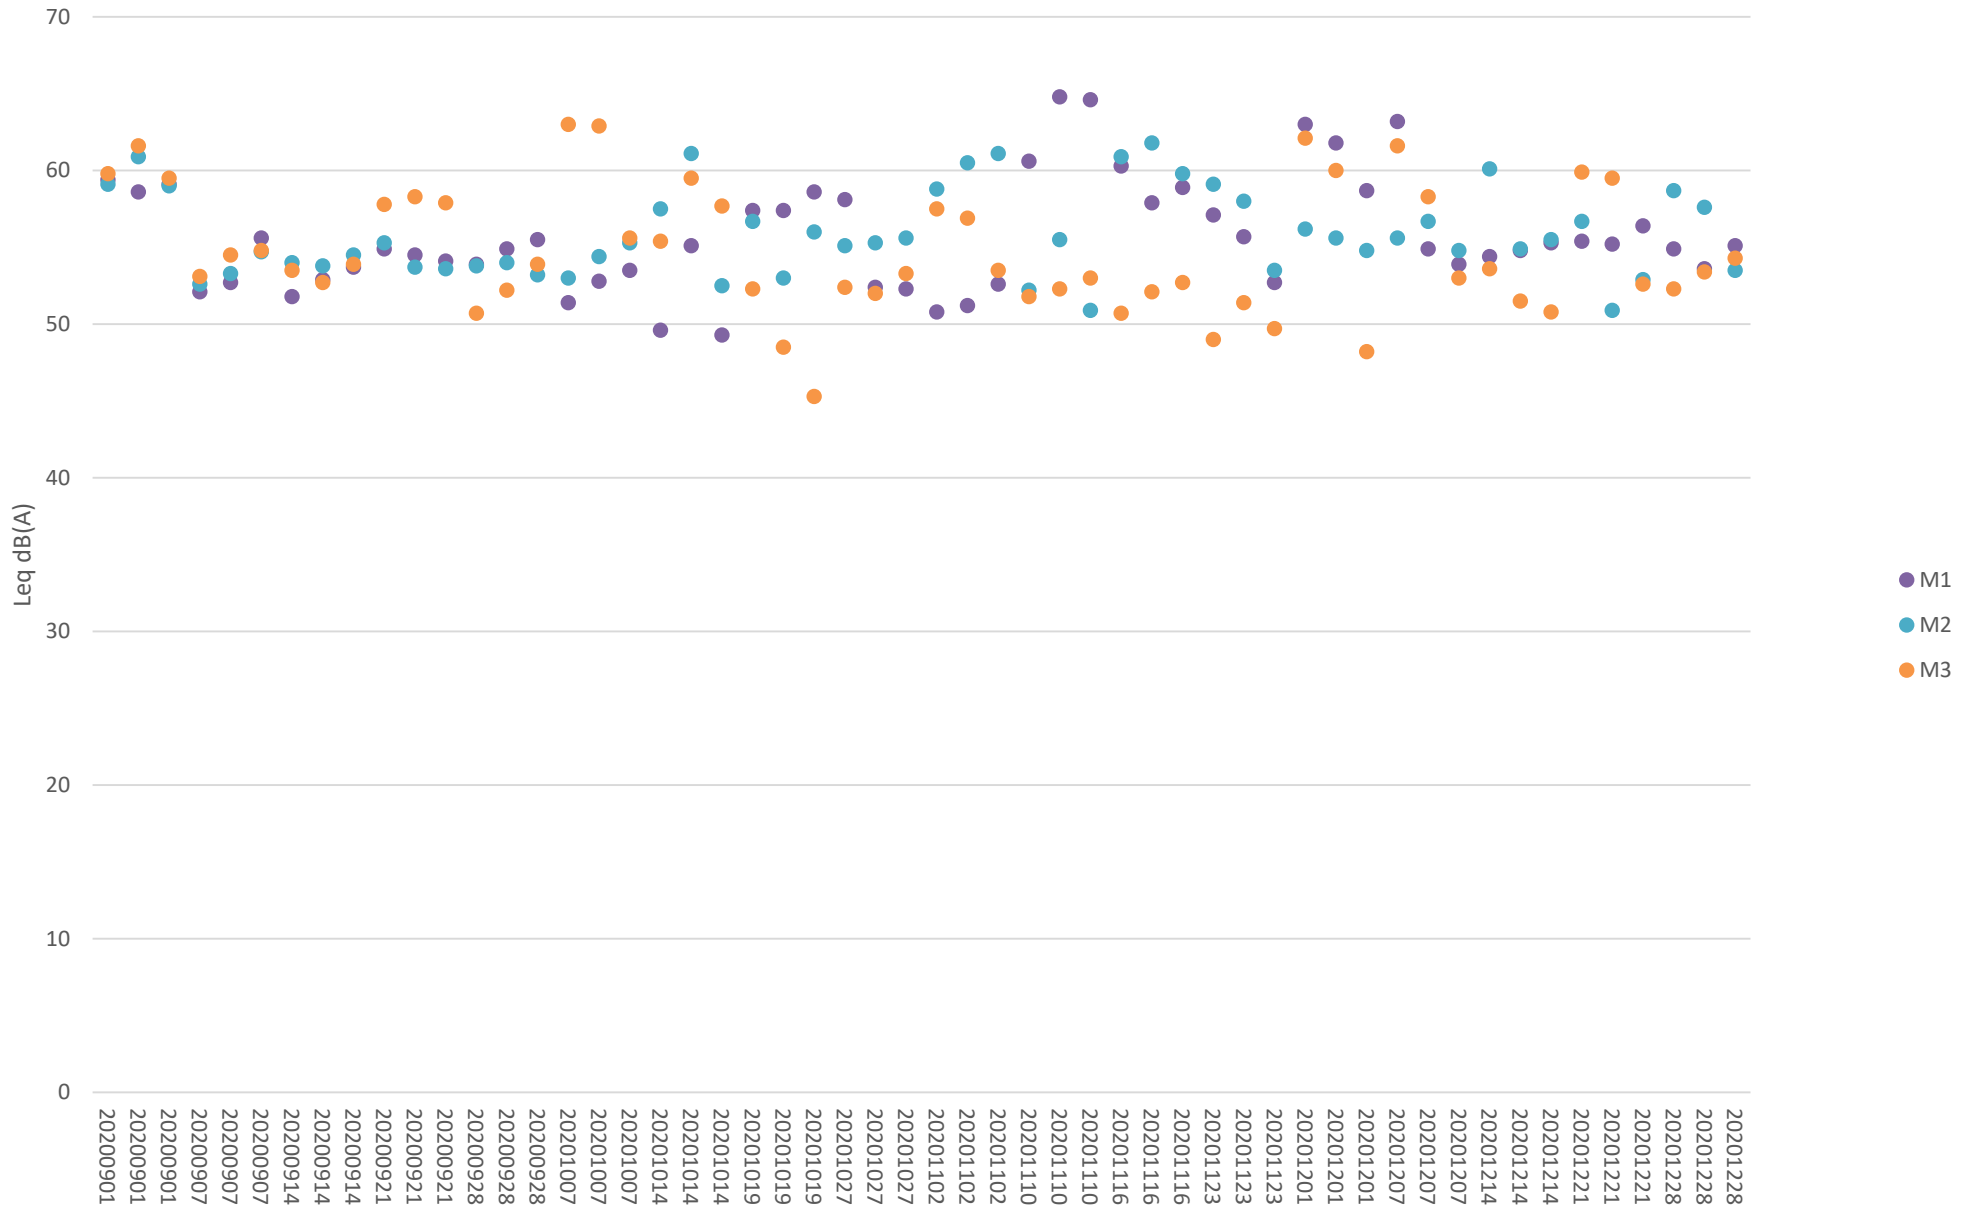

Appendix K Waste Flow Table



Monthly Summary Waste Flow Table for 2018 (year)

Project : Integrated Waste Management Facilities, Phase 1

Contract No.: EP/SP/66/12

Month	Actual Quantities of Inert C&D Materials Generated Monthly								Actual Quantities of C&D Wastes Generated Monthly					
	Total Quantity Generated	Hard Rock and Large Broken Concrete (see Note 1)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill Sand	Imported Fill Public fill	Imported Fill Rock	Metals	Paper/ cardboard packaging	Plastics (see Note 2)	Chemical Waste		Others, e.g. general refuse (see Note 3)
	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)			(in ,000 kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000L)	(in ,000 m ³)
Jan	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Feb	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Mar	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Apr	0	0	0	0	0	0	0	0	0	0	0	0	0	0
May	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Jun	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Sub-total	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Jul	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Aug	0	0	0	0	0	0	0	0	0	0	0	0	0	0.0065
Sep	0	0	0	0	0	2.9619	0	0	0	0	0	0	0	0
Oct	0	0	0	0	0	3.0771	0	0	0	0	0	0	0	0.0130
Nov	0	0	0	0	0	6.7871	0	0	0	0	0	0	0	0
Dec	0	0	0	0	0	59.0709	0	0	0	0	0	0.2000	0.8700	0
Total	0	0	0	0	0	71.8970	0	0	0	0	0	0.2000	0.8700	0.0195

- Notes:
- (1) Broken concrete for recycling into aggregates.
 - (2) Plastics refer to plastic bottles/ containers, plastic sheets/ foam from packaging materials.
 - (3) Use the conversion factor : 1 full load of dumping truck being equivalent to 6.5m³ by volume.



Monthly Summary Waste Flow Table for 2019 (year)

Project : Integrated Waste Management Facilities, Phase 1

Contract No.: EP/SP/66/12

Month	Actual Quantities of Inert C&D Materials Generated Monthly								Actual Quantities of C&D Wastes Generated Monthly					
	Total Quantity Generated	Hard Rock and Large Broken Concrete (see Note 1)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill Sand	Imported Fill Public fill	Imported Fill Rock	Metals	Paper/ cardboard packaging	Plastics (see Note 2)	Chemical Waste		Others, e.g. general refuse (see Note 3)
	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)			(in ,000 kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000L)	(in ,000 m ³)
Jan	0	0	0	0	0	82.6139	0	0	0	0	0	0	0	0.0065
Feb	0	0	0	0	0	46.7821	0	0	0	0	0	0	0	0
Mar	0	0	0	0	0	97.1000	0	0.7552	0	0.2560	0	0	0	0
Apr	0	0	0	0	0	58.0413	0	0	0	0	0	0	0	0
May	0	0	0	0	0	14.5625	0	1.4648	0	0	0	0	0	0.0065
Jun	0	0	0	0	0	0	0	6.8421	0	0	0	0	0	0
Sub-total	0	0	0	0	0	299.0998	0	9.0621	0	0.2560	0	0	0	0.0130
Jul	0	0	0	0	0	0	0	0.4289	0	0	0	0	8.4000	0.0130
Aug	0	0	0	0	0	2.5775	0	10.5600	0	0	0	0	0	0
Sep	0	0	0	0	0	6.1081	0	8.4704	0	0.3530	0	0	0	0.0065
Oct	0	0	0	0	0	9.8875	0	7.1900	0	0	0	0	0	0
Nov	0	0	0	0	0	38.3088	0	19.3105	0	0	0	0	0	0.0195
Dec	0	0	0	0	0	54.3469	0	26.9807	0	0	0	0	0	0.0910
Total	0	0	0	0	0	410.3286	0	82.0026	0	0.6090	0	0	8.4000	0.1430

- Notes:
- (1) Broken concrete for recycling into aggregates.
 - (2) Plastics refer to plastic bottles/ containers, plastic sheets/ foam from packaging materials.
 - (3) Use the conversion factor : 1 full load of dumping truck being equivalent to 6.5m³ by volume.



Monthly Summary Waste Flow Table for 2020 (year)

Project : Integrated Waste Management Facilities, Phase 1

Contract No.: EP/SP/66/12

Month	Actual Quantities of Inert C&D Materials Generated Monthly								Actual Quantities of C&D Wastes Generated Monthly					
	Total Quantity Generated	Hard Rock and Large Broken Concrete (see Note 1)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill Sand	Imported Fill Public fill	Imported Fill Rock	Metals	Paper/ cardboard packaging	Plastics (see Note 2)	Chemical Waste		Others, e.g. general refuse (see Note 3)
	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)	(in ,000m ³)			(in ,000 kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000L)	(in ,000 m ³)
Jan	0	0	0	0	0	37.1550	0	25.0812	0	0	0	0	0	0.0065
Feb	0	0	0	0	0	27.7910	0	18.8300	0	0	0	0	0	0.0065
Mar	0	0	0	0	0	22.5669	0	26.1586	0	0	0	0	7.2000	0.0065
Apr	0	0	0	0	0	12.7800	0	10.1825	0	0	0	0	0	0.0195
May	0	0	0	0	0	16.1138	0	24.3740	0	0.4220	0	0	0	0.0195
Jun	0	0	0	0	0	31.5177	0	28.3030	0	0	0	0	0	0.0065
Sub-total	0	0	0	0	0	147.9244	0	132.9293	0	0.4220	0	0	7.2000	0.0650
Jul	0	0	0	0	0	34.7856	17.0606	35.1800	0	0	0	0	0	0.0195
Aug	0	0	0	0	0	27.1375	65.5667	27.9335	0	0	0	0	0	0
Sep	0	0	0	0	0	11.9813	110.1328	43.5435	0	0	0	0	0	0.0195
Oct	0	0	0	0	0	2.8213	131.6600	22.5415	0	0	0	0	0	0.0130
Nov	0	0	0	0	0	0	162.1811	44.6475	0	0.4090	0	0	0.4000	0.0130
Dec	0	0	0	0	0	0	174.9800	57.8380	0	0	0	0	0	0.0130
Total	0	0	0	0	0	224.6501	661.5812	364.6133	0	0.8310	0	0	7.6000	0.1430

- Notes:
- (1) Broken concrete for recycling into aggregates.
 - (2) Plastics refer to plastic bottles/ containers, plastic sheets/ foam from packaging materials.
 - (3) Use the conversion factor : 1 full load of dumping truck being equivalent to 6.5m³ by volume.

Appendix L Event / Action Plan for Coral Monitoring

Event	Action			
	ET Leader	IEC	SO	Contractor
Action Level Exceedance	1. Check monitoring data 2. Inform the IEC, SO ,and Contractor of the findings; 3. Increase the monitoring to at least once a month to confirm findings; 4. Propose mitigation measures for consideration	1. Discuss monitoring with the ET and the Contractor; 2. Review proposals for additional monitoring and any other measures submitted by the Contractor and advise the SO accordingly.	1. Discuss with the IEC additional monitoring requirements and any other measures proposed by the ET; 2. Make the agreement on the measures to be implemented.	1. Inform the SO and confirm notification of the non-compliance in writing; 2. Discuss with the ET and the IEC and propose measures to the IEC and the SO; 3. Implement the agreed measures.
Limit Level Exceedance	1. Undertake Steps 1-4 as in the Action Level Exceedance. If further exceedance of Limit Level, propose enhancement measures for consideration.	1. Discuss monitoring with the ET and the Contractor; 2. Review proposals for additional monitoring and any other measures submitted by the Contractor and advise the SO accordingly.	1. Discuss with the IEC additional monitoring requirements and any other measures proposed by the ET; 2. Make the agreement on the measures to be implemented.	1. Inform the SO and confirm notification of the non-compliance in writing; 2. Discuss with the ET and the IEC and propose measures to the IEC and the SO; 3. Implement the agreed measures.

Appendix M Event / Action Plan for White-Bellied Sea Eagle

Event	Action		
	Environmental Team	Audit Team	Contractor
Absence of White-bellied Sea Eagle during a whole day of monitoring.	<p>Inform audit team.</p> <p>Increase monitoring frequency to daily.</p>	<p>Inform site engineer and contractor.</p> <p>If the absence remains:</p> <ul style="list-style-type: none"> • Review construction activities and noise monitoring records of the associated period; • Identify potential causes of the absence; • Propose remedial measures, such as change of construction method and sequence; • Confirm the feasibility of the proposed remedial measures with site engineer and contractor; • Discuss with environmental team about the effectiveness of the proposed remedial measures. 	<p>Implement the agreed remedial measures.</p>


Appendix N Exceedance Report

Statistical Summary of Exceedances in the Reporting Period

Water Quality (Regular DCM)			
Location	Action Level	Limit Level	Total
B1	2	1	3
B2	1	1	2
B3	2	2	4
B4	1	1	2
CR1	1	0	1
CR2	2	1	3
F1A	1	1	2
H1	0	1	1
S1	0	0	0
S2A	0	0	0
S3	0	0	0
M1	0	0	0

Noise (Day Time)			
Location	Action Level	Limit Level	Total
M1	0	0	0
M2	0	0	0
M3	0	0	0
Noise (Evening Time)			
Location	Action Level	Limit Level	Total
M1	0	0	0
M2	0	0	0
M3	0	0	0
Noise (Night Time)			
Location	Action Level	Limit Level	Total
M1	0	0	0
M2	0	0	0
M3	0	0	0

Incident Report on Action Level or Limit Level Non-compliance

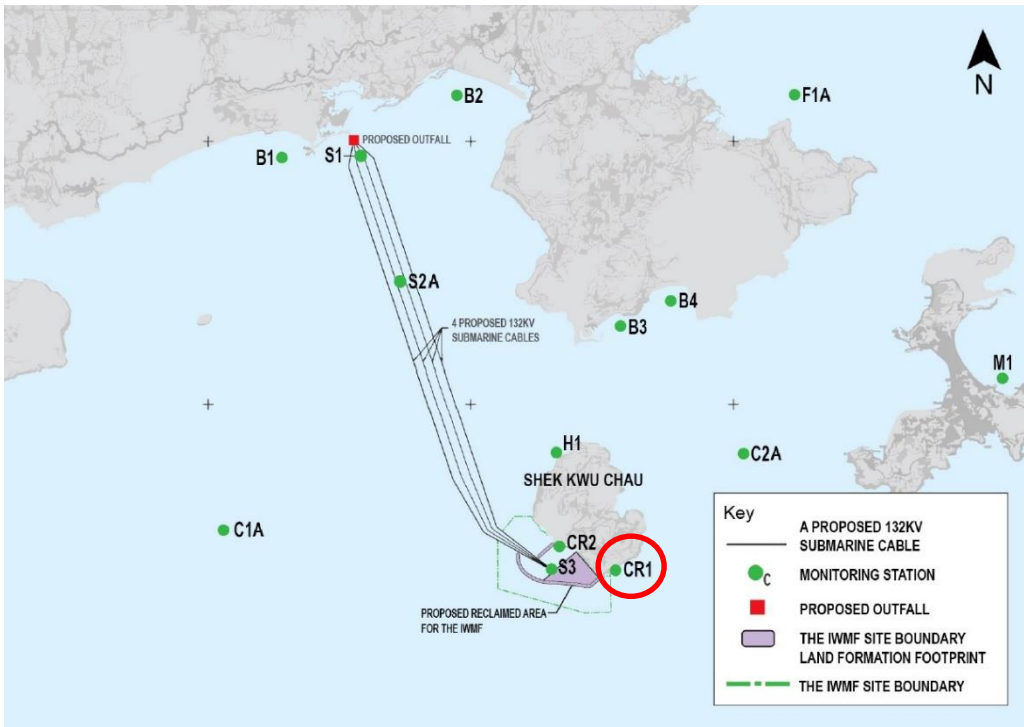Project	Integrated Waste Management Facilities, Phase 1		
Date	04 Dec 2020 (Lab result received on 09 Dec 2020)		
Time	12:45 – 16:15 (Mid-Ebb) 08:00 – 11:30 (Mid Flood)		
Mid-Ebb			
Monitoring Location	CR1 		
Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 9.0 mg/L (120% of C1A)		≥ 10.0 mg/L
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	9.8 mg/L (CR1)	7.5 mg/L (C1A) 6.8 mg/L (C2A)	6.5 mg/L (B1) 7.5 mg/L (B2) 8.5 mg/L (B3) 7.0 mg/L (B4) 6.7 mg/L (F1A) 7.3 mg/L (H1) 6.5 mg/L (M1) 7.3 mg/L (CR2)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 04 Dec 2020 include reclamation works, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Northwest to Southeast at waters around Shek Kwu Chau.</p> <p>CR1 is located close to the works location within the Project site while silt curtain checking by the Contractor was implemented on Marine Access (04 Dec 2020, 10:00am) and checking results showed that no deficiency of silt curtain was found on that day.</p> <p>From MMO monitoring records on 04 Dec 2020, MMO team was arranged for one derrick barge (DL-9) and silt curtain at western marine access area on that day while</p>		


no deficiency of silt curtain was found before the commencement of and during construction activity.

According to the field observation by Marine Mammal Observer team & sampling team during sampling event, no silt plume was observed in the Project site.


Site tidiness in the present barges in the Project site were checked during weekly site inspection on 01 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.


Mid-Flood

Monitoring Location

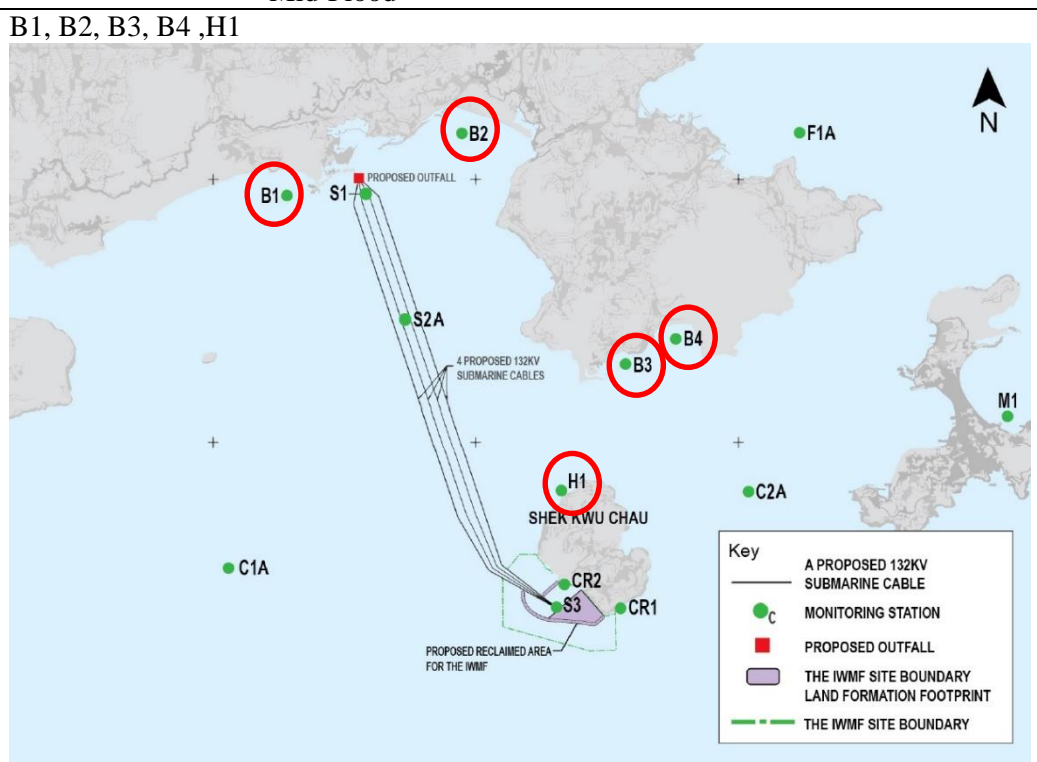


Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 10.8 mg/L (120% of C2A)		≥ 11.7 mg/L (130% of C2A)
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	12.0 mg/L (B1) 14.5 mg/L (B2) 16.0 mg/L (B3) 15.0 mg/L (B4) 12.8 mg/L (H1)	14.0 mg/L (C1A) 9.0 mg/L (C2A)	9.7 mg/L (F1A) 9.5 mg/L (M1) 6.8 mg/L (CR1) 6.2 mg/L (CR2)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 04 Dec 2020 include reclamation works, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from East to West at waters around Shek Kwu Chau.</p> <p>B1, B2, B3, B4 & H1 are located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedance of this monitoring station is deemed to be unrelated to the Project.</p> <p>Silt curtain checking by the Contractor was implemented on Marine Access (04 Dec 2020, 10:00am) and checking results showed that no deficiency of silt curtain was</p>		

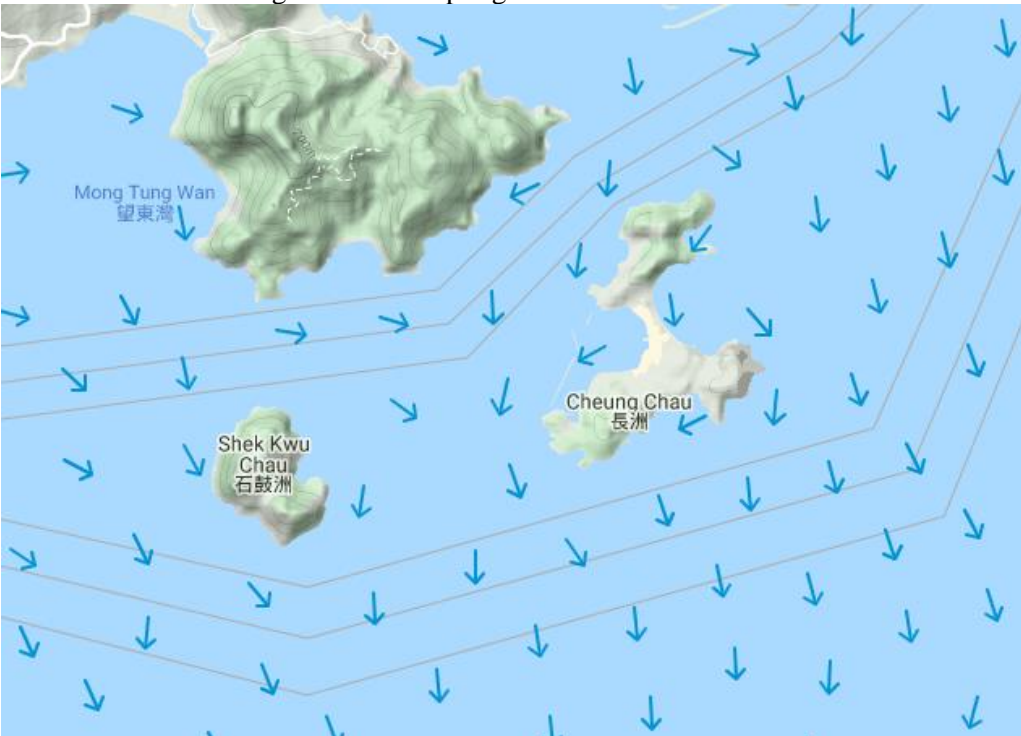	<p>found on that day.</p> <p>From MMO monitoring records on 04 Dec 2020, MMO team was arranged for one derrick barge (DL-9) and silt curtain at western marine access area on that day while no deficiency of silt curtain was found before the commencement of and during construction activity.</p> <p>According to the field observation by Marine Mammal Observer team & sampling team during sampling event, no silt plume was observed in the Project site.</p> <p>Site tidiness in the present barges in the Project site were checked during weekly site inspection on 01 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.</p>
<p>Actions taken / to be taken</p>	<p>Examination of environmental performance of the Project will be continued during the weekly inspection, and the Contractor is reminded to implement all applicable mitigation measures as per the Updated EM&A Manual.</p>
<p>Remarks</p>	<p>Current direction during mid-ebb sampling on 04 Dec 2020:</p>  <p>Current direction during mid-flood sampling on 04 Dec 2020:</p>

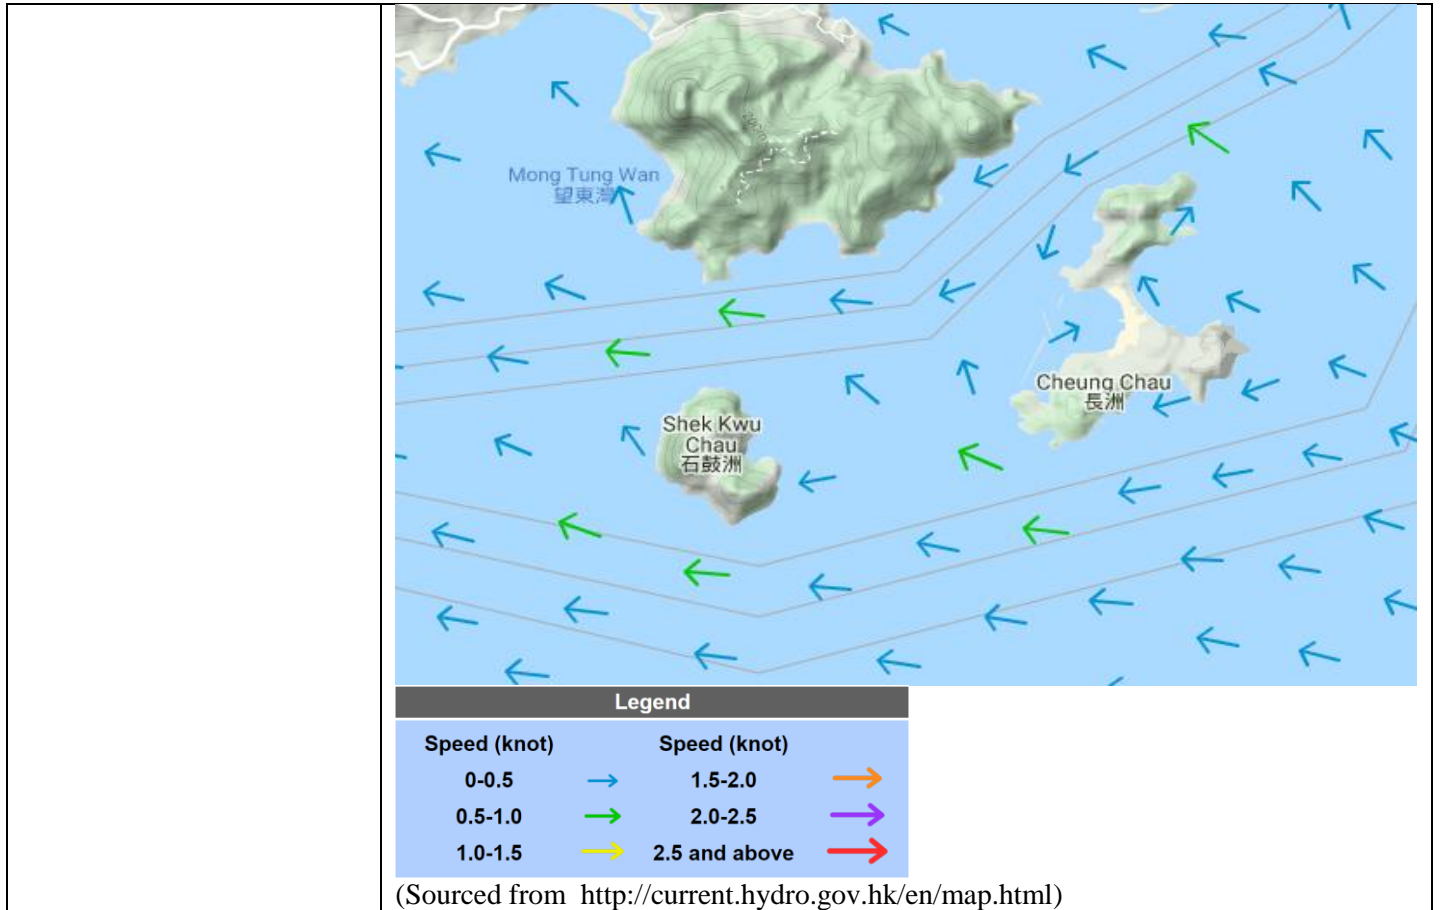

Prepared by	Joe Ho
Date	11 Dec 2020


Incident Report on Action Level or Limit Level Non-compliance

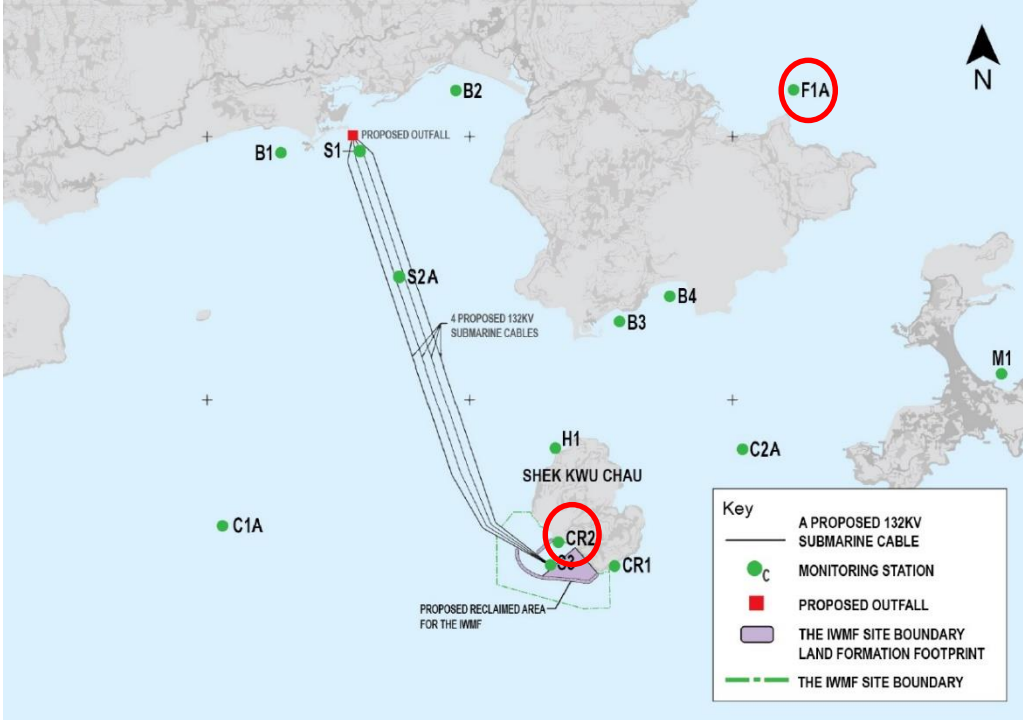Project	Integrated Waste Management Facilities, Phase 1		
Date	07 Dec 2020 (Lab result received on 10 Dec 2020)		
Time	15:15 – 18:45 (Mid Ebb)		
Mid-Ebb			
Monitoring Location	F1A, CR2 		
Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 10.2 mg/L (120% of C1A)		≥ 11.1 mg/L (130% of C1A)
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	12.2 mg/L (F1A) 11.3 mg/L (CR2)	8.5 mg/L (C1A) 10.0 mg/L (C2A)	9.8 mg/L (B1) 10.0 mg/L (B2) 7.5 mg/L (B3) 7.3 mg/L (B4) 9.8 mg/L (H1) 10.0 mg/L (M1) 9.8 mg/L (CR1)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 07 Dec 2020 include reclamation works, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Northwest to Southeast at waters around Shek Kwu Chau.</p> <p>F1A is located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedance of this monitoring station is deemed to be unrelated to the Project.</p> <p>CR2 is located close to the works location within the Project site while silt curtain checking by the Contractor was implemented on Marine Access (07 Dec 2020, 10:00am) and checking results showed that no deficiency of silt curtain was found on that day.</p>		

From MMO monitoring records on 07 Dec 2020, MMO team was arranged for one derrick barge (DL-9) and silt curtain at western marine access area on that day while no deficiency of silt curtain was found before the commencement of and during construction activity.


According to the field observation by Marine Mammal Observer team & sampling team during sampling event, no silt plume was observed in the Project site.

Site tidiness in the present barges in the Project site were checked during weekly site inspection on 01 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.

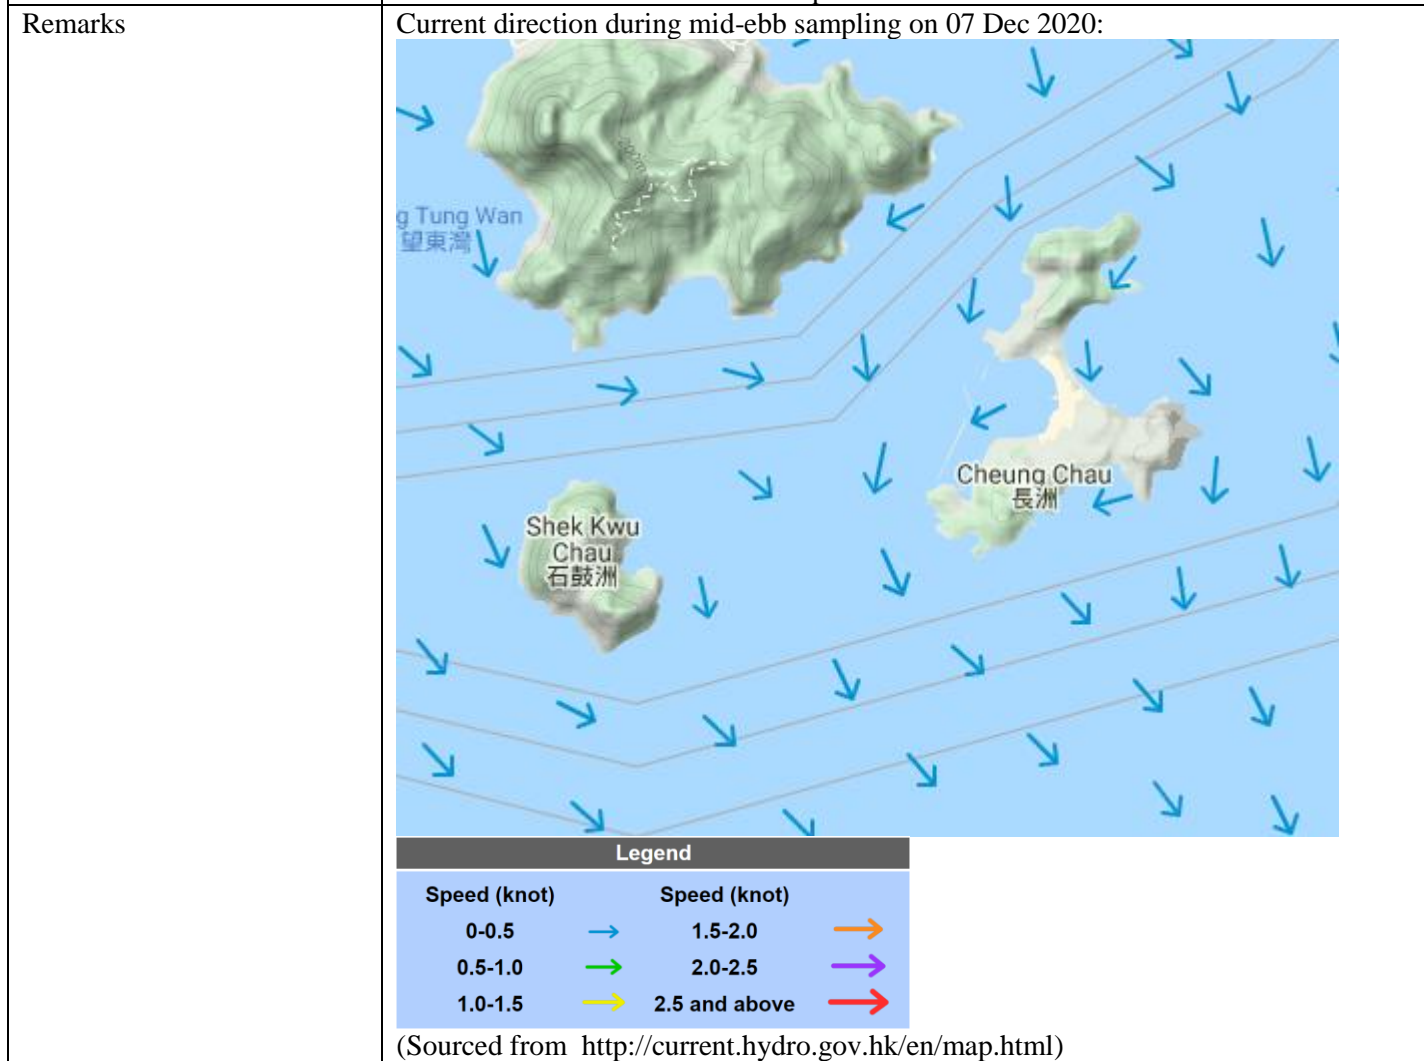

Prepared by	Joe Ho
Date	23 Dec 2020

Incident Report on Action Level or Limit Level Non-compliance

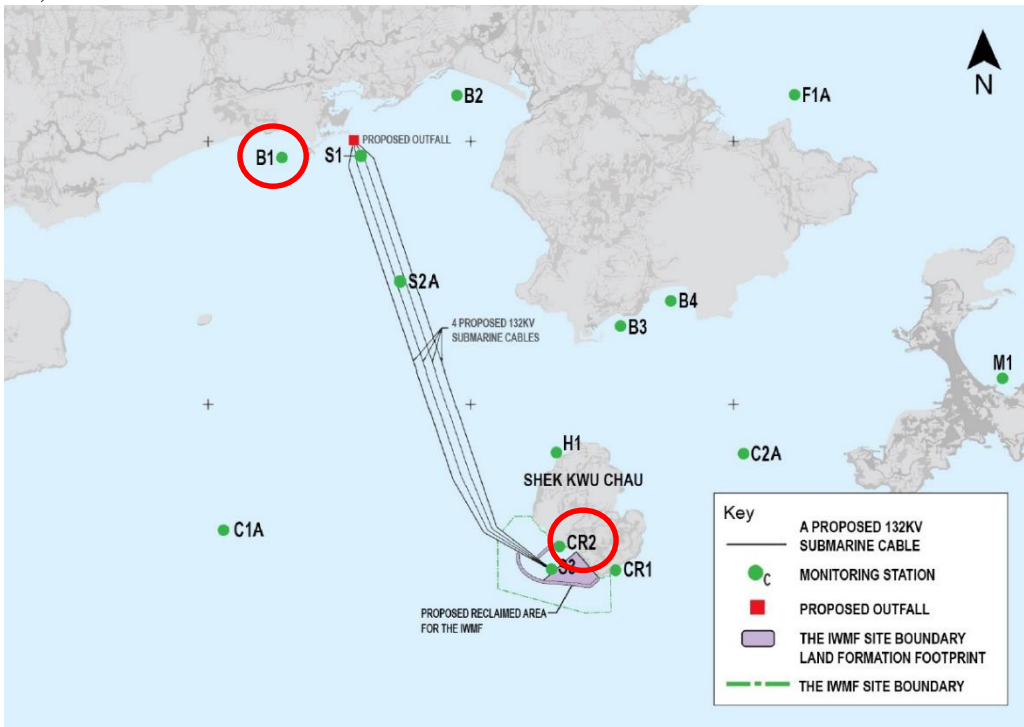
Project	Integrated Waste Management Facilities, Phase 1		
Date	16 Dec 2020 (Lab result received on 21 Dec 2020)		
Time	12:00 – 15:30 (Mid-Ebb) 08:00 – 11:30 (Mid Flood)		
Mid-Ebb			
Monitoring Location	B1, CR2 		
Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 9.0 mg/L (120% of C1A)		≥ 10.0 mg/L
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	9.0 mg/L (B1) 9.3 mg/L (CR2)	7.5 mg/L (C1A) 9.0 mg/L (C2A)	7.0 mg/L (B2) 6.5 mg/L (B3) 6.8 mg/L (B4) 8.0 mg/L (F1A) 6.5 mg/L (H1) 7.0 mg/L (M1) 6.8 mg/L (CR1)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 16 Dec 2020 include reclamation works, loading platform at caissons No.36/37, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Northwest to Southeast at waters around Shek Kwu Chau.</p> <p>B1 is located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedances of these monitoring stations are deemed to be unrelated to the Project.</p> <p>As levelling of G200 rockfill at Seawall B in the vicinity of marine access by diver was conducted at marine access on 16 Dec 2020, silt curtain at marine access was remained open on 16 Dec 2020. No public fill laying work was conducted below the sea level on 16 Dec 2020. No silt curtain checking was implemented by Contractor.</p>		

On 16 Dec 2020, Marine Mammal Observer (MMO) team stood by on one derrick barge (金盈 8). According to the field observation by MMO team & sampling team during sampling event, no silt plume was observed outside the seawall and marine access opening, no silt plume was observed during the water sampling at CR2, which is the closest sampling point near the marine access. (Supporting photos 1,2&3).


Similar work schedule was found on 18 Dec 2020. However, no exceedance was found at monitoring location CR2 on 18 Dec 2020. The exceedance at CR2 on 16 Dec 2020 might not be caused by the construction work within the site boundary.

Site tidiness in the present barges in the Project site were checked during weekly site inspection on 08 Dec 2020, soil was found on the edge of the barge. The deficiency has been rectified by Contractor immediately.


Mid-Flood

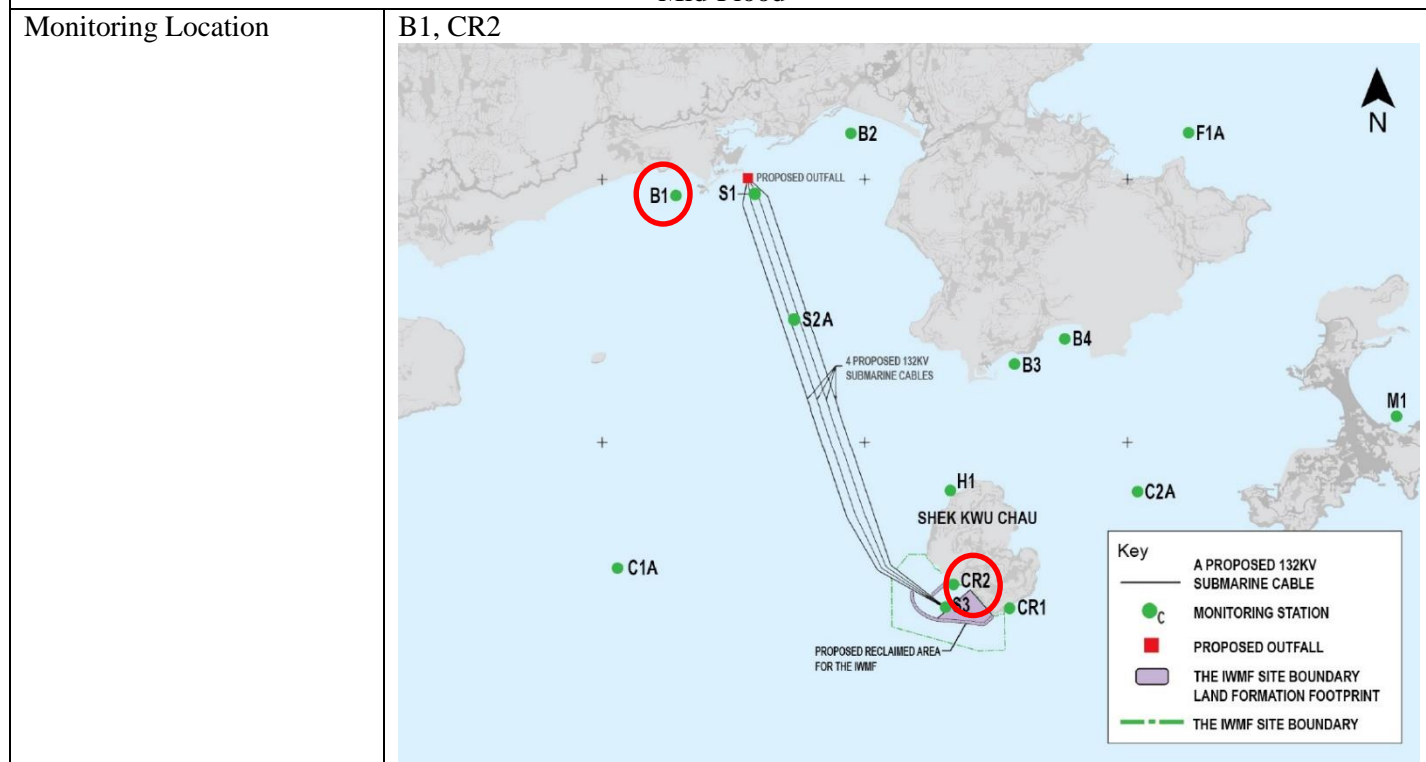

Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 8.0 mg/L		≥ 10.0 mg/L
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	8.0 mg/L (B1) 8.2 mg/L (CR2)	6.7 mg/L (C1A) 5.5 mg/L (C2A)	6.0 mg/L (B2) 6.5 mg/L (B3) 7.3 mg/L (B4) 6.0 mg/L (F1A) 6.3 mg/L (H1) 6.3 mg/L (M1) 7.7 mg/L (CR1)
Possible reason for Action or Limit Level Non-compliance	Works scheduled on site on 16 Dec 2020 include reclamation works, loading platform at caissons No.36/37, laying of rockfill and caisson installation.		
	Dominating sea current direction was found to be from Southeast to Northwest at waters around Shek Kwu Chau.		
	B1 is located at unrelated stream direction (neither upstream nor downstream, far		

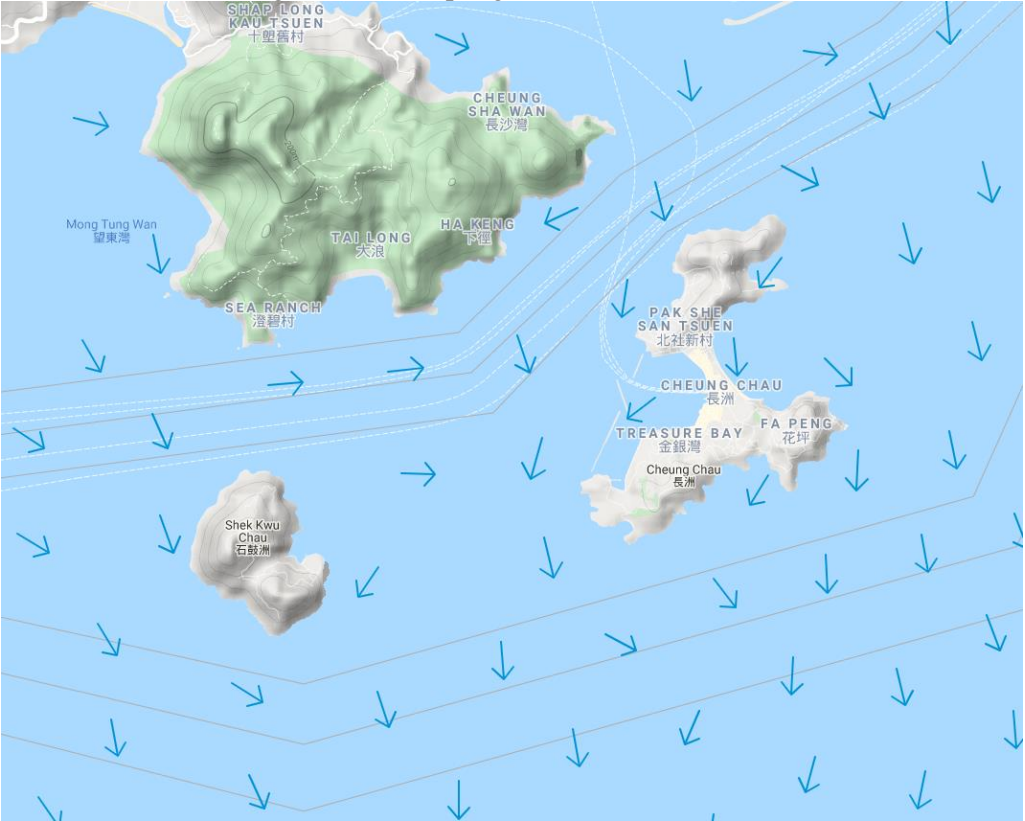
	<p>away) to the works location, exceedances of these monitoring stations are deemed to be unrelated to the Project.</p> <p>As levelling of G200 rockfill at Seawall B in the vicinity of marine access by diver was conducted at marine access on 16 Dec 2020, silt curtain at marine access was remained open on 16 Dec 2020. No public fill laying work was conducted below the sea level on 16 Dec 2020. No silt curtain checking was implemented by Contractor.</p> <p>On 16 Dec 2020, Marine Mammal Observer (MMO) team stood by on one derrick barge (金盈 8). According to the field observation by MMO team & sampling team during sampling event, no silt plume was observed outside the seawall and marine access opening, no silt plume was observed during the water sampling at CR2 which is the closest sampling point near the marine access. (Supporting photos 1,2&3).</p> <p>Similar work schedule was found on 18 Dec 2020. However, no exceedance was found at monitoring location CR2 on 18 Dec 2020. The exceedance at CR2 on 16 Dec 2020 might not be caused by the construction work within the site boundary.</p> <p>Site tidiness in the present barges in the Project site were checked during weekly site inspection on 08 Dec 2020, soil was found on the edge of the barge. The deficiency has been rectified by Contractor immediately.</p>
<p>Actions taken / to be taken</p>	<p>Examination of environmental performance of the Project will be continued during the weekly inspection, and the Contractor is reminded to implement all applicable mitigation measures as per the Updated EM&A Manual.</p>
<p>Remarks</p>	<p>Current direction during mid-ebb sampling on 16 Dec 2020:</p> 

Current direction during mid-flood sampling on 16 Dec 2020:

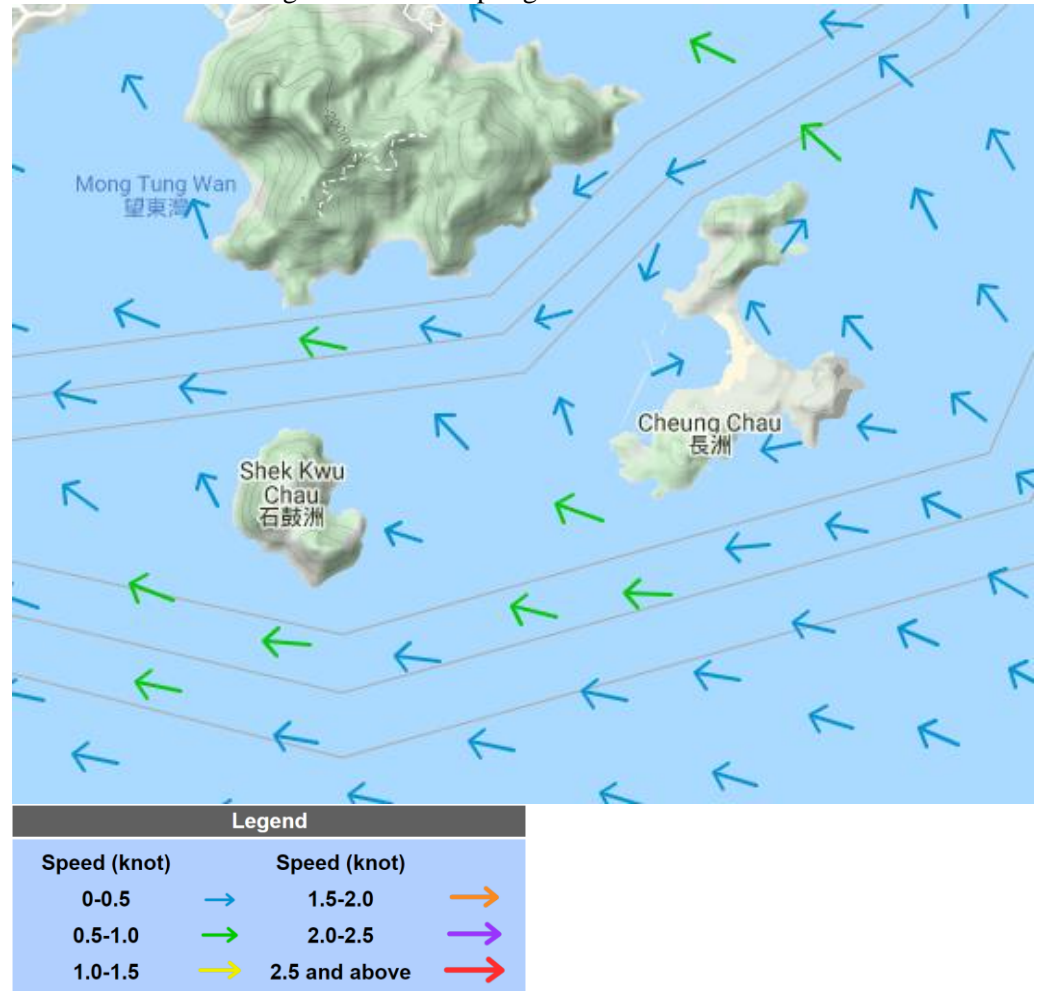

(Sourced from <http://current.hydro.gov.hk/en/map.html>)

Supporting Photo 1 (Overview photo):

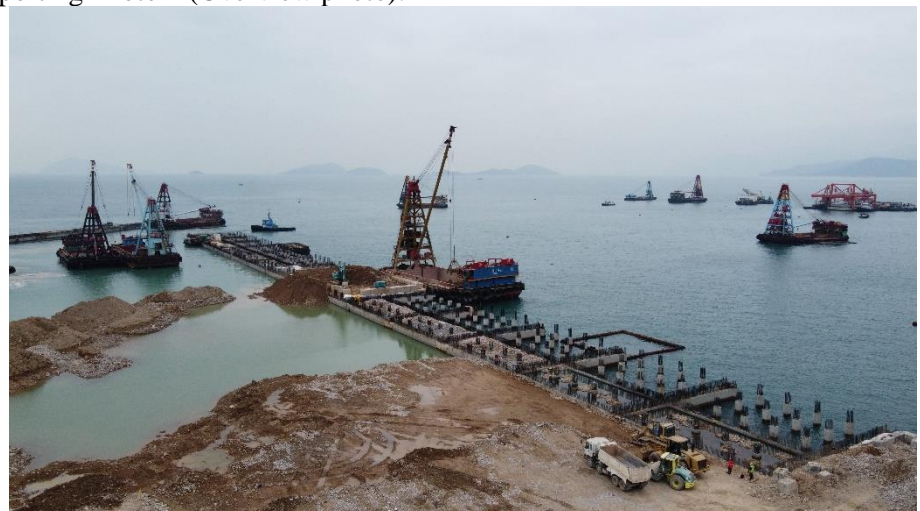

Supporting Photo 2 (Water sampling at CR2 during Mid-ebb):



Supporting Photo 3 (Water sampling at CR2 during Mid-flood):



Prepared by Joe Ho

Date 24 Dec 2020

Incident Report on Action Level or Limit Level Non-compliance


Project	Integrated Waste Management Facilities, Phase 1		
Date	18 Dec 2020 (Lab result received on 23 Dec 2020)		
Time	13:15 – 16:45 (Mid-Ebb) 08:00 – 11:30 (Mid Flood)		
Mid-Ebb			
Monitoring Location	<p>B3</p> <p>The map shows the Shek Kwu Chau area with various monitoring stations marked with green dots. A red square indicates the proposed outfall location. Four lines represent the proposed 132KV submarine cables. A red circle highlights monitoring station B3. A purple shaded area indicates the proposed reclaimed area for the IWMF. A key in the bottom right corner defines the symbols: a line for the proposed 132KV submarine cable, a green dot for a monitoring station, a red square for a proposed outfall, a purple outline for the IWMF site boundary land formation footprint, and a green dashed line for the IWMF site boundary.</p>		
Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 8.8 mg/L (120% of C1A)		≥ 10.0 mg/L
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	9.0 mg/L (B3)	7.3 mg/L (C1A) 7.3 mg/L (C2A)	7.3 mg/L (B1) 8.0 mg/L (B2) 8.0 mg/L (B4) 6.8 mg/L (F1A) 8.2 mg/L (H1) 5.3 mg/L (M1) 5.8 mg/L (CR1) 5.3 mg/L (CR2)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 18 Dec 2020 include reclamation works, loading platform at caissons No.36/37, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Northwest to Southeast at waters around Shek Kwu Chau.</p> <p>B3 is located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedances of these monitoring stations are deemed to be unrelated to the Project.</p> <p>As levelling of G200 rockfill at Seawall B in the vicinity of marine access by diver was conducted at marine access on 18 Dec 2020, silt curtain at marine access was remained open on 18 Dec 2020. No public fill laying work was conducted below the</p>		

sea level on 18 Dec 2020. No silt curtain checking was implemented by Contractor. However, no exceedance was found at monitoring location CR2 (the closest monitoring location near marine access).

On 18 Dec 2020, Marine Mammal Observer (MMO) team stood by on one derrick barge (金盈 8). According to the field observation by MMO team & sampling team during sampling event, no silt plume was observed outside the seawall and marine access opening

Site tidiness in the present barges in the Project site were checked during weekly site inspection on 17 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.

Mid-Flood

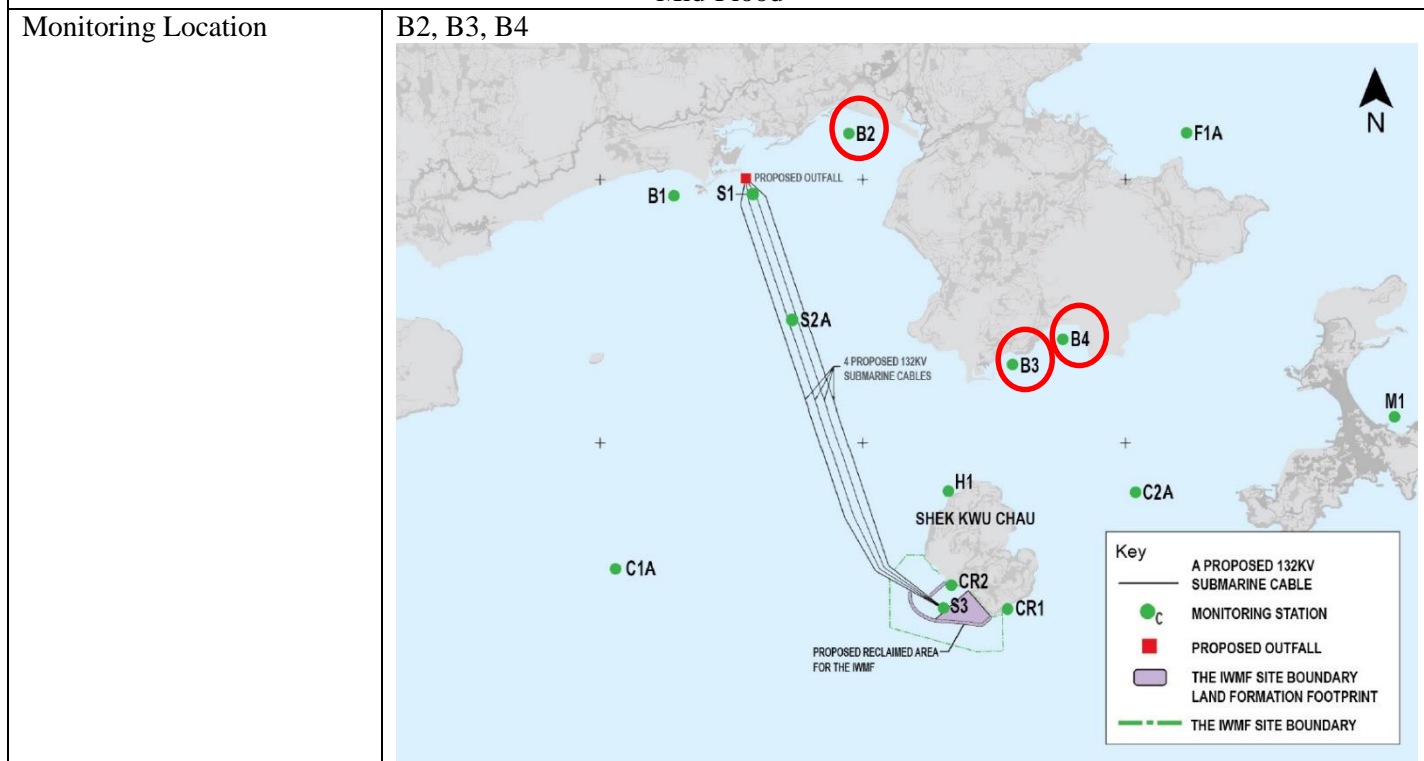



Parameter	Suspended Solid (SS)		
-----------	----------------------	--	--

Action & Limit Levels	Action Level	Limit Level	
	≥ 8.0 mg/L	≥ 10.0 mg/L	

Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	9.8 mg/L (B2) 10.0 mg/L (B3) 9.8mg/L (B4)	7.8 mg/L (C1A) 5.2 mg/L (C2A)	6.0 mg/L (B1) 5.8 mg/L (F1A) 7.0 mg/L (H1) 5.3 mg/L (M1) 4.7 mg/L (CR1) 4.8 mg/L (CR2)

Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 18 Dec 2020 include reclamation works, loading platform at caissons No.36/37, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Southeast to Northwest at waters around Shek Kwu Chau.</p> <p>B2, B3 & B4 are located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedance of this monitoring station is deemed to be unrelated to the Project.</p>		
--	--	--	--

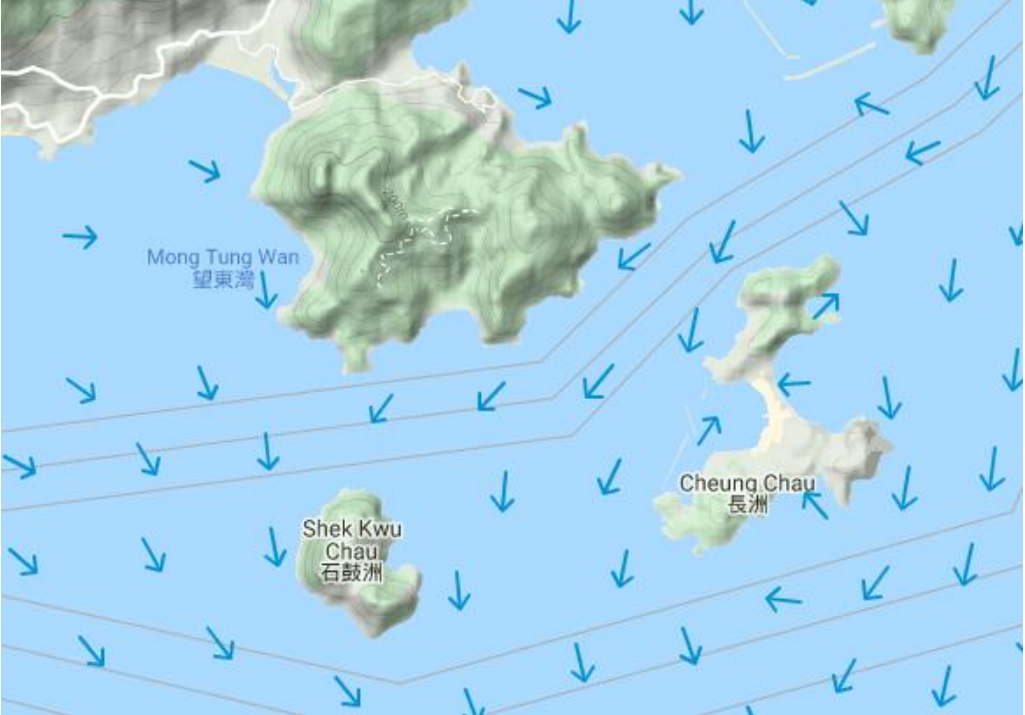
	<p>As levelling of G200 rockfill at Seawall B in the vicinity of marine access by diver was conducted at marine access on 18 Dec 2020, silt curtain at marine access was remained open on 18 Dec 2020. No public fill laying work was conducted below the sea level on 18 Dec 2020. No silt curtain checking was implemented by Contractor. However, no exceedance was found at monitoring location CR2 (the closest monitoring location near marine access).</p> <p>On 18 Dec 2020, Marine Mammal Observer (MMO) team stood by on one derrick barge (金盈 8). According to the field observation by MMO team & sampling team during sampling event, no silt plume was observed outside the seawall and marine access opening</p> <p>Site tidiness in the present barges in the Project site were checked during weekly site inspection on 17 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.</p>
<p>Actions taken / to be taken</p>	<p>Examination of environmental performance of the Project will be continued during the weekly inspection, and the Contractor is reminded to implement all applicable mitigation measures as per the Updated EM&A Manual.</p>
<p>Remarks</p>	<p>Current direction during mid-ebb sampling on 18 Dec 2020:</p>  <p>Current direction during mid-flood sampling on 18 Dec 2020:</p>

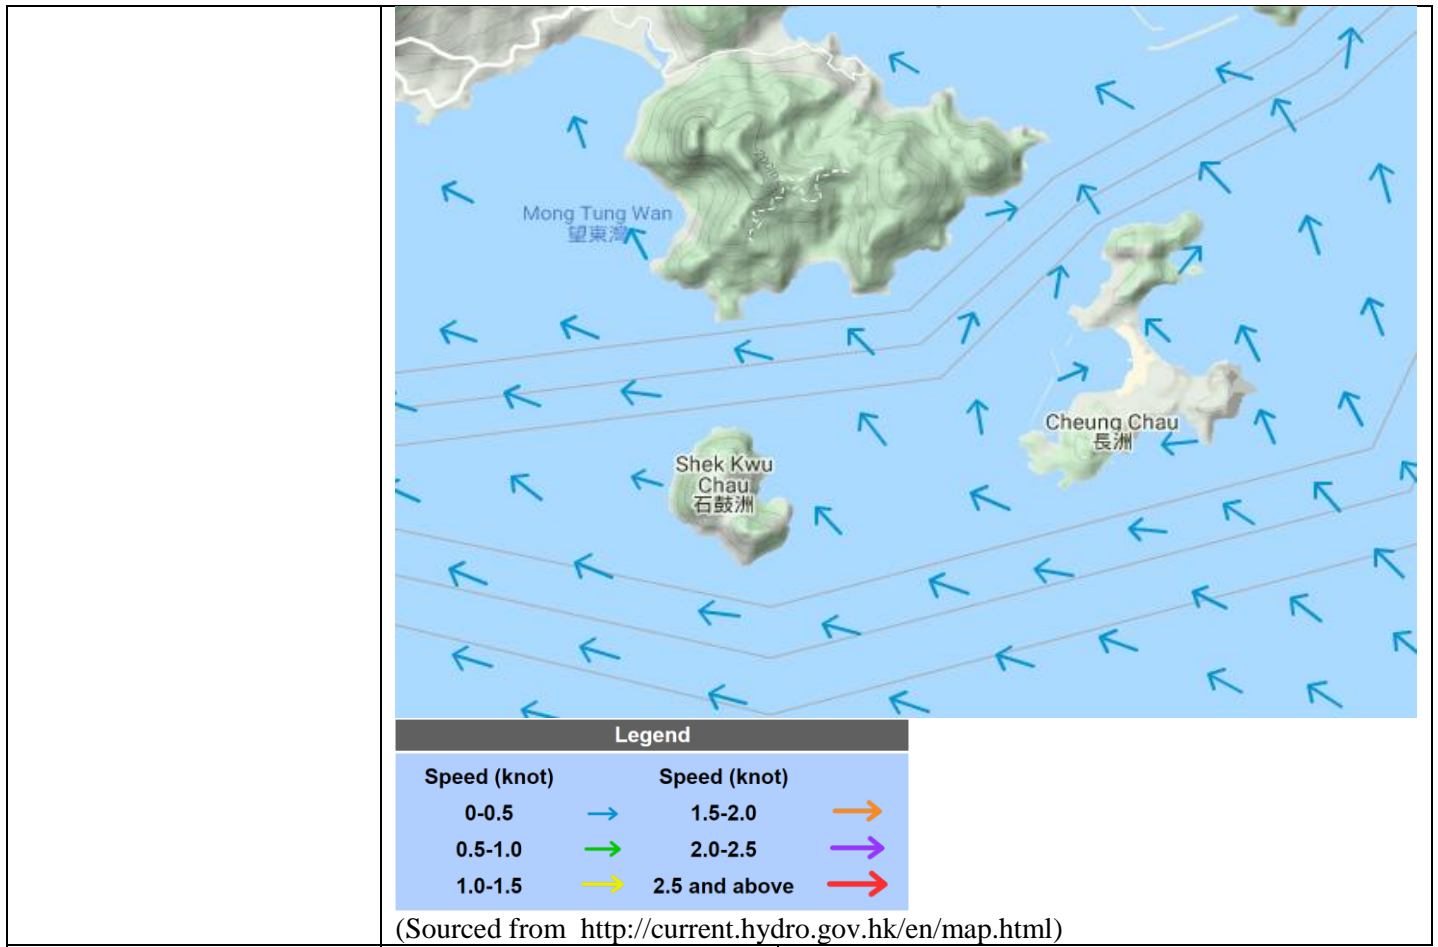

Prepared by	Joe Ho
Date	24 Dec 2020

Incident Report on Action Level or Limit Level Non-compliance

Project	Integrated Waste Management Facilities, Phase 1		
Date	22 Dec 2020 (Lab result received on 28 Dec 2020)		
Time	08:00 – 11:30 (Mid-Ebb)		
Monitoring Location	Mid-Ebb		
Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 8.0 mg/L		≥ 10.0 mg/L
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	9.0 mg/L (B3)	5.7 mg/L (C1A) 5.7 mg/L (C2A)	5.8 mg/L (B1) 5.5 mg/L (B2) 5.0 mg/L (B4) 6.7 mg/L (F1A) 6.7 mg/L (H1) 7.0 mg/L (M1) 5.3 mg/L (CR1) 5.0 mg/L (CR2)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 22 Dec 2020 include reclamation works, laying Geotextiles, loading platform at caissons No.36/37, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Northwest to Southeast at waters around Shek Kwu Chau.</p> <p>B3 is located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedance of this monitoring station is deemed to be unrelated to the Project.</p> <p>Silt curtain checking by the Contractor was implemented on Marine Access (22 Dec 2020, 01:00pm) and checking results showed that no deficiency of silt curtain was found on that day.</p>		

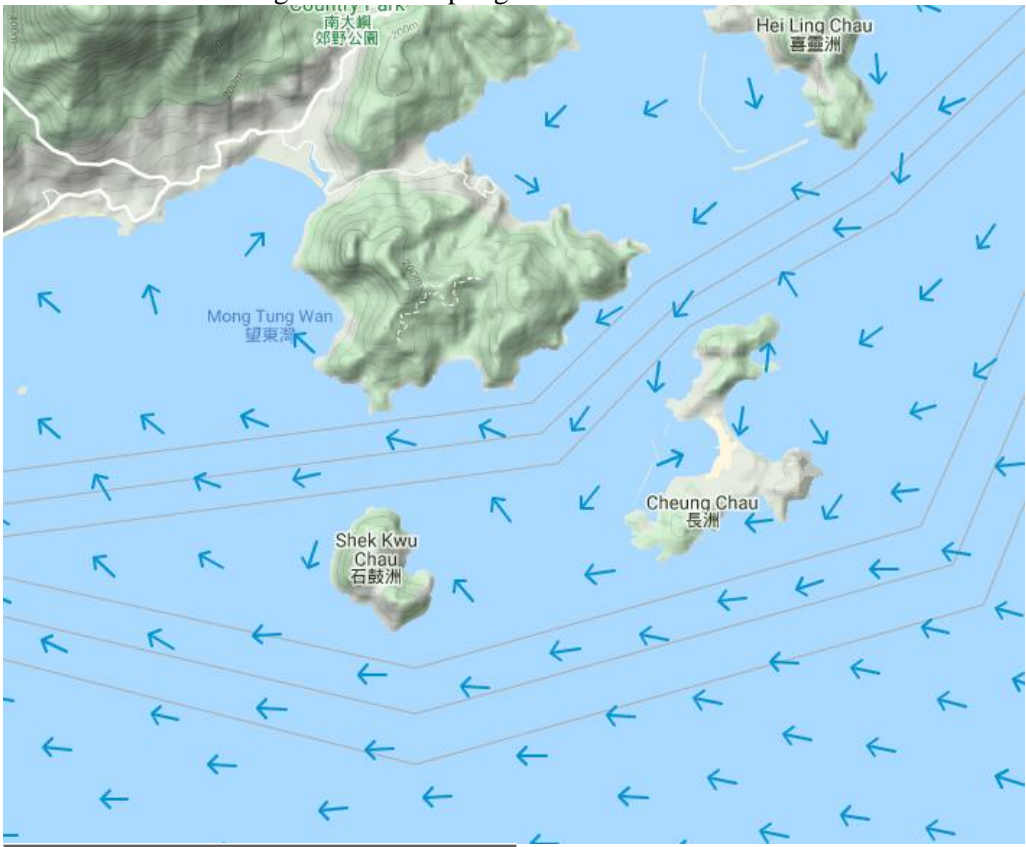	<p>From MMO monitoring records on 22 Dec 2020, MMO team was arranged for one derrick barge (金盈 8) and silt curtain at western marine access area on that day while no deficiency of silt curtain was found before the commencement of and during construction activity.</p> <p>According to the field observation by Marine Mammal Observer team & sampling team during sampling event, no silt plume was observed in the Project site.</p> <p>Site tidiness in the present barges in the Project site were checked during weekly site inspection on 22 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.</p>																				
<p>Remarks</p>	<p>Current direction during mid-ebb sampling on 22 Dec 2020:</p>  <table border="1" data-bbox="470 1489 986 1675"> <thead> <tr> <th colspan="4">Legend</th> </tr> <tr> <th>Speed (knot)</th> <th>Color</th> <th>Speed (knot)</th> <th>Color</th> </tr> </thead> <tbody> <tr> <td>0-0.5</td> <td>Blue</td> <td>1.5-2.0</td> <td>Orange</td> </tr> <tr> <td>0.5-1.0</td> <td>Green</td> <td>2.0-2.5</td> <td>Purple</td> </tr> <tr> <td>1.0-1.5</td> <td>Yellow</td> <td>2.5 and above</td> <td>Red</td> </tr> </tbody> </table> <p>(Sourced from http://current.hydro.gov.hk/en/map.html)</p>	Legend				Speed (knot)	Color	Speed (knot)	Color	0-0.5	Blue	1.5-2.0	Orange	0.5-1.0	Green	2.0-2.5	Purple	1.0-1.5	Yellow	2.5 and above	Red
Legend																					
Speed (knot)	Color	Speed (knot)	Color																		
0-0.5	Blue	1.5-2.0	Orange																		
0.5-1.0	Green	2.0-2.5	Purple																		
1.0-1.5	Yellow	2.5 and above	Red																		
<p>Prepared by</p>	<p>Joe Ho</p>																				
<p>Date</p>	<p>05 Jan 2021</p>																				

Incident Report on Action Level or Limit Level Non-compliance

Project	Integrated Waste Management Facilities, Phase 1		
Date	30 Dec 2020 (Lab result received on 04 Jan 2021)		
Time	10:15 – 13:45 (Mid-Ebb)		
Monitoring Location	Mid-Ebb		
Parameter	Suspended Solid (SS)		
Action & Limit Levels	Action Level		Limit Level
	≥ 10.4 mg/L (120% of C1A)		≥ 11.3 mg/L (130% of C1A)
Measurement Level	Impact Station(s) of Exceedance	Control Stations	Impact Station(s) without Exceedance
	11.0 mg/L (F1A)	8.7 mg/L (C1A) 9.2 mg/L (C2A)	7.5 mg/L (B1) 8.3 mg/L (B2) 7.5 mg/L (B3) 6.8 mg/L (B4) 8.3 mg/L (H1) 7.8 mg/L (M1) 9.8 mg/L (CR1) 9.0 mg/L (CR2)
Possible reason for Action or Limit Level Non-compliance	<p>Works scheduled on site on 30 Dec 2020 include reclamation works, laying concrete block at A2/A3 loading platform, laying of rockfill and caisson installation.</p> <p>Dominating sea current direction was found to be from Northwest to Southeast at waters around Shek Kwu Chau.</p> <p>F1A is located at unrelated stream direction (neither upstream nor downstream, far away) to the works location, exceedance of this monitoring station is deemed to be unrelated to the Project.</p> <p>Silt curtain checking by the Contractor was implemented on Marine Access (30 Dec 2020, 11:30am) and checking results showed that no deficiency of silt curtain was found on that day.</p>		


From MMO monitoring records on 30 Dec 2020, MMO team was arranged for one derrick barge (金盈 8)) and silt curtain at western marine access area on that day while no deficiency of silt curtain was found before the commencement of and during construction activity.

According to the field observation by Marine Mammal Observer team & sampling team during sampling event, no silt plume was observed in the Project site.

Site tidiness in the present barges in the Project site were checked during weekly site inspection on 29 Dec 2020. No major observation of improper site practices that could contribute to the increase of the suspended solids recorded.

Remarks

Current direction during mid-ebb sampling on 30 Dec 2020:

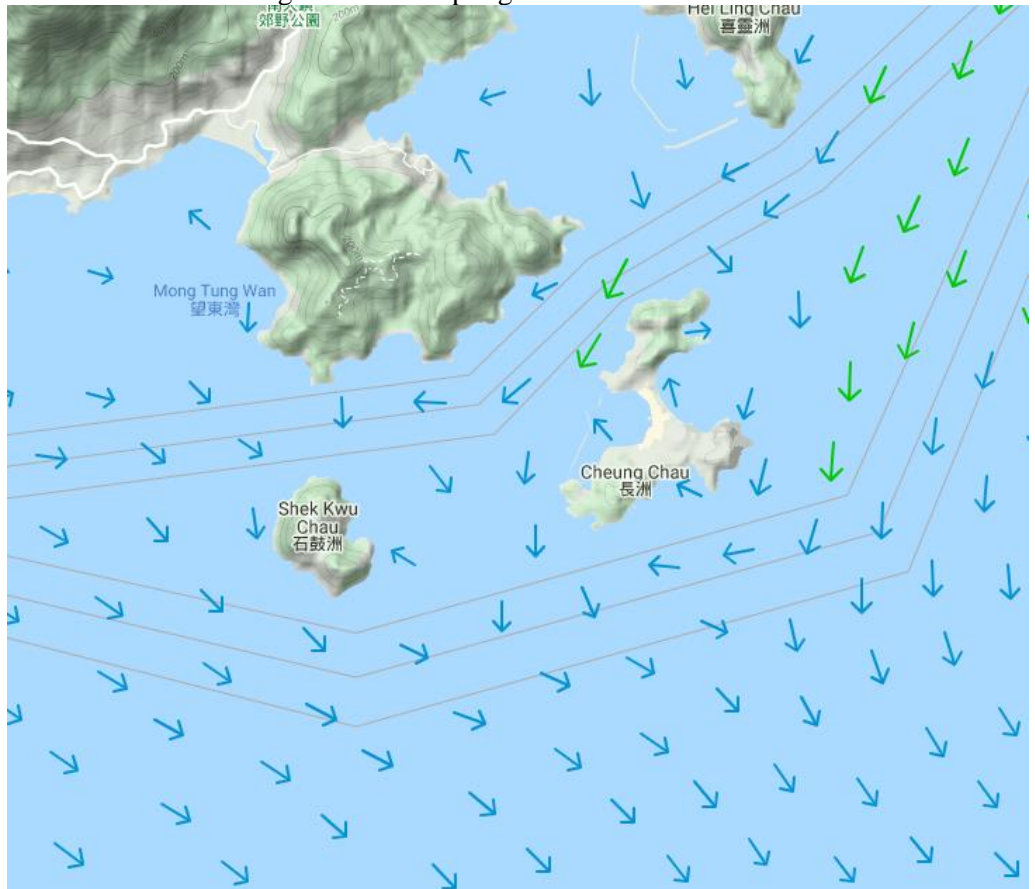

Legend	
Speed (knot)	Speed (knot)
0-0.5	1.5-2.0
0.5-1.0	2.0-2.5
1.0-1.5	2.5 and above

(Sourced from <http://current.hydro.gov.hk/en/map.html>)

Prepared by	Joe Ho
Date	06 Jan 2021

Appendix O Complaint Log

Statistical Summary of Environmental Complaints

Reporting Period	Environmental Complaint Statistics		
	Frequency	Cumulative	Complaint Nature
1 Dec 2020- 31 Dec 2020	0	0	N/A

Statistical Summary of Environmental Summons

Reporting Period	Environmental Summons Statistics		
	Frequency	Cumulative	Details
1 Dec 2020- 31 Dec 2020	0	0	N/A

Statistical Summary of Environmental Prosecution

Reporting Period	Environmental Prosecution Statistics		
	Frequency	Cumulative	Details
1 Dec 2020- 31 Dec 2020	0	0	N/A

Appendix P Impact Monitoring Schedule of Next Reporting Month

Impact Monitoring Schedule for IWMF
Jan-21

Sun	Mon	Tue	Wed	Thu	Fri	Sat
					1	2 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 12:48 - 16:00 Flood Tide: 06:00 - 12:48 Monitoring Time: Mid-ebb: 11:30 - 17:00 *Mid-flood: 08:00 - 11:30
3	4 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 14:33 - 18:07 Flood Tide: 07:18 - 14:33 Monitoring Time: Mid-ebb: 14:35 - 18:05 Mid-flood: 09:10 - 12:40 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3	5 Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3	6 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 16:00 - 20:34 Flood Tide: 08:50 - 16:00 Monitoring Time: &Mid-ebb: 15:30 - 19:00 Mid-flood: 10:40 - 14:10	7 Impact Ecology monitoring for WBSE	8	9 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 07:00 - 11:00 Flood Tide: 11:00 - 18:19 Monitoring Time: *Mid-ebb: 08:00 - 11:30 Mid-flood: 12:54 - 16:24
10	11 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 09:29 - 12:58 Flood Tide: 12:58 - 19:34 Monitoring Time: Mid-ebb: 09:28 - 12:58 & Mid-flood: 14:31 - 18:01 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3	12 Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3	13 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 11:00 - 14:34 Flood Tide: 14:34 - 21:00 Monitoring Time: Mid-ebb: 11:02 - 14:32 &Mid-flood: 15:30 - 19:00	14 Impact Ecology monitoring for WBSE	15 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 12:24 - 16:02 Flood Tide: 05:24 - 12:24 Monitoring Time: Mid-ebb: 12:28 - 15:58 * Mid-flood: 08:00 - 11:30	16
17	18 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 14:00 - 18:15 Flood Tide: 07:00 - 14:00 Monitoring Time: Mid-ebb: 14:22 - 17:52 & Mid-flood: 08:45 - 12:15 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3 Ecology monitoring for Marine Mammals by Vessel-based Line-Transsect Survey	19 Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3	20 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 08:00 - 16:00 Flood Tide: 16:00 - 20:27 Monitoring Time: * Mid-ebb: 16:28 - 19:58 Mid-flood: 10:15 - 13:45	21 Impact Ecology monitoring for WBSE	22 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 03:10 - 09:00 Flood Tide: 09:00 - 17:35 Monitoring Time: * Mid-ebb: 08:00 - 11:30 Mid-flood: 13:02 - 16:32	23
24	25 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 08:00 - 12:00 Flood Tide: 12:00 - 18:44 Monitoring Time: Mid-ebb: 08:15 - 11:45 Mid-flood: 13:37 - 17:07 Daytime, Evening & Night time Noise monitoring for M1, M2 & M3 Ecology monitoring for Marine Mammals by Vessel-based Line-Transsect Survey	26 Impact Daytime, Evening & Night time Noise monitoring for M1, M2 & M3	27 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 10:00 - 13:00 Flood Tide: 13:00 - 20:00 Monitoring Time: Mid-ebb: 09:45 - 13:15 Mid-flood: 14:45 - 18:15	28 Impact Ecology monitoring for WBSE	29 Impact Water Quality monitoring for B1, B2, B3, B4, H1, C1A, C2A, F1A, CR1, CR2, M1 Tidal Period: Ebb Tide: 11:00 - 15:00 Flood Tide: 15:00 - 21:00 Monitoring Time: Mid-ebb: 11:15 - 14:45 &Mid-flood: 15:30 - 19:00	30
31						

Remarks:
1. Daytime Noise Monitoring (07:00-19:00), Evening Time Noise Monitoring (19:00-23:00), Night Time Noise Monitoring (23:00-07:00)
2. Water Quality Monitoring for S1, S2 and S3 will only conduct during DCM works, refer to Detailed DCM Plan

Note:
* - as per Marine Department Notice No 107 of 2018, all vessels employed for the works should stay in the works area outside the hours of works (07:00 to 23:00). Due to safety concern, Water Quality Monitoring would start at 08:00.
- Prioritized routing: Mid-Ebb: C1→S3→CR2→CR1→H1→Remaining stations and Mid-Flood: C2→CR1→S3→CR2→H1→Remaining stations
\$ - Since predicted tide is shorter than 3.5 hours, method of 90% tidal period as monitoring time is approached.
& - Due to safety concern for sampling event in night-time, method of 90% tidal period as monitoring time is approached and end at 19:00.